

# LAND CORNER RECORD

T 4 N, R 8 East, W.M. Skamania County  
 Segregated Surveys: Corner Code No. 2-5  
 Name: n/a Corner No.: n/a  
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:  
 Originally set by G.L.O. surveyor, Robert A. Webster, in 1896.  
 No restoration found.

2. Description of Evidence Found:  
 18" Fir B.T. snag at N 82 W, 82.5 feet from corner position.  
 42" Fir B.T. at N 52 E, 9.73 feet from corner position.  
 19" Fir B.T. with visible scribe at S 69 E, 32.0 feet from corner position.  
 46" Fir B.T. at West 10.27 feet from corner position.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 600-22 Page No. 57 Date of work 11-18-82

Shown on D.N.R. Final Map #462. See corner diagram on reverse side.

On 11-18-82, the D.N.R. set a standard D.N.R. iron pipe with stamped brass cap at intersection of record distances from live B.T.'s (distances measured from B.T. faces).



Washington Plane Coordinates: South Zone, Y 166,637.57 X 1,659,531.07  
 3rd Order Accuracy. Derived From: 1975 Olson Eng. survey data at S.W. corner Sec. 5 (Recorded in Bk 1 page 54, Records of Skamania County)  
 Pin Pointed on Photo No. Date Located at

### SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date Sept. 29, 1983

Signature M. A. Kinaman Certificate No. 11977



### AUDITOR'S CERTIFICATE


Filed for record this 6th day of OCTOBER, 1983 at 1:45 P.M. In Book 418 of MONUMENTS at page 5 at the request of Washington State Department of Natural Resources

County Auditor

57  
600.27

LAIRD  
GORDON  
BRESSLER

11-18-82

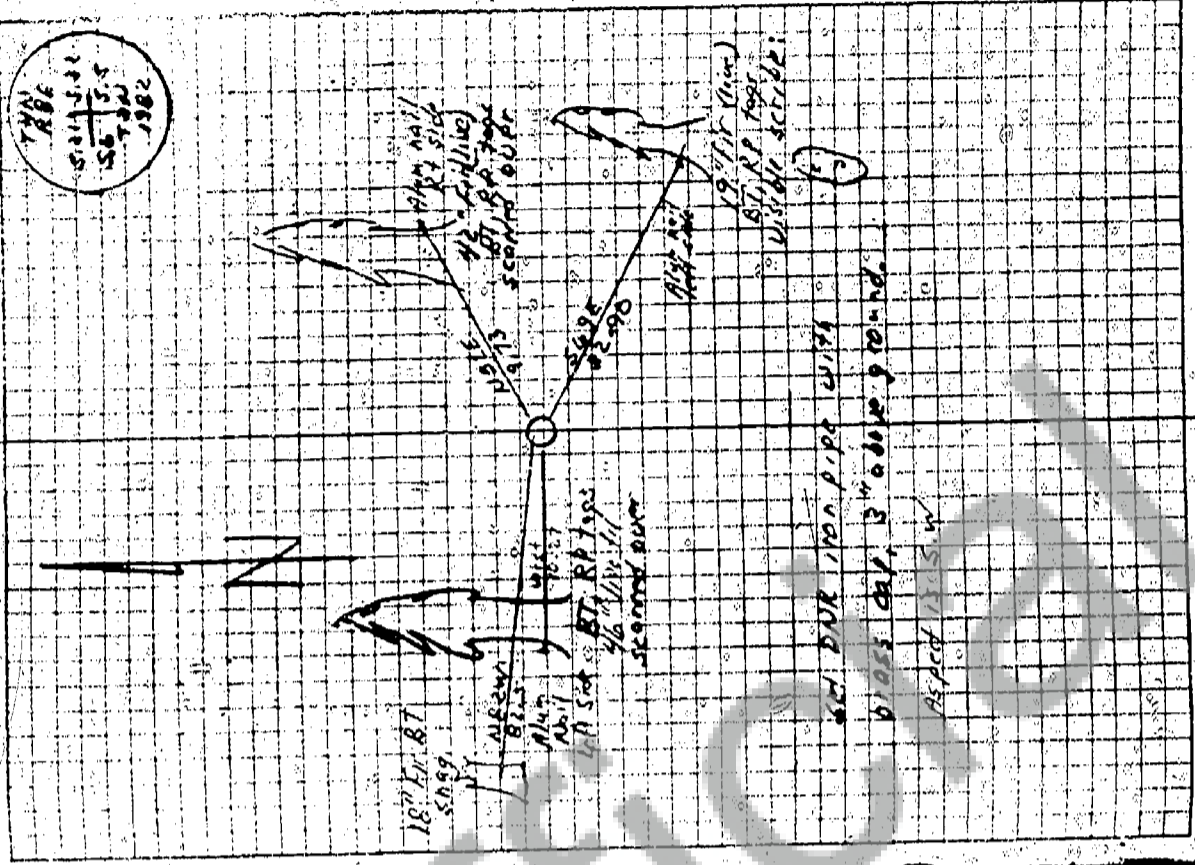

GLO Survey of 1896

East on N boundary Sec 6

78.88 Set post

24" Fir N48E 131.8 8.50'

14" Fir S72E 50L 33.00'

24" Fir West 151.1 9.90'

16" Fir N84W 125L 82.50

Section Corner 73E4N RDE

Found 3 like BT's & 1 rotted BT. S89.  
Opened up the SE BT and found remains  
of scribing on the badly burned face. Did  
not open the other BT's.

Set the pipe & cap by intersecting the  
distances from the BT's faces, allowing  
for growth on the 2 BT's not opened up.  
The pattern won't work by measuring from  
the centers of the BT's.

No other surveys of record

corner is DPE true sta. 125