

131509

BOOK 176 PAGE 826

FILED FOR RECORD  
SKAMANIA CO. WASH  
BY DNR.

MAY 12 2 34 PM '98

*Gary M. Olson*  
AUDITOR  
GARY M. OLSON


DEPARTMENT OF NATURAL RESOURCES  
CENTRAL REGION

LAND CORNER RECORD

GRANTOR/SURVEYOR/PUBLIC OFFICER: This corner record correctly represents work performed by me or under my direction in conformance with the Survey Recording Act.

H. THOMAS LAIRD, JR., PLS

CENTRAL REGIONAL SURVEYOR  
DEPARTMENT OF NATURAL RESOURCES  
1404 RUSH ROAD  
CHEHALIS, WA 98532-8727

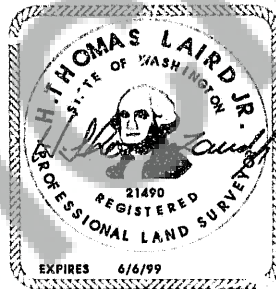

GRANTEE: PUBLIC

DATE SIGNED: May 7, 1998

LEGAL: TWP: 2 NORTH RGE: 5 EAST CORNER CODE: L-1  
ADDITIONAL IDENTIFIER: (BLM designation, street or plat names, block, lot, etc.)

1/4 CORNER COMMON TO SECTIONS 13 AND 18, T2N, R4 AND 5E

COUNTY: SKAMANIA

WASHINGTON PLANE COORDINATES: N: E:

ORDER: ZONE: DATUM (Date of adjustment):

CORNER INFORMATION: Discuss the history, evidence found, and perpetuation of the corner. Diagram the references; provide the date of work; and, if applicable, a reference to a map of record and/or the field book/page no. Use the back, if needed.

Set by U.S. Deputy Surveyor John Trutch in 1857 and marked with a post and two bearing trees: 12" hemlock at S52°E 16 links  
4" vine maple at N67°W 45 links  
No evidence of the the original GLO survey was found.

Found a 2" iron pipe which was used as the 1/4 corner by BPA in 1938 and 1952. The pipe was used on the following surveys recorded in Clark County: Book 12 page 190 and Book 34 page 73. Also on the following surveys recorded in Skamania County: Book 2 page 114 and Book 3 page 255.  
The pipe was accepted as the perpetuation of the GLO corner based on historical use.

On May 5, 1998, a 3/4" X 36" aluminum rod with 3 1/4" stamped magnetic aluminum cap was driven into the found iron pipe. See the reverse side for the references.

In 1988, while surveying inside Section 18 based on the survey in Book 2 page 114, I found an iron pipe in an east-west fence line and erroneously thought it to be the pipe called for in the survey referred to. At that time I epoxied a DNR cap to the pipe and filed LCR's in Clark and Skamania Counties, in Book 2 page 181, and Book 2/5 page 42 respectively. While researching an upcoming project in Section 13 I found an ROS by Terry Trantow in Book 3 page 255 that noted that the DNR cap was not at the 1/4 corner position. Subsequent research proved him correct and on May 5, 1998 the DNR cap was removed from the iron pipe in the east-west fence line using a hack saw. This pipe is N41°E 133.3 feet from the correct 1/4 corner. It is unknown what this pipe represents.

DNR Field Book No. 3021A, page 72. Declination = 19° east.

REMARKS  
INDEXED, L&P  
DIRECT  
FILED

This form is in compliance with the intent of RCW 65.04.045 and prescribed by the Public Land Survey Office, Department of Natural Resources - 1/97.

MARK THE CORNER LOCATION BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE:  
For corners at the intersection of two lines, the corner code is the alphanumeric coordinate that corresponds to the appropriate intersection of lines.

For corners that are only on one line, the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "B" and "C" is designated BC-5.

For corners that are between lines, the corner code is both line segments; i.e., a corner in the SE1/4 of the SE1/4 of section 18 is designated MN 4-5.

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	
A																										A
B																										B
C																										C
D																										D
E																										E
F																										F
G																										G
H																										H
I																										I
J																										J
K																										K
L																										L
M																										M
N																										N
O																										O
P																										P
Q																										Q
R																										R
S																										S
T																										T
U																										U
V																										V
W																										W
X																										X
Y																										Y
Z																										Z

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

## SPACE FOR ADDITIONAL COMMENT:

1/4 13 1/2 18 TAN R 4 1/2 SE

GLO of 1857 John Trutch #24

40.00 Set Post

12" Hemlock @ S52E 16L

4" Pine maple @ N67W 45L

No dir. evidence found

Found 2" iron pipe 37' west of  
E of 1/12th

pipe used on BPA plots 1930 & 1952  
and RDS

Clark Co.

Skamania Co

12-190

2-114

34-73

3-255

Found DNR cap on iron pipe @ N41E  
133' set erroneously in 1988 as per  
LGR's Bk 2 p 121 - Plat 10  
Bk 2 1/2 pg 42 Skamania Co.  
removed cap from pipe

May 5, 1998

Gordon  
Feden  
Daniel  
Dorman  
72  
302 1A  
T2N  
R46E P56  
S13 1/2  
1998

