RECORD OF SURVEY

IN A PORTION OF THE NE 1/4 OF THE SE 1/4 AND THE SE 1/4 OF THE NW 1/4 OF SECTION 8, T3N, R8E, W.M., SKAMANIA COUNTY, WASHINGTON

AUGUST 13, 2012

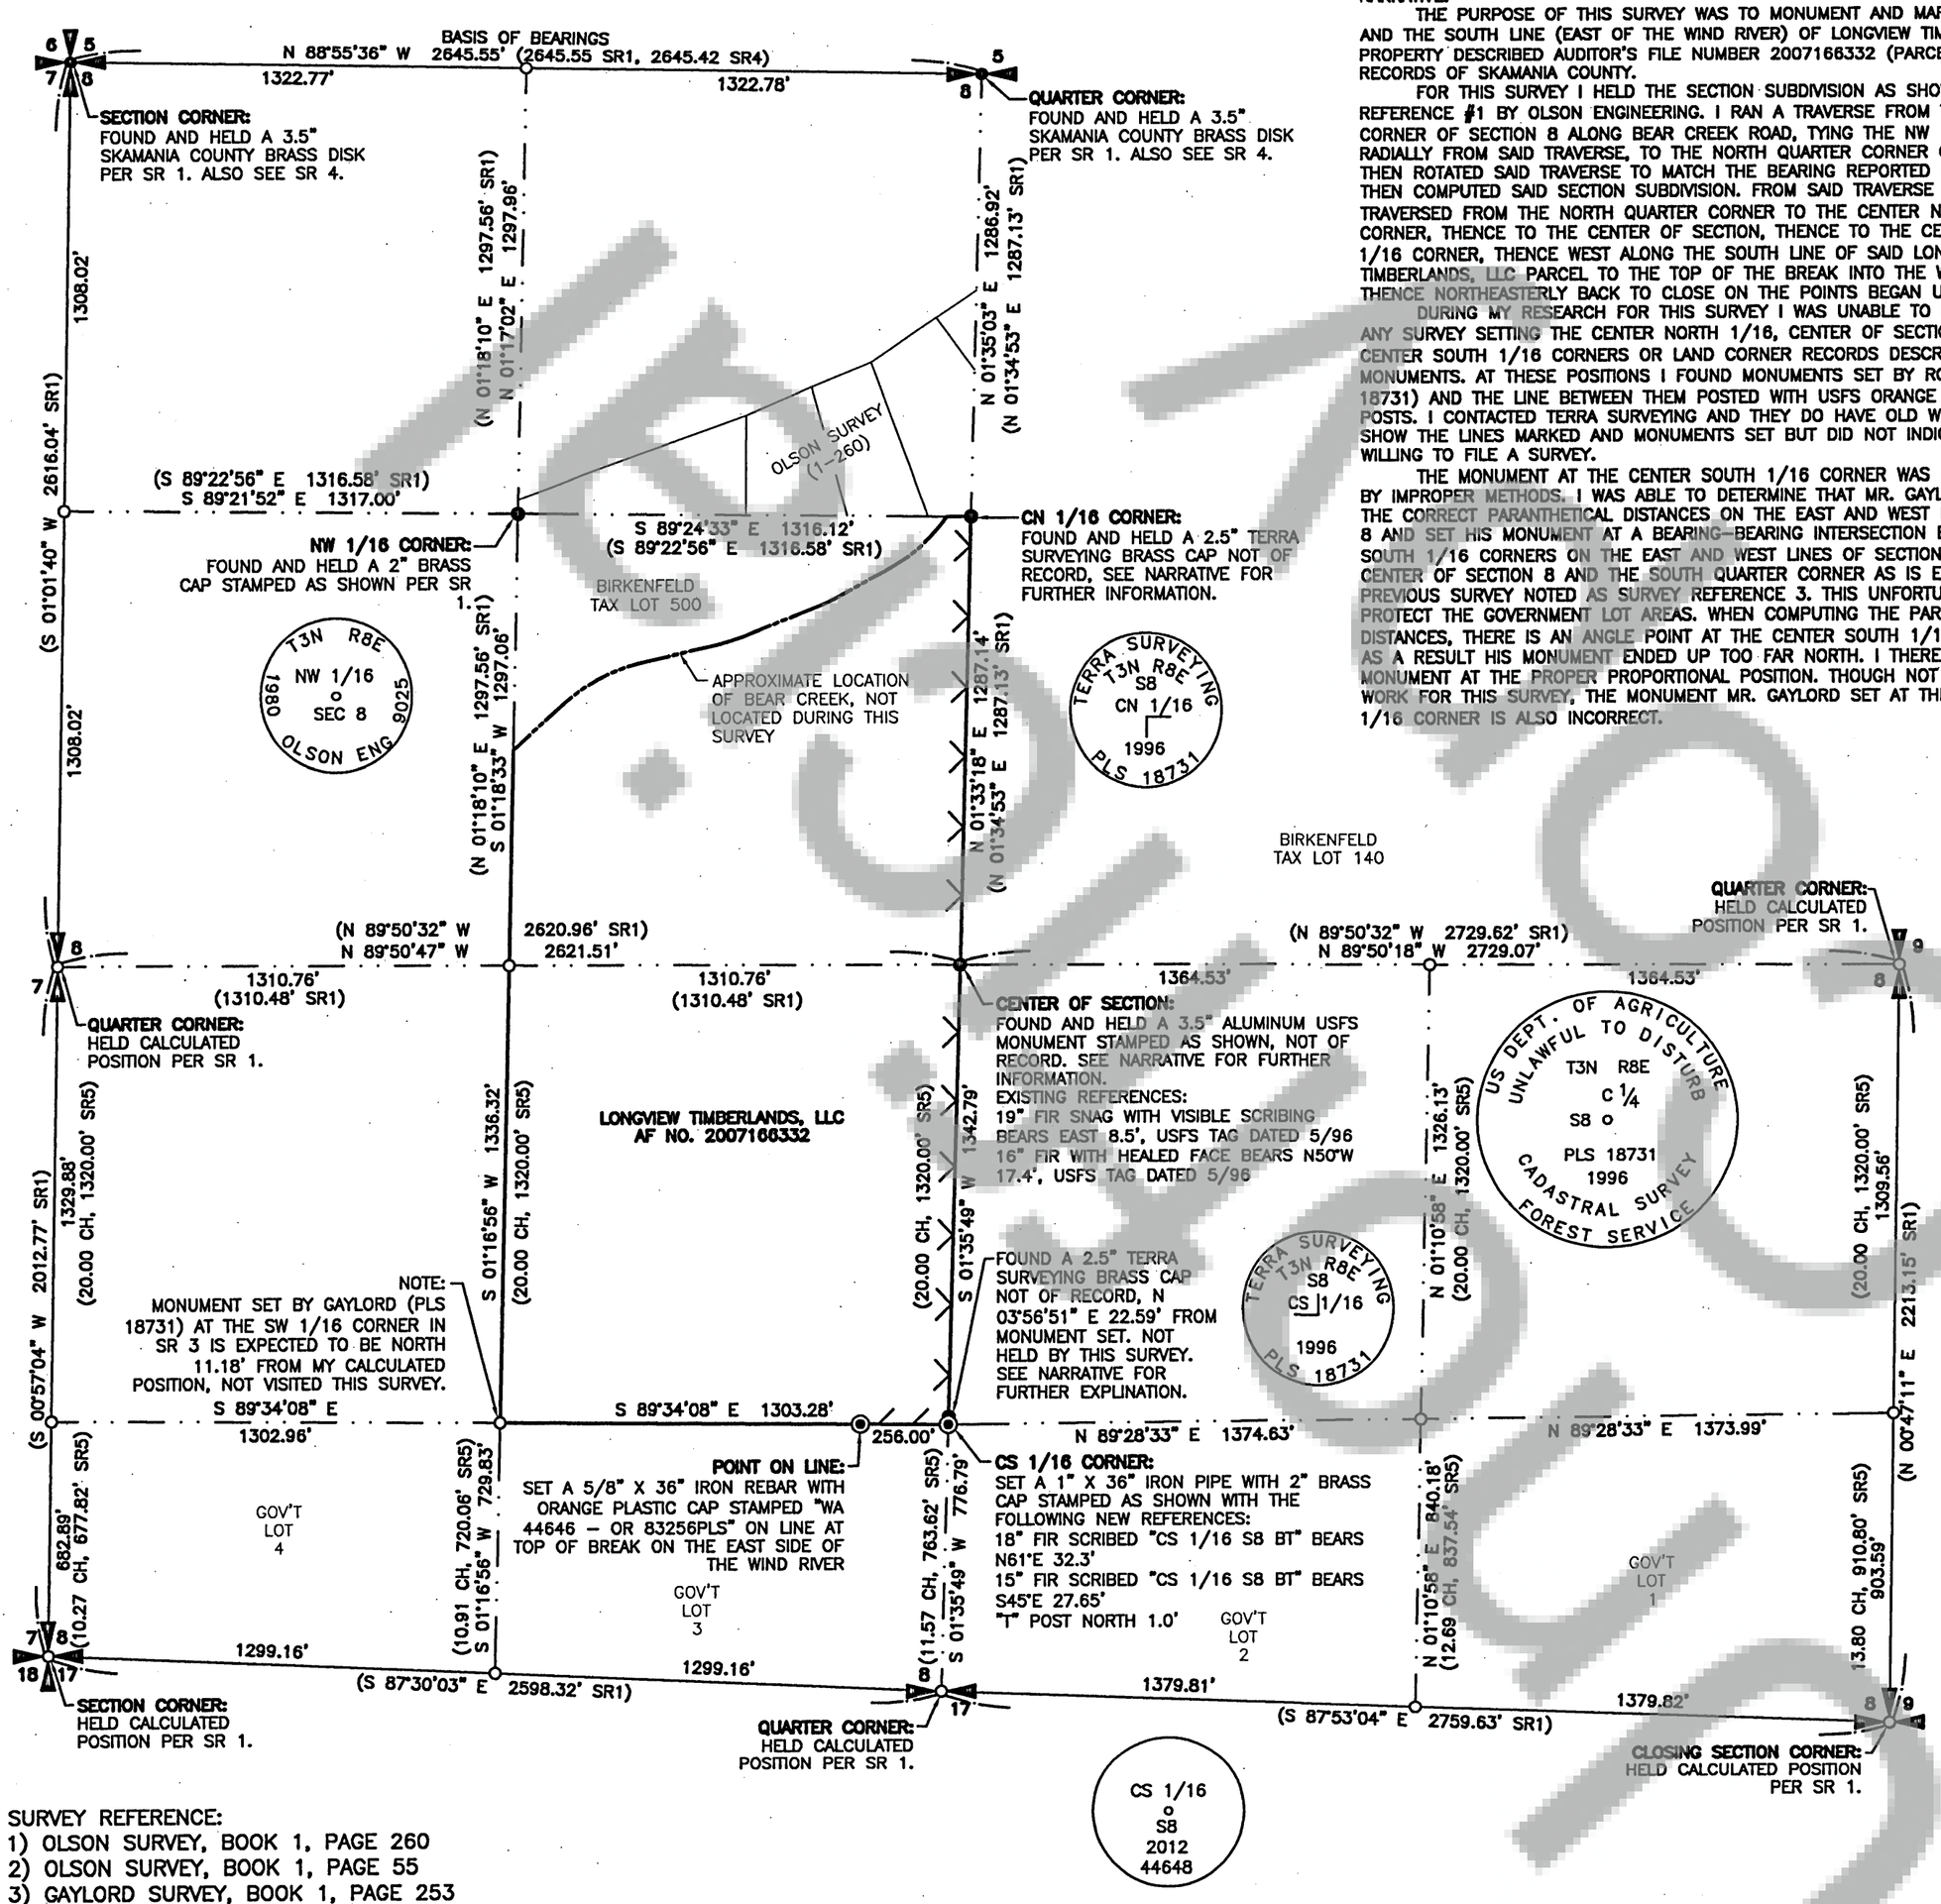

NARRATIVE:

THE PURPOSE OF THIS SURVEY WAS TO MONUMENT AND MARK THE EAST LINE AND THE SOUTH LINE (EAST OF THE WIND RIVER) OF LONGVIEW TIMBERLANDS, LLC PROPERTY DESCRIBED AUDITOR'S FILE NUMBER 2007166332 (PARCEL 36), DEED RECORDS OF SKAMANIA COUNTY.

FOR THIS SURVEY I HELD THE SECTION SUBDIVISION AS SHOWN IN SURVEY REFERENCE #1 BY OLSON ENGINEERING. I RAN A TRAVERSE FROM THE NORTHWEST CORNER OF SECTION 8 ALONG BEAR CREEK ROAD, TYING THE NW 1/16 CORNER RADIALLY FROM SAID TRAVERSE, TO THE NORTH QUARTER CORNER OF SECTION 8. I THEN ROTATED SAID TRAVERSE TO MATCH THE BEARING REPORTED ON SAID SURVEY. I THEN COMPUTED SAID SECTION SUBDIVISION. FROM SAID TRAVERSE I THEN TRAVERSED FROM THE NORTH QUARTER CORNER TO THE CENTER NORTH 1/16 CORNER, THENCE TO THE CENTER OF SECTION, THENCE TO THE CENTER SOUTH 1/16 CORNER, THENCE WEST ALONG THE SOUTH LINE OF SAID LONGVIEW TIMBERLANDS, LLC PARCEL TO THE TOP OF THE BREAK INTO THE WIND RIVER, THENCE NORTHEASTERLY BACK TO CLOSE ON THE POINTS BEGAN UPON.

DURING MY RESEARCH FOR THIS SURVEY I WAS UNABLE TO FIND RECORD OF ANY SURVEY SETTING THE CENTER NORTH 1/16, CENTER OF SECTION OR THE CENTER SOUTH 1/16 CORNERS OR LAND CORNER RECORDS DESCRIBING THE MONUMENTS. AT THESE POSITIONS I FOUND MONUMENTS SET BY ROY GAYLORD (PLS 18731) AND THE LINE BETWEEN THEM POSTED WITH USFS ORANGE CARSONITE POSTS. I CONTACTED TERRA SURVEYING AND THEY DO HAVE OLD WORK MAPS WHICH SHOW THE LINES MARKED AND MONUMENTS SET BUT DID NOT INDICATE THEY WERE WILLING TO FILE A SURVEY.

THE MONUMENT AT THE CENTER SOUTH 1/16 CORNER WAS FOUND TO BE SET BY IMPROPER METHODS. I WAS ABLE TO DETERMINE THAT MR. GAYLORD HAD USED THE CORRECT PARANTHETICAL DISTANCES ON THE EAST AND WEST LINE OF SECTION 8 AND SET HIS MONUMENT AT A BEARING–BEARING INTERSECTION BETWEEN THE SOUTH 1/16 CORNERS ON THE EAST AND WEST LINES OF SECTION 8 AND THE CENTER OF SECTION 8 AND THE SOUTH QUARTER CORNER AS IS EVIDENT IN HIS PREVIOUS SURVEY NOTED AS SURVEY REFERENCE 3. THIS UNFORTUNATELY DID NOT PROTECT THE GOVERNMENT LOT AREAS. WHEN COMPUTING THE PARENTHETICAL DISTANCES, THERE IS AN ANGLE POINT AT THE CENTER SOUTH 1/16 CORNER AND AS A RESULT HIS MONUMENT ENDED UP TOO FAR NORTH. I THEREFOR SET A NEW MONUMENT AT THE PROPER PROPORTIONAL POSITION. THOUGH NOT IN MY SCOPE OF WORK FOR THIS SURVEY, THE MONUMENT MR. GAYLORD SET AT THE SOUTHWEST 1/16 CORNER IS ALSO INCORRECT.

N

0 400 800 1200

BASIS OF BEARING: N 88°55'36" W ALONG THE NORTH LINE OF THE NW 1/4 OF SECTION 8 BETWEEN MONUMENTS FOUND AS NOTED PER SURVEY REFERENCE 1.

LEGEND:

- ○ INDICATES A CALCULATED POSITION, NOTHING SET DURING THIS SURVEY
- ● INDICATES MONUMENT FOUND AS NOTED
- ◉ INDICATES MONUMENT SET AS NOTED
- ( ) INDICATES RECORD INFORMATION PER SURVEY REFERENCE NUMBER CITED
- SR1 INDICATES SURVEY REFERENCE NUMBER
- CH INDICATES CHAIN (1 CHAIN = 66 FEET)
- INDICATES LINE MARKED WITH 1/2" x 72" FIBER GLASS RODS WITH RED AND WHITE RIBBON. TREES ALONG LINE PAINTED AND BLAZED WITH BLUE PAINT.
- INDICATES LINE PREVIOUSLY POSTED BY GAYLORD CIRCA 1996 WITH ORANGE CARSONITE POSTS

DEED REFERENCES:
GRANTOR: CAVENHAM FOREST INDUSTRIES, INC
GRANTEE: LONGVIEW FIBRE COMPANY
BOOK 112, PAGE 40

GRANTOR: LONGVIEW FIBRE COMPANY
GRANTEE: LONGVIEW TIMBERLANDS, LLC
AF NO. 2007166332 (PARCEL 36)

JASON L. SIMES STATE OF WASHINGTON 44648 REGISTERED PROFESSIONAL LAND SURVEYOR
9-7-2012

SURVEY REFERENCE:
1) OLSON SURVEY, BOOK 1, PAGE 260
2) OLSON SURVEY, BOOK 1, PAGE 55
3) GAYLORD SURVEY, BOOK 1, PAGE 253
4) DNR FINAL MAP 462, DATED JULY 1983
5) GLO PLAT & NOTES FOR TOWNSHIP 3 NORTH, RANGE 8 EAST, APPROVED DECMBER 13, 1897

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW TIMBER IN AUGUST, 2012.

9-7-2012
JASON L. SIMES, PROFESSIONAL LAND SURVEYOR, LS# 44648

NEW REFERENCES HAVE A LOCATION TAG ABOVE THE SCRIBE BOTH ORIENTED TOWARD THE MONUMENT. A BRASS WASHER INSCRIBED "SIMES 44648" WAS TACKED INTO THE FACE. A SPIKE WAS DRIVEN AT SIDE CENTER OF THE TREE. BEARINGS WERE MEASURED TO THE TREE AND WERE TAKEN WITH A HAND COMPASS WITH THE DECLINATION SET TO 18° EAST. DISTANCES WERE MEASURED TO THE SPIKE WITH A 50' BUCKERS TAPE.

LONGVIEW TIMBER CORPORATION MAKES NO WARRANTIES AS TO MATTERS OF UNWRITTEN TITLE SUCH AS ADVERSE POSSESSION, ACQUIESCENCE, ESTOPPLE, ETC.

A FIELD TRAVERSE WAS PERFORMED USING A NIKON NIVO 3.0C THREE SECOND TOTAL STATION WITH TDS DATA COLLECTION SYSTEM. THE FIELD TRAVERSE MET THE MINIMUM STANDARDS FOR SURVEYS AS DESIGNATED IN WAC 332-130-090. ALL CORNERS NOTED AS FOUND WERE VISITED IN AUGUST 2012.

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS 19th DAY OF September 2012 AT 1:10 P.M. IN BOOK — OF SURVEYS AT PAGE 1
AT THE REQUEST OF LONGVIEW TIMBER CORPORATION.
AF 2012181560

Melissa Anderson
DEPUTY COUNTY AUDITOR

SCALE: 1"=400'	LONGVIEW TIMBER CORPORATION
JOB NO. 3N8E8	10 INTERNATIONAL WAY
DATE: 8-13-12	LONGVIEW, WA 98632
CALC BY: JLS	(360) 442-4311
DRAWN BY: JLS	
CHECKED BY: EVB	
SHEET 1 OF 1	

AFN #2012181560 Recorded 09/19/2012 at 01:10 PM DocType: SURV Filed by: Page: 1 of 1 Auditor Timothy O. Todd Skamania County, WA