

LAND CORNER RECORD

T 2 N, R 4 East, W.M. Skamania Clark County
 Segregated Surveys: Corner Code No. X-21 - Sheet 1 of 2
 Name: n/a Corner No.: n/a
 DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite

1. History of Corner Establishment and Subsequent Restoration:

Originally set by John Truten during 1857 G.L.O. survey. Restored May 1971 with 1 1/2" iron pipe set by Dept. of Game by single proportion using incorrect corner position to the north and south as shown on 1971 unrecorded Dept. of Game survey and 1977 Wallace and Assoc. survey shown in Book 7 page 106.

2. Description of Evidence Found:

Above mentioned 1 1/2" iron pipe and aluminum plug at S 7 W, 10.31 ft. from corner position. Not accepted this survey.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 607.07A Page No. 18, 29, 30 Date of work 19 Jan '82.

Set punch mark on large 4' x 8' boulder at calculated mid-point corner position. Punch mark barely noticeable. Set 2 standard D.N.R. iron pipes and stamped brass caps as R.M.'s to corner at S 1 33' 11" E, 25.00 ft. and S 88 31' 1" E, 25.00 ft. Both pipes set in stone mounds.

Shown on D.N.R. Final Map 441.

See sketch on back.

Washington Plane Coordinates: South Zone, Y 107,581.88 - X 1,547,416.93 -
 3rd Order Accuracy. Derived From: USC & GS 'Ells' and DNR 3-3N-4E

Pin Pointed on Photo No. Date Located at.

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date Sept 27, 1983

Signature

11977
 Certificate No.



AUDITOR'S CERTIFICATE

Filed for record this 6TH day of OCTOBER 1983 at 2:10 P.M. In
 Book 2/4 of MONUMENTS at page 5 at the request of
 Washington State Department of Natural Resources

J. M. Olson by J. D. Dyer, Rep.
 County Auditor

CLO of 1857

10.00 Set post

A Fir 10" S75W 129' 85.14'

A Fir (dead) 36" N58E 94' 63.36'

41.50 Foot of descent E & W.


W 1/4 corner Sec 36 T2N R4E

Found 1 1/4" IP w/ aluminum plug set by the Dept of Game by single proportion using incorrect corner position to the north & south. Not accepted. DOB used a calc. position for the SW cor. S. 36, and used Fred Law's pipe at the NW cor. S. 36. Hagedorn re-monumented the SW corner at its orig. position, and Lawson re-monumented the NW cor.

Other surveys:

May 1971 - undersigned Dept of Game survey

1977 - Wallace & Assoc. Bk 7, Pg 106 (used DOB p 4c)

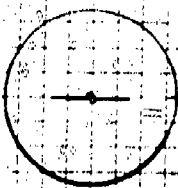

Could not set because corner falls atop a large boulder. See pages 23 & 39 for reference mens.

