




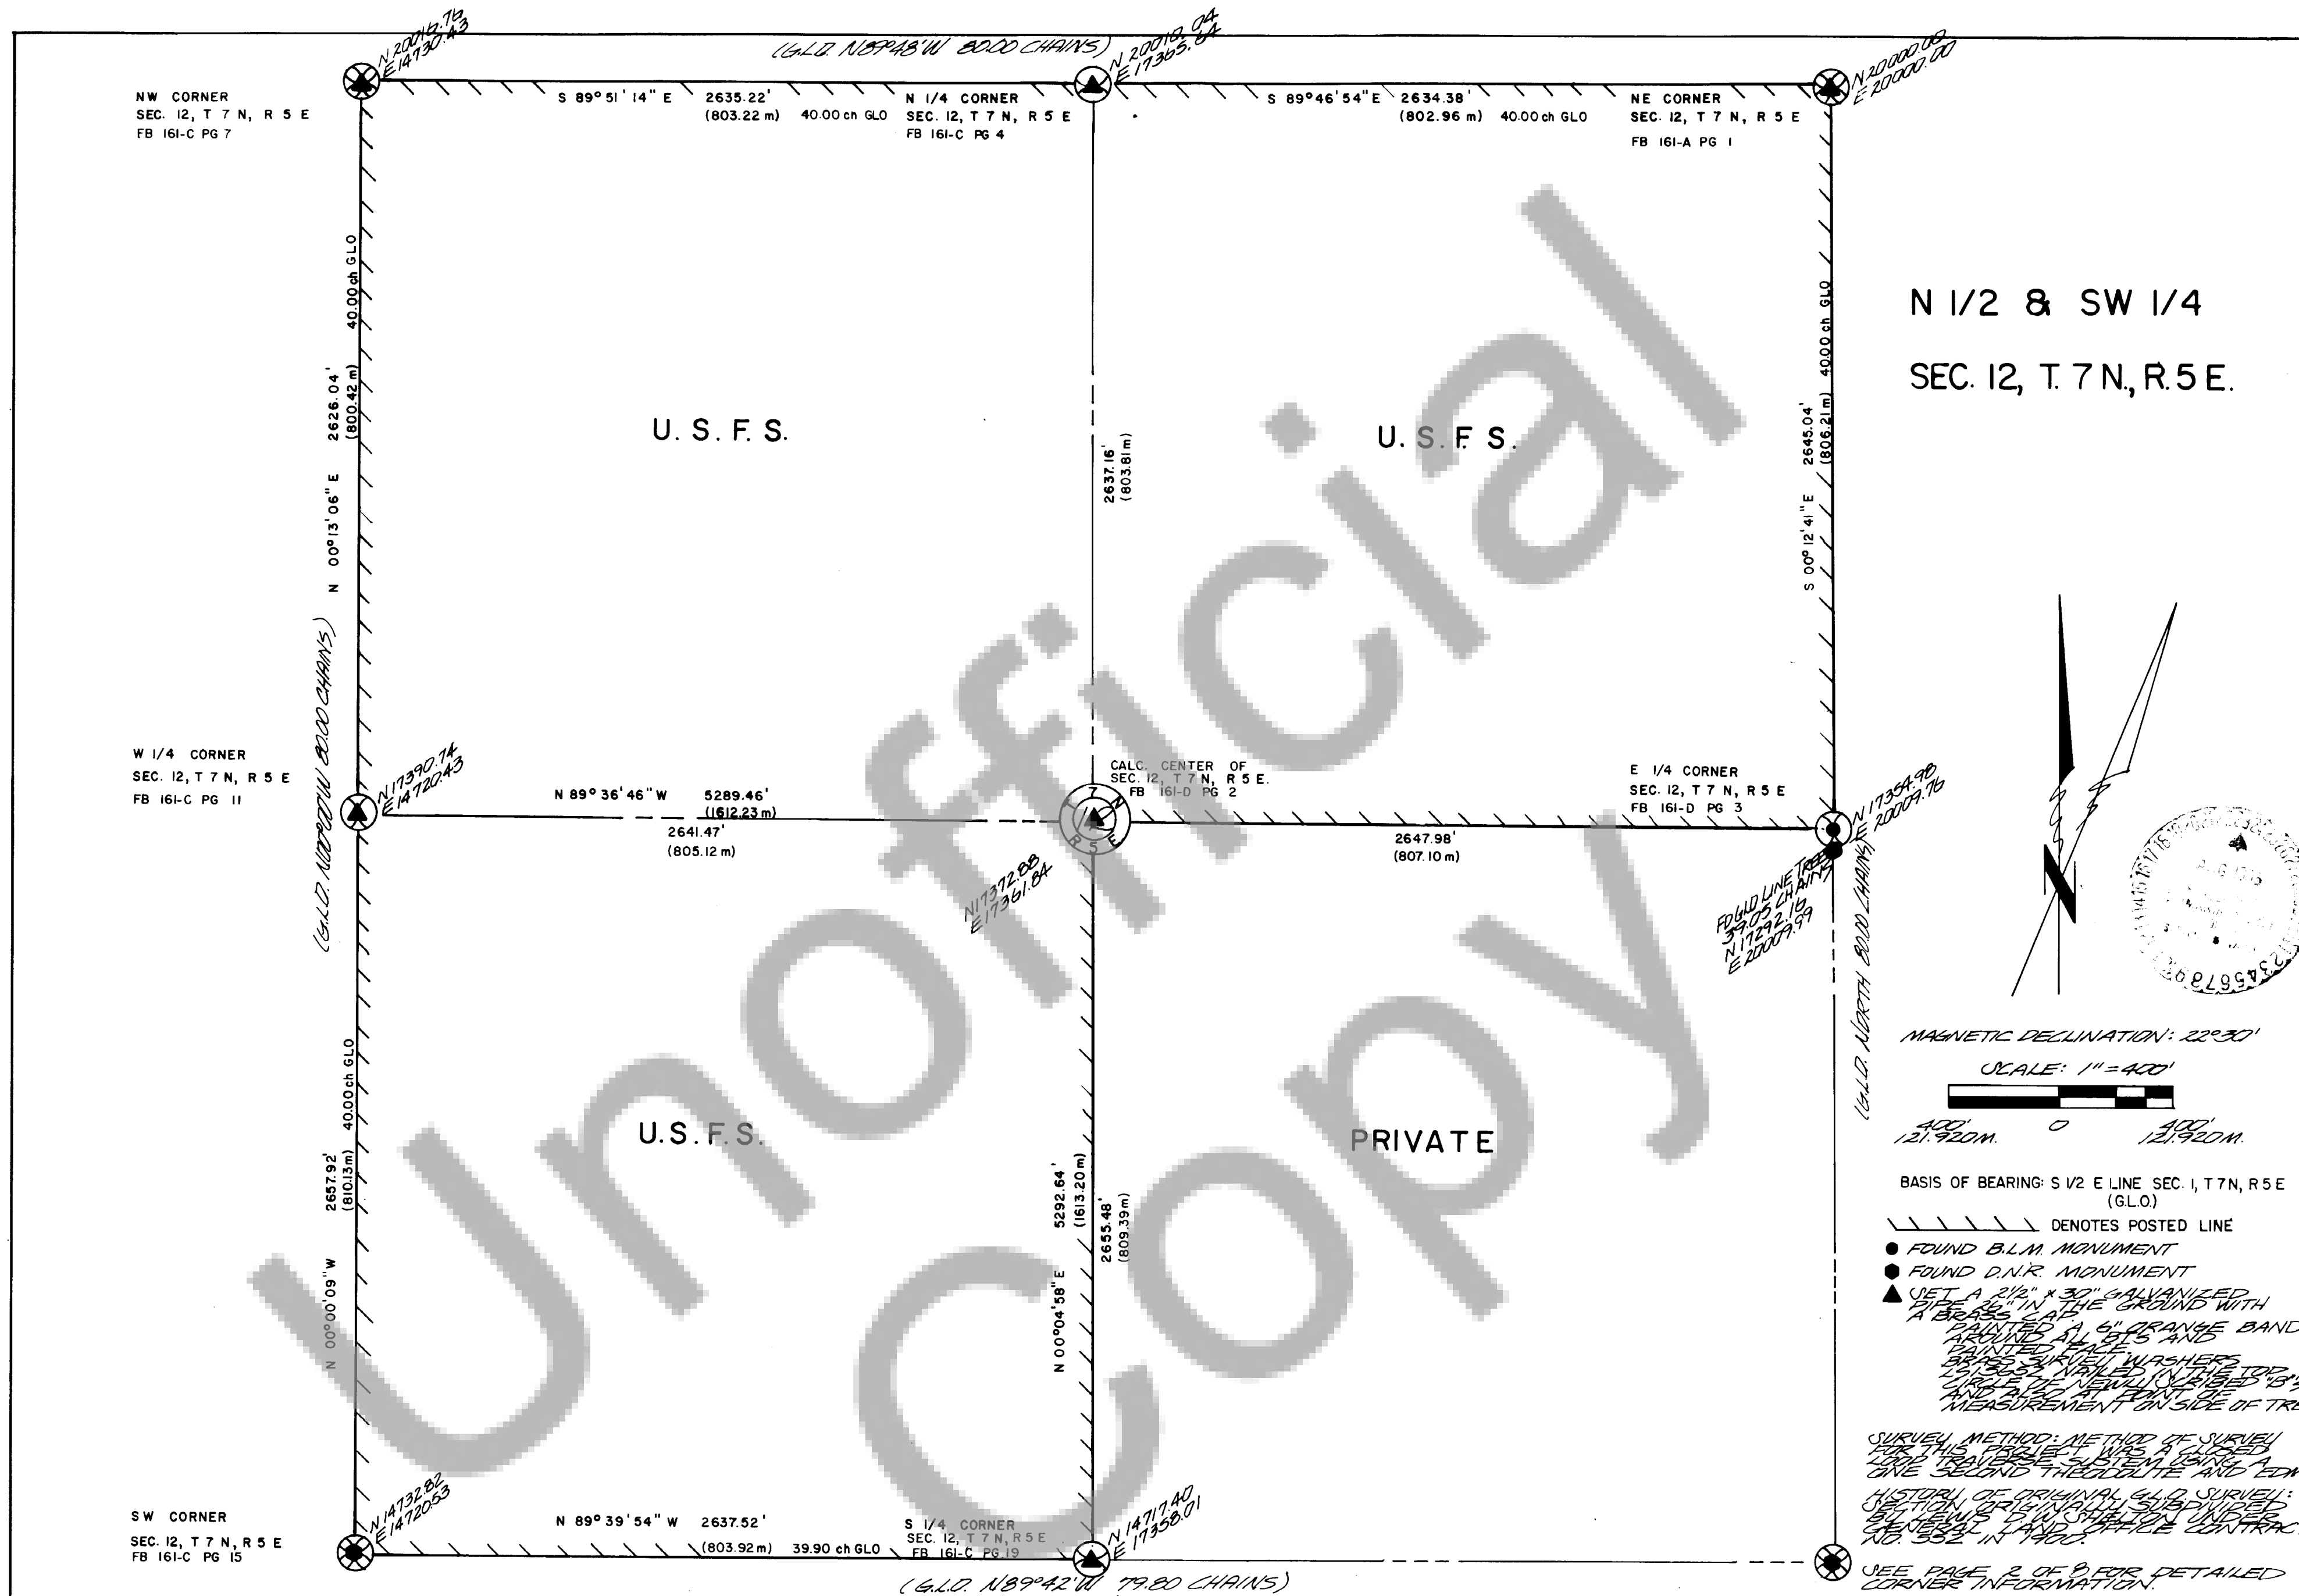


SECTION 12, T7N, R5E, W1M. CORNER INFO

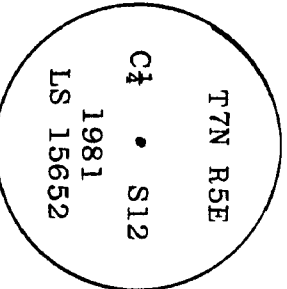


CENTER QUARTER CORNER SECTION 12, FB 161-1, Page 2
Scribed new BT's:
9" Silver Fir N05°W 25.38', scribed "C4 S12 BT"
4" Silver Fir N89°E 21.91', scribed "X BT"
Nailed 54-3 and 54-9 signs on all BT's.

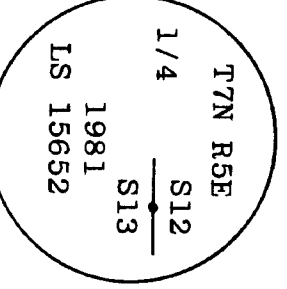


SOUTH QUARTER CORNER SECTION 12, FB 161, Page 2
Found 2" x 5" pipe at corner location.
Found WeyCo RP's:
6" Silver Fir Stump N78°W 0.40', WeyCo Tag & Nail
28" Hemlock Stump S28°E 31.00', WeyCo Tag & Nail
Scribed new BT's:
Reference Point 1/2" x 30" Rebar with plastic cap
LS 15652 S28°E 28.45', S28°E 2.23' to stump from Rebar
4" Hemlock S55°W 94.82', scribed "X BT"
Nailed 54-3 and 54-4 signs on all BT's.
Nailed 54-3 sign on stump giving distance to rebar.

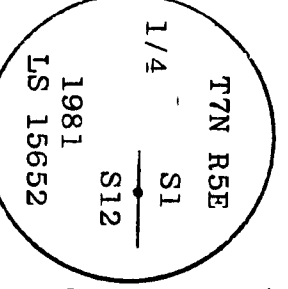


NORTH QUARTER CORNER SECTION 12, FB 161, Page 10
Found 2 OBT's:
22" Silver Fir Stump N45°E 2.64', visible scribe, cruiser marks, WeyCo Tag & Nail.
20" Silver Fir Stump S06°E 17.16', visible scribe, WeyCo Tag and RP
Scribed new BT's:
4" Silver Fir N20°E 6.98', scribed "1/4 S1 BT"
6" Silver Fir S25°E 12.85', scribed "1/4 S12 BT"
Nailed 54-3 and 54-4 signs on all BT's.

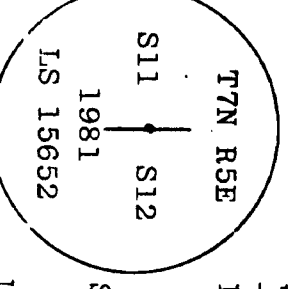


WEST QUARTER CORNER SECTION 12, FB 161, Page 11
Found 2 OBT's:
23" Silver Fir Stump N46°W 25.08', visible scribe
23" Silver Fir Stump N33°E 40.92', badly deteriorated stump.
Scribed new BT's:
7" Silver Fir N51°E 42.66', scribed "1/4 S12 BT"
9" Silver Fir S55°W 28.16', scribed "1/4 S11 BT"
Nailed 54-3 and 54-4 signs on all BT's.

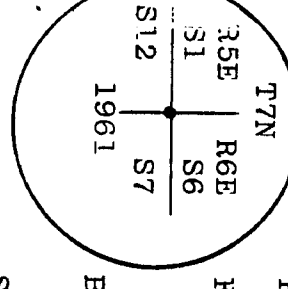


NORTHEAST CORNER SECTION 12, FB 161, Page 17
Found BLM Monument in root wad laying flat with ground.
Dug out and reset from accessories.
Found OBT's:
14" White Fir Snag S46°E 18.48', visible scribe
26" White Fir Stump S80°W 40.26', visible scribe
16" White Fir Stump N80°E 4.62', no scribe
BLM BT's:
10" White Fir Snag N19°W 39.27', visible scribe, BT sign
11" White Fir N43°E 22.04', visible scribe, BT sign
Scribed new BT's:
12" Silver Fir N15°E 41.41', scribed "T7N R6E S6 BT"
8" Silver Fir N38°W 12.69', scribed "T7N R5E S1 BT"
10" Silver Fir S33°W 122.26', scribed "T7N R5E S12 BT"
10" Silver Fir S78°E 31.60', scribed "T7N R6E S7 BT"
Nailed 54-3 and 54-4 signs on all BT's.

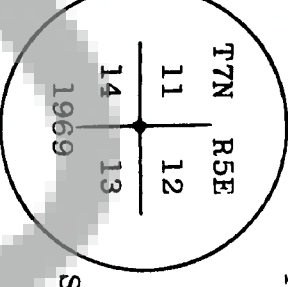


SOUTHWEST CORNER SECTION 12, FB 161, Page 13
Found DNR 4" x 4" Concrete Monument with brass cap
Found 2 OBT's:
25" Silver Fir Stump S44°W 27.72', visible scribe
with brass survey tag on face, USFS location poster and WeyCo tag.
16" Silver Fir, alive S66°E 11.88', face grown over, WeyCo tag and spike, cruiser marks, WeyCo tag reads N66°W 11.00'.
Scribed new BT's:
10" Silver Fir N28°W 26.46', scribed "T7N R5E S11 BT"
9" Silver Fir S76°W 16.13', scribed "T7N R5E S14 BT"
3" Silver Fir N74°E 34.54', scribed "X BT"
Nailed 54-3 and 54-4 signs on all BT's.

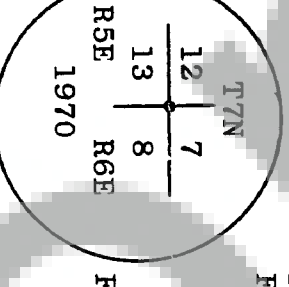

SOUTHEAST CORNER SECTION 12, FB 161, Page 1
Found DNR Concrete Monument with brass cap.
Found 3 OBT's:
6" Silver Fir Stump S54°W 13.20', visible scribe, USFS 54-3
16" Silver Fir Stump S23°W 23.10', face grown over
16" Silver Fir Stump N58°W 15.84', no scribe, badly deteriorated.
Found RP's:
27" Silver Fir Stump N53°W 22.80', State tag
12" Silver Fir Stump S49°W 24.92', State tag, WeyCo tag and nail.
32" Silver Fir Stump S88°E 14.40', WeyCo tag and nail
Scribed new BT's:
7" Silver Fir N59°E 66.12', scribed "T7N R6E S7 BT"
4" Hemlock N49°W 8.53', scribed "X BT"
4" Hemlock S25°W 17.02', scribed "X BT"
13" Silver Fir S30°E 54.36', scribed "T7N R6E S18 BT"
Nailed 54-3 and 54-4 signs on all BT's.

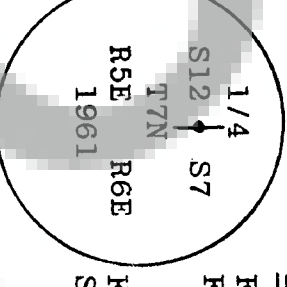

EAST QUARTER CORNER SECTION 12, FB 161, Page 12
Found BLM Monument with brass cap.
Found OBT's:
17" Fir Stump, visible scribe, S13°E 23.76'
26" Down Fir, face buried, USFS location poster attached
Found BLM 8" Silver Fir, visible scribe, N45°E 13.12'
Scribed new BT's:
5" Silver Fir N24°W 19.77', scribed "X BT"
5" Silver Fir S74°E 8.39', scribed "X BT"
Nailed 54-3 and 54-4 signs on all BT's.

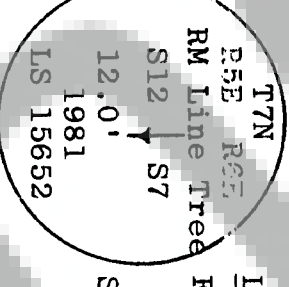

LINE TREE, SOUTH HALF EAST LINE, SECTION 12, FB 161-1, Page 3
Found 60" Fir Stump, one original Notch on South side, 70.50' S03°E of the East 1/4 Corner Section 12.
(GPO call 63')
Set reference monument North 12.00' from center of stump, Set 2 1/2" x 30" galvanized pipe with brass cap.



CERTIFICATE NO. _____

SURVEYOR'S CERTIFICATE

BUTLER & ZIEMER LAND SURVEYORS, INC.
475 NW CHEHALIS AVENUE
P O BOX 149 (206) 748-8803
CHEHALIS, WASHINGTON

AUDITOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF BUTLER & ZIEMER LAND SURVEYORS, INC.

FILED FOR RECORD THIS 2nd DAY OF _____, 19____
AT _____ IN BOOK _____ OF _____
AT THE REQUEST OF BUTLER & ZIEMER LAND SURVEYORS, INC.

_____ COUNTY AUDITOR

_____ LICENSE NO. 18876

DRN	MARLETA	DATE	9-7-84
CHK'D	ETAS	JOB NO.	8172
SCALE	NOT SCALE	SHEET	2 OF 8



SECTION 2, T7N, R5E, W1N.
CORNER INFO


SOUTHEAST CORNER SECTION 2, FB 161, Page 3

Found 2 OBT's:

26" White Fir N79°E 41.56', visible scribe
50" Hemlock Snag S30°W 29.37', visible scribe, with
Weyco RP tag

Scribed new BT's:

14" Silver Fir N53°E 25.21', scribed "T7N R5E S1 BT"
12" Silver Fir N32°W 9.72', scribed "T7N R5E S2 BT"
12" Silver Fir S40°W 26.30', scribed "T7N R5E S11 BT"
13" Silver Fir S27°E 10.19', scribed "T7N R5E S12 BT"
Nailed 54-3 and 54-4 signs on all BT's.

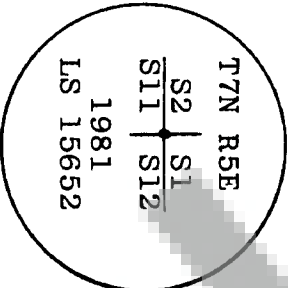


EAST QUARTER CORNER SECTION 2, FB 161-1, Page 5

Found 27" Silver Fir Stump OBT (8' high) N45°W 8.75',
visible scribe, cruiser marks and plot tag

Scribed new BT's:

6" Fir S45°W 39.39', scribed "X BT"
6" Hemlock S25°E 34.84', scribed "X BT"
Nailed 54-3 and 54-4 signs on all BT's.

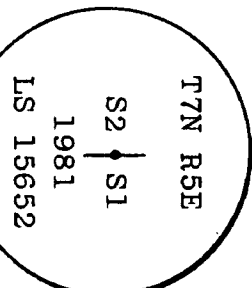


NORTHEAST CORNER SECTION 2, FB 161, Page 14

Found 2 OBT's:

32" Silver Fir Snag S56°W 34.98', visible scribe,
and cruiser marks.
24" Silver Fir Stump S44°E 23.10', stump lies on
skid trail and is cut off flush with ground.
Scribed new BT's:


7" Silver Fir N31°E 9.11', scribed "T8N R5E S36 BT"
4" Hemlock N59°W 11.39', scribed "X BT"
5" Silver Fir S59°W 27.02', scribed "X BT"
5" Hemlock S60°E 17.93', scribed "X BT"
Nailed 54-3 and 54-4 signs on all BT's.

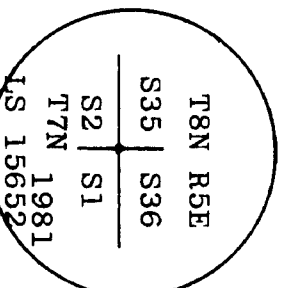

NORTH QUARTER CORNER SECTION 2, FB 161, Page 4

Found 15" White Fir Stump OBT N86°E 27.06', visible scribe


Scribed new BT's:
8" Silver Fir N72°E 17.46', scribed "1/4 S35 BT"
6" Silver Fir S20°E 26.71', scribed "1/4 S2 BT"
Nailed 54-3 and 54-4 signs on all BT's.

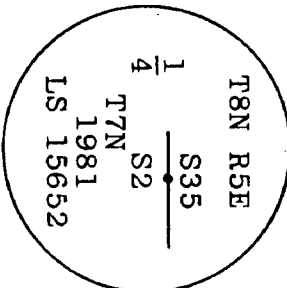

NORTHWEST CORNER SECTION 2, FB 161, Page 20

Found 4 OBT's:

45" Silver Fir S73°W 11.22', face grown over
28" Silver Fir Snag (down) N15°E 32.34', visible
scribe, BT sign, USFS location poster
36" Silver Fir Stump S22°E 45.54', visible scribe
36" Silver Fir Stump N07°W 34.40', possible OBT
Scribed new BT's:
16" Silver Fir N69°E 47.06', scribed "T8N R5E S35 BT"
7" Hemlock N21°W 18.96', scribed "T8N R5E S34 BT"
13" Hemlock S18°E 41.18', scribed "T7N R5E S2 BT"
Nailed 54-3 and 54-4 signs on all BT's.

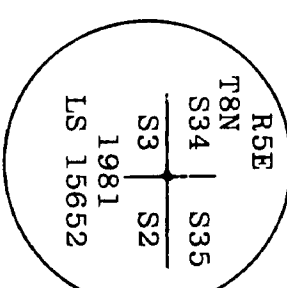


SOUTH QUARTER CORNER SECTION 2, FB 161, Page 18

Found 2 OBT's:

24" Silver Fir Stump S30°W 13.86', visible scribe,
with Weyco tag.
15" Silver Fir Stump N33°W 22.44', visible scribe.
Scribed new BT's:


14" Silver Fir N42°E 26.44', scribed "1/4 S2 BT"
12" Silver Fir S30°E 22.32', scribed "1/4 S11 BT"
Nailed 54-3 and 54-4 signs on all BT's.

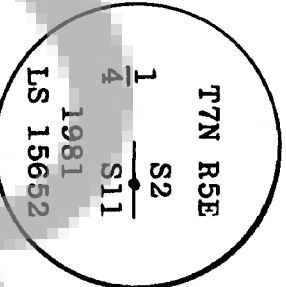

CENTER QUARTER CORNER SECTION 2, FB 161-1, Page 15

Scribed new BT's:

8" Silver Fir N29°E 11.55', scribed "C4 S2 BT"
10" Silver Fir N77°W 15.24', scribed "C4 S2 BT"
Nailed 54-3 and 54-9 signs on all BT's.

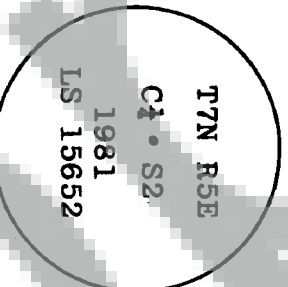


SOUTHWEST CORNER SECTION 2, FB 161, Page 16

Found 1 1/2" galvanized I.P. and 10"x12"x10" Stone with
axe marks at the corner position.

Found 4 OBT's:

23" Silver Fir Stump S84 3/4°E 50.82', visible scribe
30" Silver Fir Stump N21 3/4°E 3.96', no marks
23" Silver Fir Stump pushed over, face buried
N78°W 7.59'

36" Silver Fir Stump pushed over, face buried
S11 3/4°W 40.26'
Found Weyco RP - 6" Silver Fir N44°W 5.70', Weyco Tag
Scribed new BT's:
5" Silver Fir N40°E 12.50', scribed "X BT"
11" Hemlock N33°W 7.41', scribed "T7N R5E S3 BT"
7" Silver Fir S82°W 13.39', scribed "T7N R5E S10 BT"
8" Silver Fir S10°E 5.65', scribed "T7N R5E S11 BT"
Nailed 54-3 and 54-4 signs on all BT's.

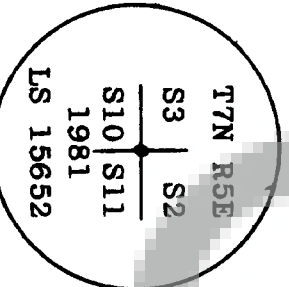


WEST QUARTER CORNER SECTION 2, FB 161-1, Page 1

Found 2 OBT's:

40" White Fir Stump S78°E 33.00', visible knife scribe,
(Note: Slope distance and wrong quadrant)
36" White Fir Stump N20°W 17.82', visible knife scribe,
(Note: Distance taken to face)

Scribed new BT's:

6" Silver Fir S53°E 10.68', scribed "1/4 S2 BT"
10" Silver Fir S57°W 23.00', scribed "1/4 S3 BT"
Nailed 54-3 and 54-4 signs on all BT's.

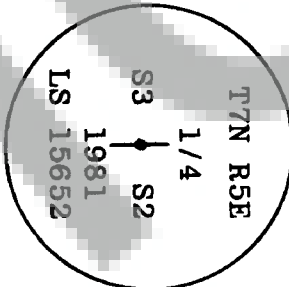

CERTIFICATE NO.

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS 11 DAY OF APRIL, 1985
AT 1 M. IN BOOK 99823 OF 99823 AT PAGE 185
AT THE REQUEST OF BUTLER & ZENNER LAND SURVEYORS, INC.

COUNTY AUDITOR

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME
OR UNDER MY DIRECTION IN CONFORMANCE WITH THE
REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE
REQUEST OF BUTLER & ZENNER LAND SURVEYORS, INC.
SEPTEMBER 1984, UNDER CONTRACT NO.
53-0353-1-CH484A. Edward G. Barth
LICENSE NO. 18076


BUTLER & ZENNER LAND SURVEYORS, INC.

475 NW CHEHALIS AVENUE
P.O. BOX 149 (206) 748-8803
CHEHALIS, WASHINGTON

DRN MARLETA DATE 9-6-84


CHKD EAB JOB NO. 53-0353-1-CH484A


SCALE NO SCALE SHEET 4 OF 8

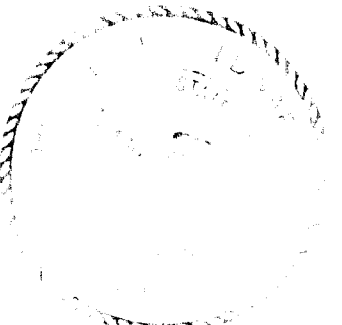


99823 99823


BOOK 2 PAGE 184

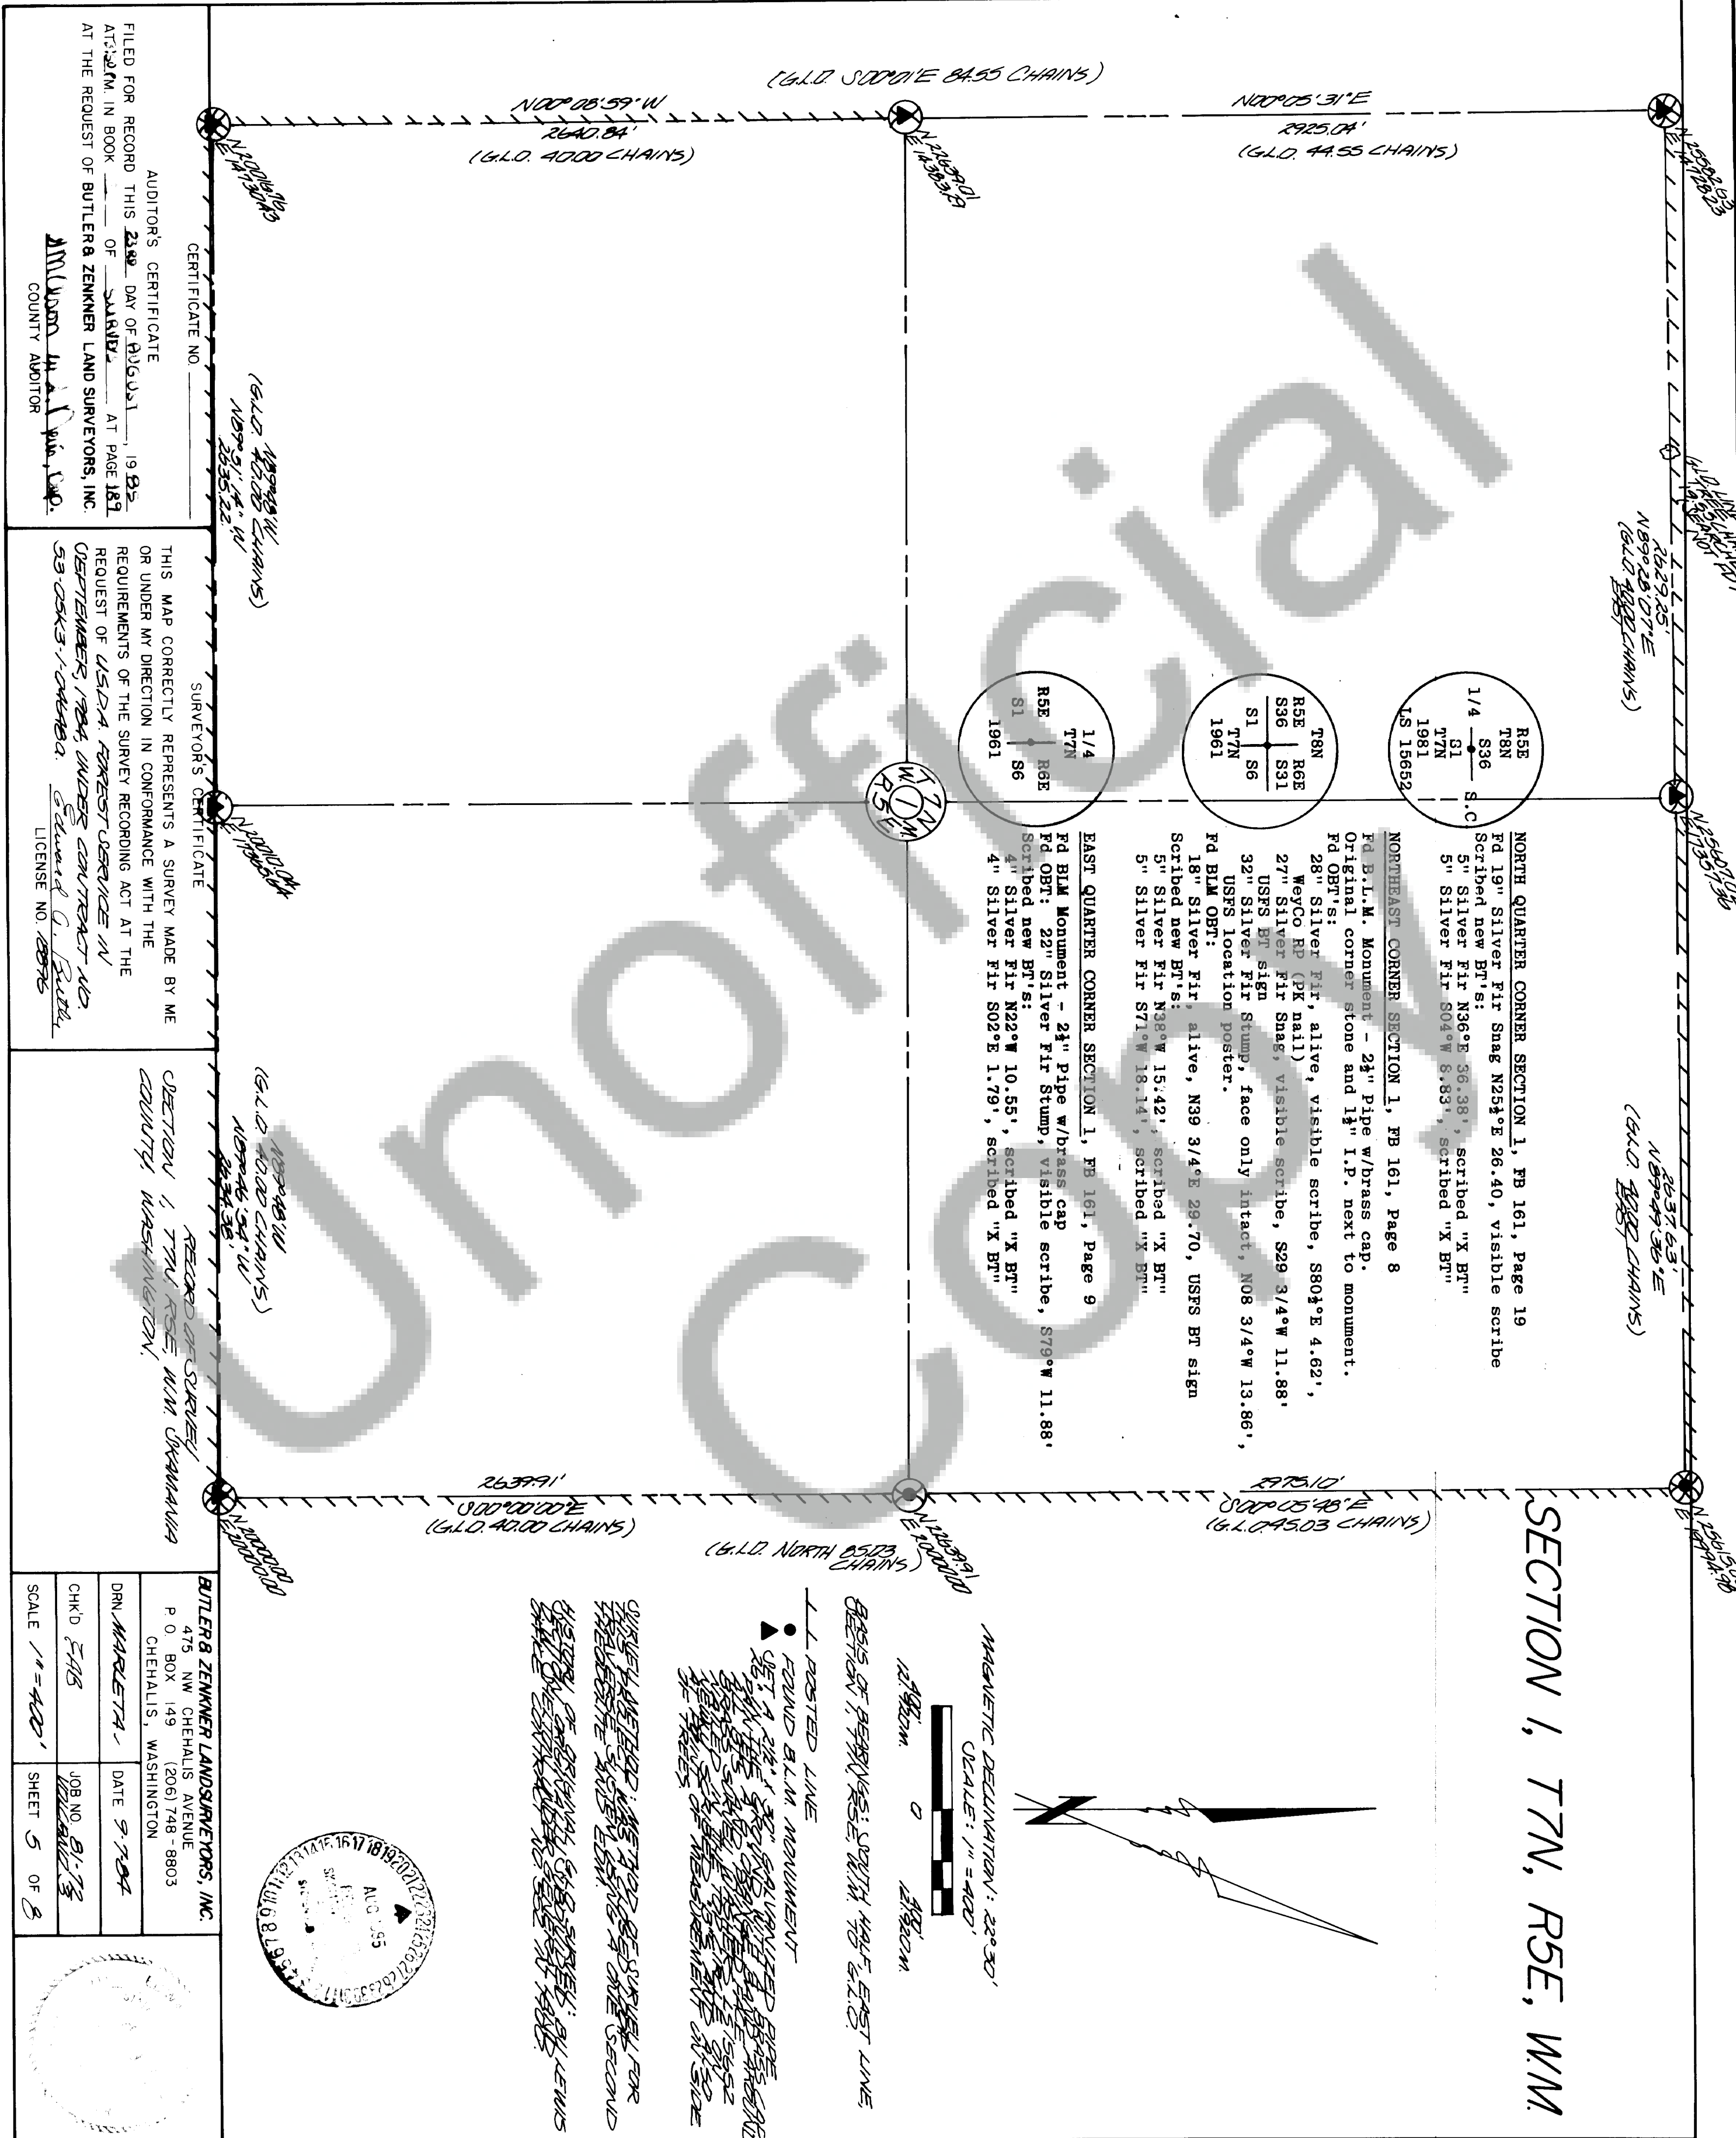

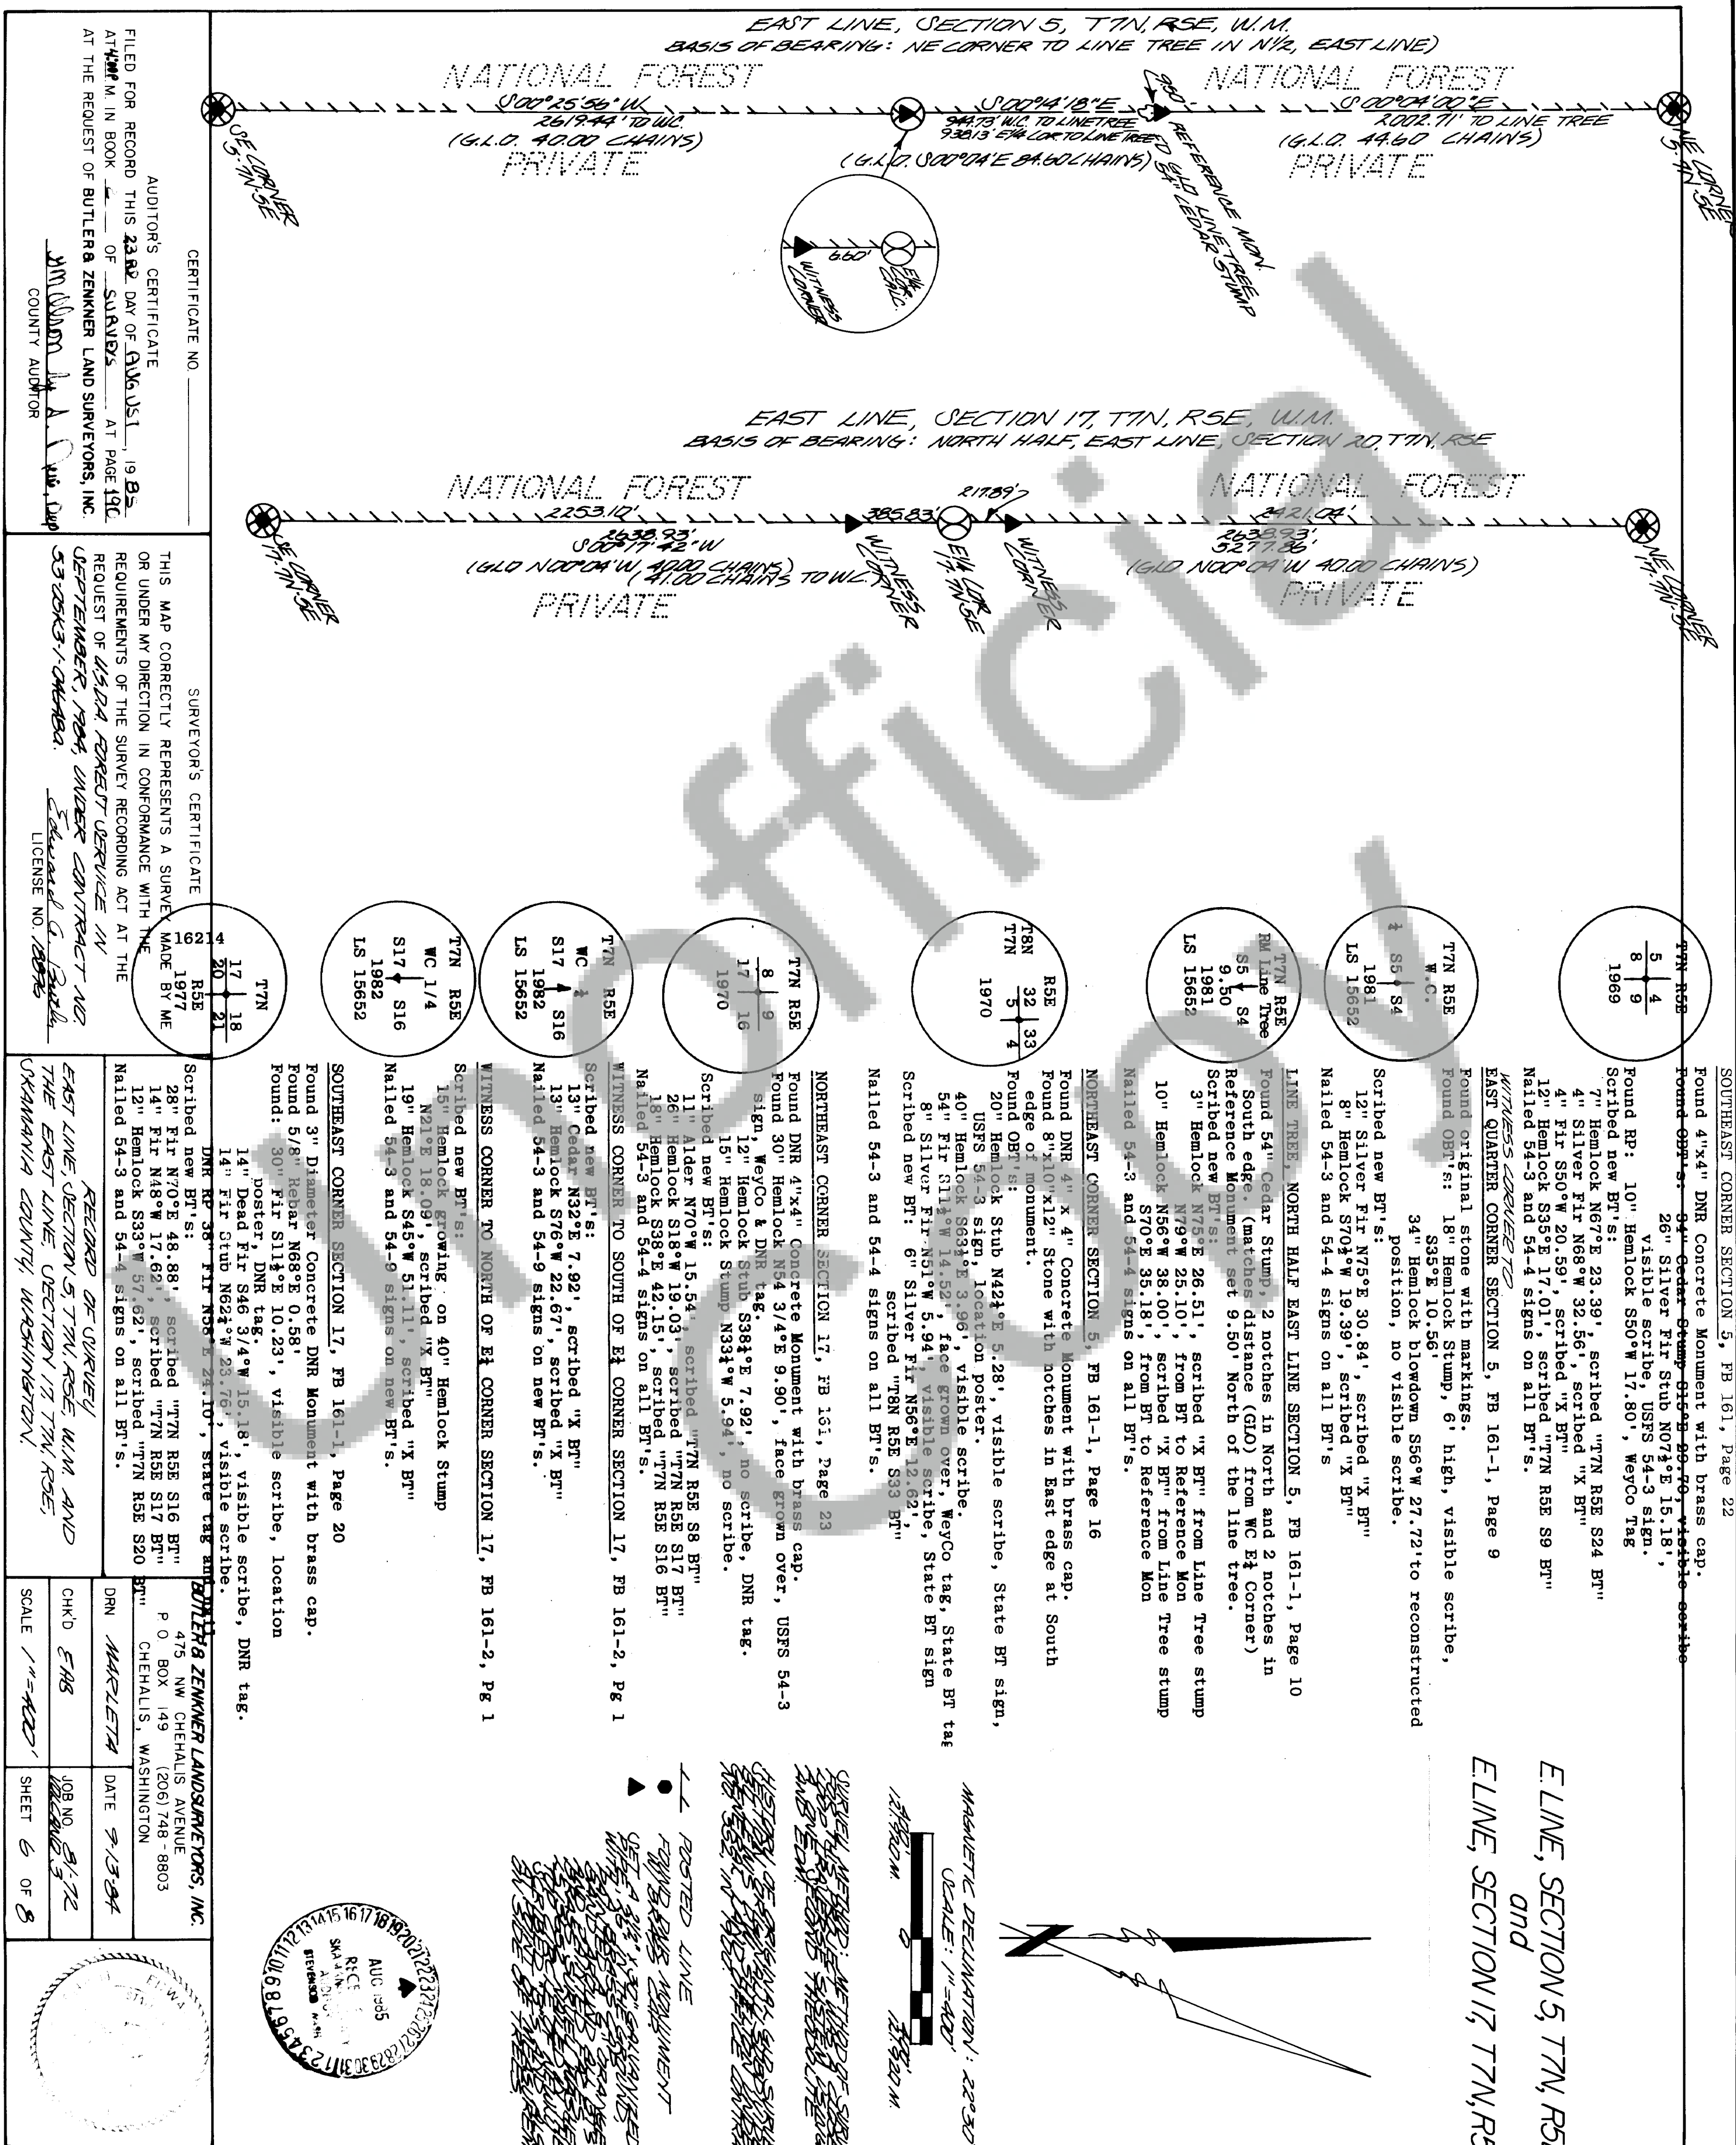


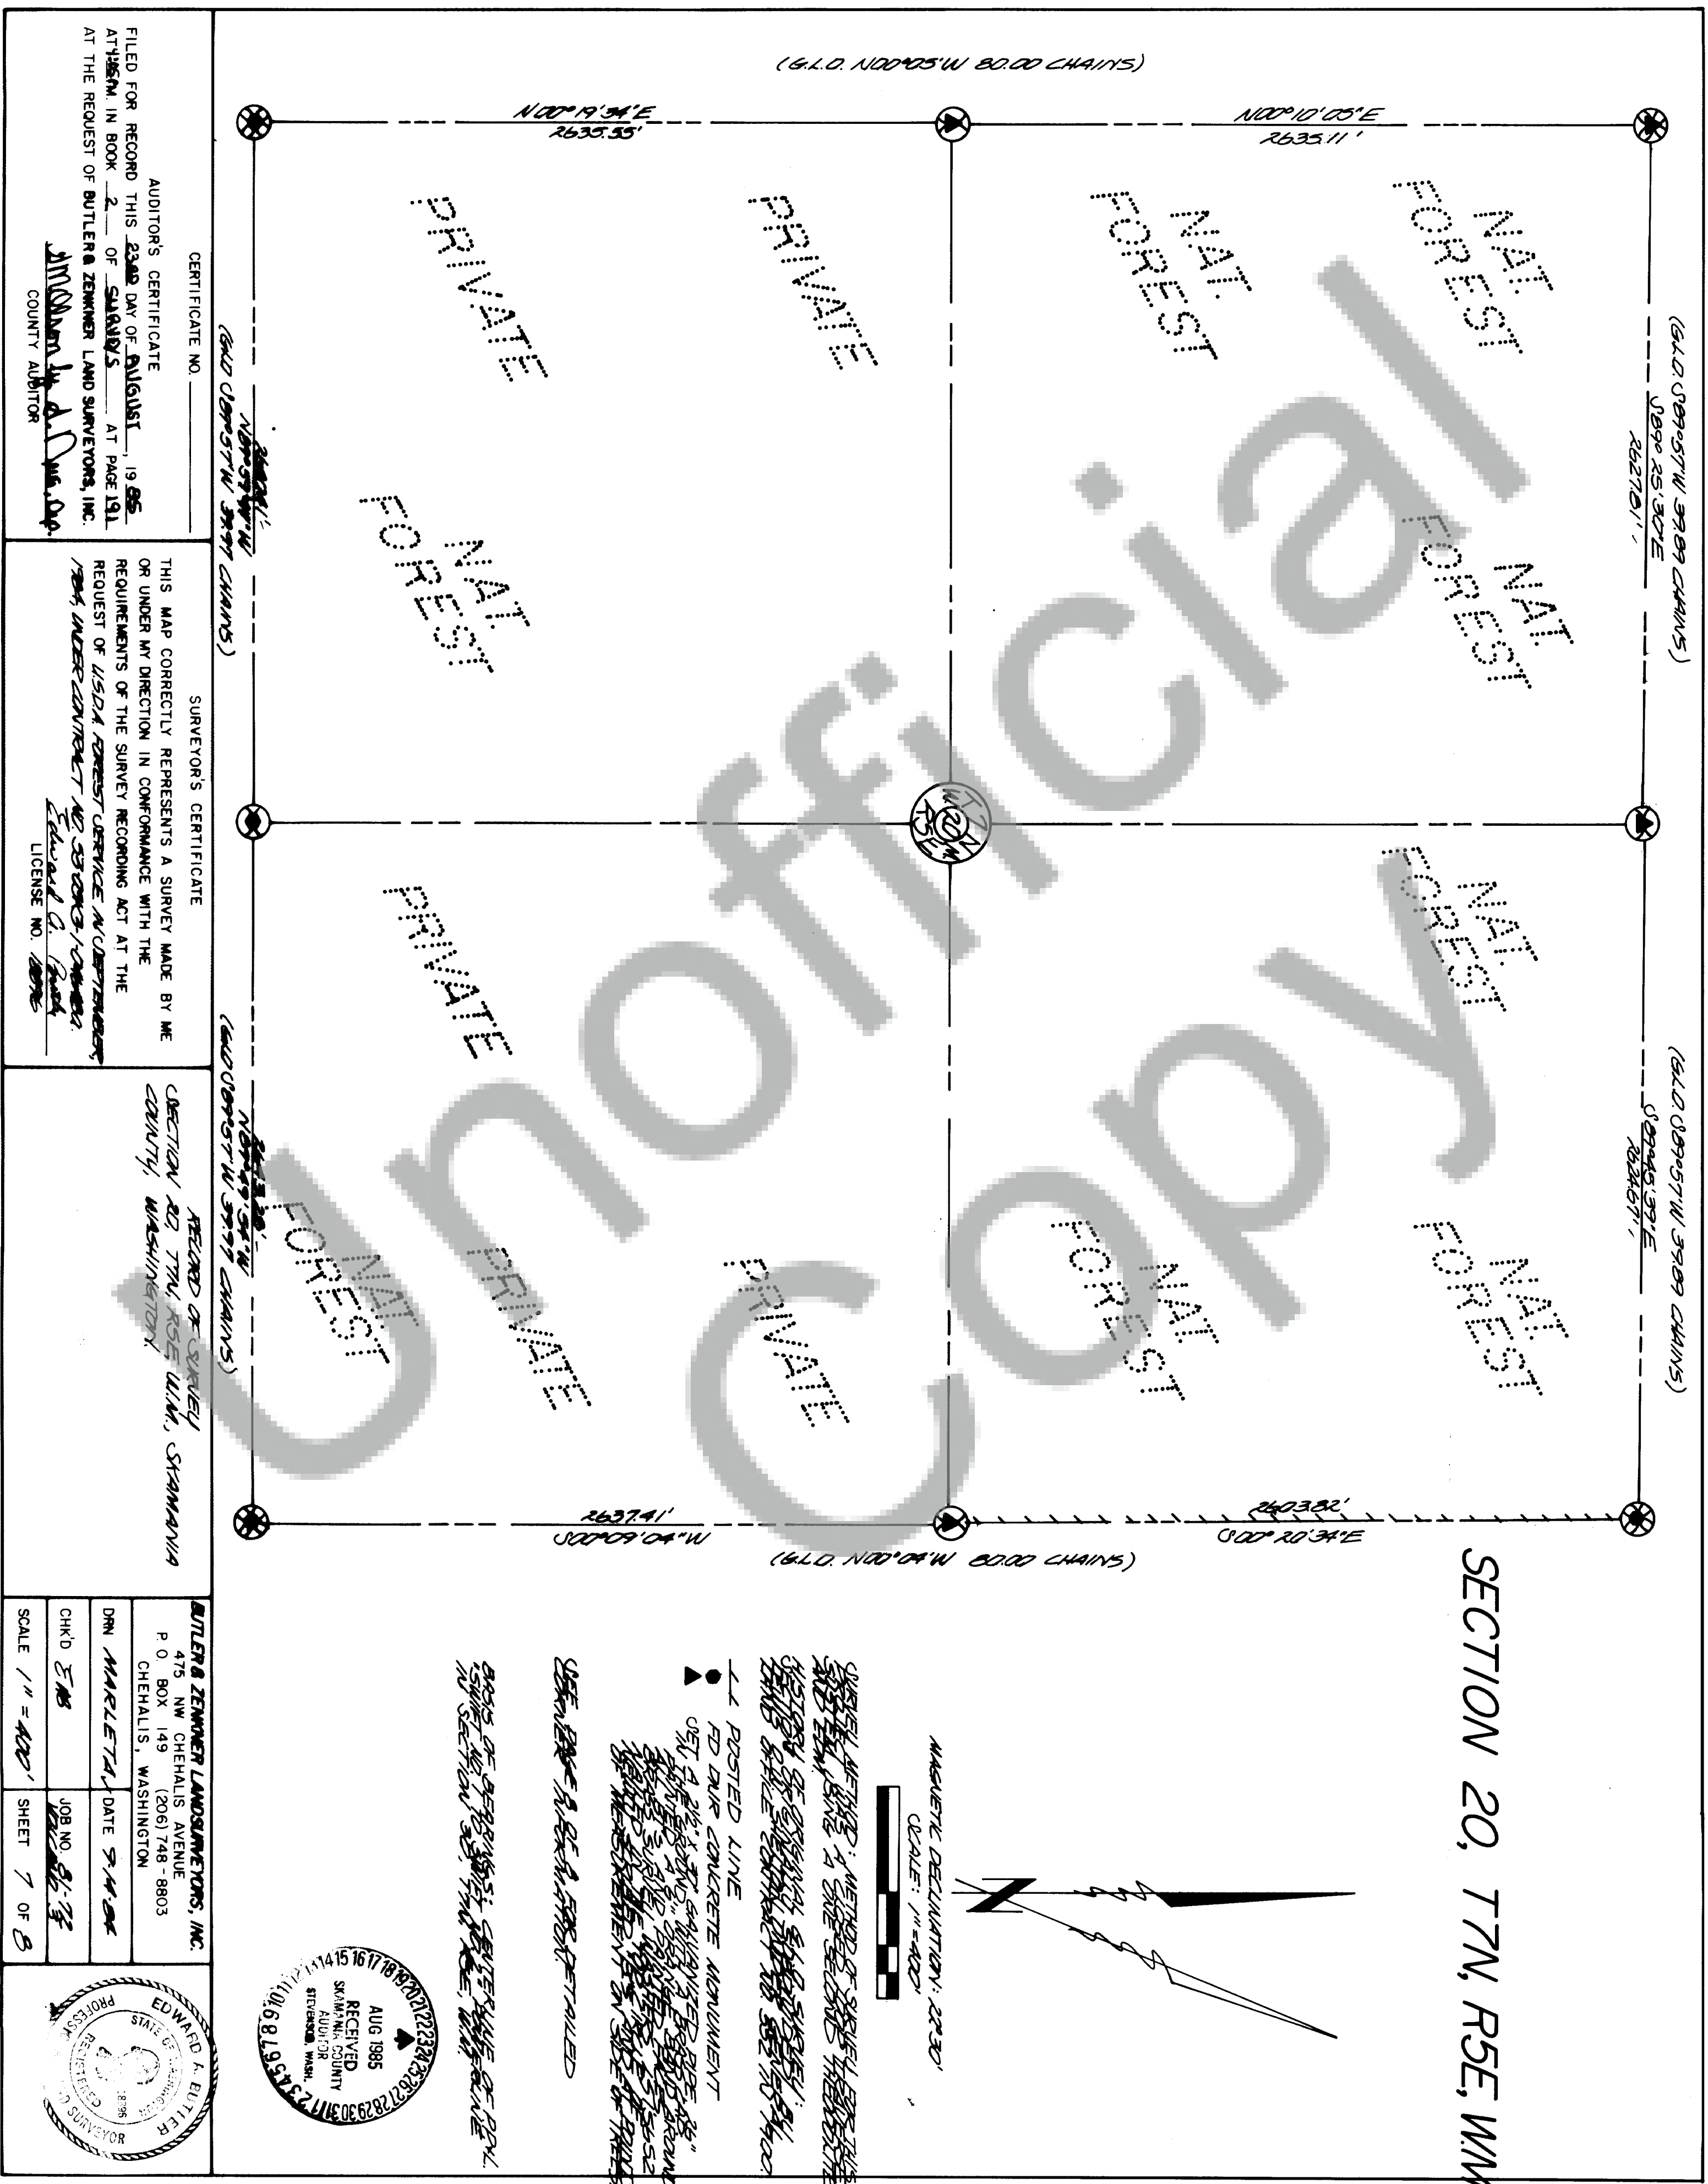


CORNER INFO - SECTION 20, T7N, R5E, W1N.

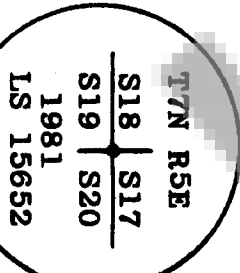


NORTHWEST CORNER SECTION 20, FB 161-1, Page 12
Found down metal fence post in mound of lava stone.
Found 12" Pine (down snag) OBT S63 3/4°E 23.10',
visible scribe, old USFS boundary, tag. Snag is
lying to Northwest.
Scribed new BT's:
12" Pine N67°E 32.17', scribed "T7N R5E S17 BT"
6" Pine N24°W 24.73', scribed "T7N R5E S18 BT"
10" Pine S62°W 31.91', scribed "T7N R5E S19 BT"
10" Pine S54°E 50.51', scribed "T7N R5E S20 BT"
Nailed 54-3 and 54-4 signs on all BT's.

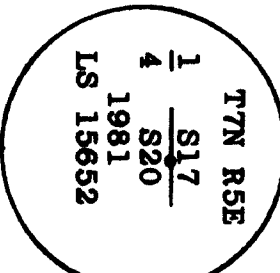


NORTH QUARTER CORNER SECTION 20, FB 161-1, Page 11
Found 13" I.P. out of position. S38°E 6.60'.
Found OBT's: 26" Hemlock N07°E 22.44', vis. scribe,
WeyCo tag.
26" Hemlock S35½°E 39.27'.
Nailed 54-3 and 54-4 signs on all BT's.

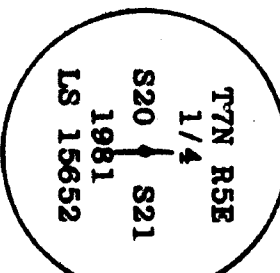


EAST QUARTER CORNER SECTION 20, FB 161-1, Page 18
Found 5/8" Rebar, 20" long, 2" out of ground.
Found OBT's: 26" Fir N70°E 24.42', vis. scribe,
USFS 54-3 sign.
10" Fir Stub S58½°W 20.46', visible scribe,
USFS 54-3 sign.
Scribed new BT:
34" Hemlock N64°W 49.31', scribed "1/4 S20 BT"
Nailed 54-3 and 54-4 signs on all BT's.

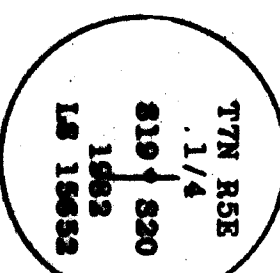


WEST QUARTER CORNER SECTION 20, FB 161-2, Page 3
Found "X" scribed in lava, as corner, with "1/4" marked
to West side on flat surface of lava cast.
Possible decayed remnants of 12" Black Pine, approx.
N41½°W 15.64'.
Set 2½" x 30" Aluminum Pipe, over "X" in a large mound
of stone with a 3½' base.
Scribed new BT's:
6" Pine N61°W 23.60', scribed "1/4 S19 BT"
9" Pine N63°E 26.65', scribed "1/4 S20 BT"
Nailed 54-3 and 54-4 signs on all BT's.
Set a 6" fiberglass guard post with 54-4 sign
attached South 3.7' on line.

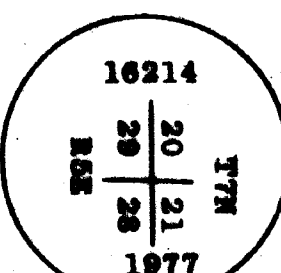

SOUTHWEST CORNER SECTION 20, FB 161, Page 7
Found OBT's:
24" Fir S66°E 23.10', visible scribe, USFS BT sign,
State tag, WeyCo tag, USFS 54-3 sign.
20" Fir Stump S23½°W 31.03', no scribe.
Found BP's: 18" Hemlock N15°W 2.60', state tag.
34" Fir N67°E 22.25', state tag.
10" Snag N06°E 22.50', USFS location poster.
Scribed new BT's:
6" Fir N63°E 24.69', scribed "T7N R5E S21 BT"
18" Hemlock N15°W 3.00', scribed "T7N R5E S20 BT"
11" Fir S60°W 24.45', scribed "T7N R5E S20 BT"
6" Fir S58°E 16.28', scribed "T7N R5E S28 BT"
Nailed 54-3 and 54-4 signs on all BT's.

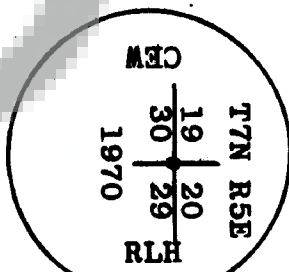

SOUTHWEST CORNER SECTION 20, FB 161, Page 7
Found 1" rebar on NE edge of monument with a metal
guard post.
Found OBT's:
24" Fir N34°W 20.46', visible scribe, USFS 54-3 sign
24" Fir Stump N74½°E 33.66', visible scribe, State BT sign
29" Fir Stump S15½°W 21.12', visible scribe, badly
deteriorated.
9" Fir Stump S22°E 28.36', no scribe, badly deteriorated.
Scribed new BT's:
24" Hemlock N31°E 33.49', scribed "T7N R5E S20 BT"
23" Fir S50°W 41.61', scribed "T7N R5E S30 BT"
6" Hemlock S29°E 46.32', scribed "T7N R5E S29 BT"
Nailed 54-3 and 54-4 signs on all BT's.

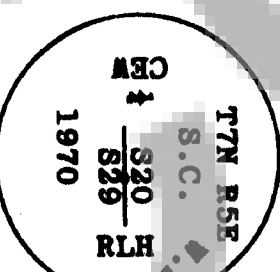

SOUTH QUARTER CORNER SECTION 20, FB 161-1, Page 14
Found OBT's:
36" Fir S40½°E 2.64', face grown over, USFS 54-3 sign,
location poster.
13" Fir (down) N11½°E 13.20', visible scribe, State
BT tag, USFS 54-3 sign.
Scribed new BT:
15" Fir N19°W 14.25', scribed "1/4 S20 BT"
Nailed 54-3 and 54-4 signs on all BT's.



CERTIFICATE NO. _____

AUDITOR'S CERTIFICATE
FILED FOR RECORD THIS 23RD DAY OF AUGUST, 1985
AT _____ OF _____ COUNTY, WASH.
AT THE REQUEST OF BUTLER & ZEMMER LAND SURVEYORS, INC.
Jim Butler
COUNTY AUDITOR

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME
OR UNDER MY DIRECTION IN CONFORMANCE WITH THE
REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE
REQUEST OF BUTLER & ZEMMER LAND SURVEYORS, INC.
EDWARD A. BUTLER
LICENSE NO. 18875

BUTLER & ZEMMER LAND SURVEYORS, INC.

475 NW CHEHALIS AVENUE
P.O. BOX 149
CHEHALIS, WASHINGTON 98531

DATE 9-20-84

JOB NO. 81-92

SHEET 8 OF 8

