

103452

T. N. TRANTOW SURVEYING

412 W. Jefferson P.O. Box 287

Bingen, Washington 98605 (509) 493-3111

LAND CORNER RECORD

FILED FOR RECORD  
BY T. N. TRANTOW SURVEYING  
JUL 7 12:39 PM '87  
AUDITOR  
GARY M. OLSON

T 4 N, R 9E, W.M. SKAMANIA County Corner Code No. N-15

Name: 1/4 corner common to Sections 15 & 22 Corner No.:  
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration: 2. Description of Evidence Found:

GLO in 1892 set a post for this corner, from which bear:  
6" fir, S52E, 15 links (9.90 ft.)  
10" fir, N27E, 22 links (14.52 ft.)

Pipe set by Broughton Lumber Co. for corner circa 1946.  
LS 16337 in 1984 rejected pipe and established corner by single proportion.


2. Found iron pipe

Found remains of rotted windthrow, burned, but with healed scars which may indicate the remains of a face. Position of tree fits call to pipe, but poorly.  
Found remains of a rotted & burned squared post, about 14" long & 4 1/2" square, tied with flagging and lying approx 3' East of pipe. Available records only indicate this pipe was set at least c. 1960, but no mention made of post. It is possible that post was found and replaced with pipe, as water table is only one foot below the surface in this swampy area. Post has been burned by the 1939 fire which went through this area, which predates any USFS work. The one degree bend in the section line at this corner is opposite, but identical to that noted at the North edge of Sec.15 and the South edge of Sec.23.  
Also found remains of a 2x2x30" 'poke' lying near corner, perhaps 20 yrs. old.  
I accept the pipe as the corner and reject the proportional position.  
I replaced the iron pipe with a new monument

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record.

F.B. No. ...40922... Page No. ....7... Job No. ....87325..... Date of Work ....15 April 1987.....


Replaced iron pipe with 1 1/2x30" galvanized iron pipe with 2 1/2" brass cap, 22" in the ground, from which bear:  
12" D-fir position, S30E, 6.9 ft.  
6" D-fir, N01W, 15.00 ft. to center of tree scribed on North side, 1/4S22BT  
Iron pipe for proportioned 1/4 corner, N01W, 46.19 ft.  
7" cottonwood, S66W, 28.13 ft. to nail in side @ center of tree scribed S22WT  
22" WRC cut stump, S30E, 19.18 ft. to nail in side @ center of stump  
Latter two WT's are marked with aluminum tags

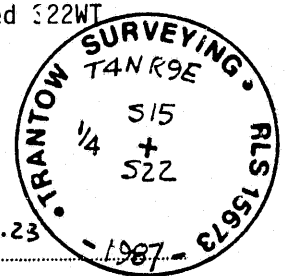

Washington Plane Coordinates: South Zone, Y 181813.81, X 1714603.23  
THIRD Order Accuracy. Derived From: 1977 DNR SURVEY IN S 23, T4NR9E.  
Pin Pointed on Photo No. NA Symbol Located at

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973.  
*Terry N. Trantow* Date 30 May 1987  
Signature Certificate No. 15673

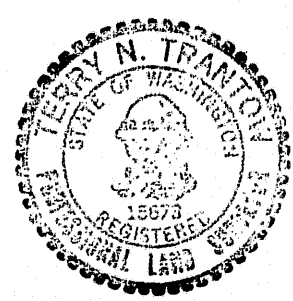

AUDITOR'S CERTIFICATE

Filed for record this day of 19 at Reg. M. In S  
Book of at page at the request of Indirect  
T. N. TRANTOW SURVEYING  
County Auditor Filed  
Mailed