

120256

BOOK 172 PAGE 534

FILED FOR RECORD
SKAMANIA CO. WASH
BY Longview Fibre

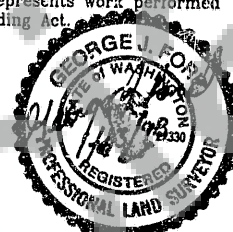
JAN 16 9 45 AM '98

GARY M. OLSON
AUDITOR

LAND CORNER RECORD

GRANTOR/ SURVEYOR/ PUBLIC OFFICER: This corner record correctly represents work performed by me or under my direction in conformance with the Surveying Recording Act.

COMPANY OR AGENCY: LONGVIEW FIBRE COMPANY

ADDRESS: PO BOX 667
LONGVIEW, WA 98632
GEORGE J. FORD, PLS
NO. 22330
EXP. 6-20-99

GRANTEE: PUBLIC

SEAL/SIGNATURE/DATE

LEGAL: SECTION 35

TWP: 3 NORTH

RGE: 6 EAST

CORNER CODE: Z-19

ADDITIONAL IDENTIFIER: (e.g., BLM designation, street intersection, plat, block, lot, etc.)

COUNTY: SKAMANIA

WASHINGTON PLANE COORDINATES: N: 135568.15

E: 1248337.68

ORDER: 1

ZONE: SOUTH

DATUM (Date of adjustment): NAD 83 (1991)

CORNER INFORMATION: Provide: (1) Pertinent History, (2) Evidence Found, and (3) Corner Perpetuation Information (diagram the references; provide the date of work; and, if applicable, reference to a map of record and/or the field book/page no.) Additional space is available on the back.

(1) Pertinent History: Corner was originally established by Charles E. Sears in 1883 under contract no. 287. DNR found corner in 1947.(2) Evidence Found: Found original bearing trees, now stumps
Found BT's: 42" Fir stp S40°E at 13.1 feet, healed scar, DNR tag 1951
18" Hemlock snag, N50°W at 20.15 feet, scribe visible(3) Corner Perpetuation Information: Set 3/4"x36" pipe with 2-1/2" brass cap stamped
New References: 11" Hemlock N54°E at 18.0 feet
13" Alder S82°W at 24.3 feet
Steel fence post North at 1.0 feetFOUND GLO BT:
18" HEMLOCK SNAG
WITH SCRIBE
(GLO NOTES N43°30'E AT 19.14')STEEL FENCE POST
NORTH - 1.0'

NO SCALE

NEW REFERENCE:
11" HEMLOCK
SCRIBED
[1/4S35BT]SET 3/4"x36" PIPE WITH
2-1/2" STAMPED BRASS CAPNEW REFERENCE:
13" ALDER
BARK SCRIBED
[1/4S2BT]FOUND GLO BT:
42" FIR STUMP, WITH SCAR
DNR TAG, 1951
(GLO NOTES S39°E AT 12.5')

DATE OF WORK: 10-10-97, FIELD BOOK: 97-01, PAGE: 13

This form is in compliance with the intent of RCW 65.04.045 and prescribed by the Public Land Survey Office, Department of Natural Resources - 9/96

MARK THE CORNER LOCATION BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE:
For corners at the intersection of two lines, the corner code is the alphanumeric coordinate that corresponds to the appropriate intersection of lines.

For corners that are only on one line, the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "B" and "C" is designated BC-5.

For corners that are between lines, the corner code is both line segments; i.e., a corner in the SE 1/4 of the SE 1/4 of section 18 is designated MN 4-5.

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C																									
D																									
E																									
F																									
G																									
H																									
J																									
K																									
L																									
M																									
N																									
O																									
P																									
Q																									
R																									
S																									
T																									
U																									
V																									
W																									
X																									
Y																									
Z																									

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT:

NOTES:

New References have a Longview Fibre Location Tag above the scribe and an 8" spike at bottom of scribe, all oriented toward monument. Bearings to references taken with hand compass having a declination of 21°e distances measured to spike.

The GLO distances did not intersect. The monument was set at the noted distances from the found original BTS.
A 6"x6" rotten post with DNR tag was also found N15°W at 1.5 feet from the set monument. The post had been displaced by a down tree. We could not determine where the post had been located originally. We had to remove a portion of the down tree to set the monument. DNR tag dated 7/3/51 noted the corner N39°W at 12.8' from the found Fir BT. The corner was established at 13.1 feet from the Fir BT.