150014

Norm Ward Aug 28 13 27 All 103

edited the and i feet

Walker !

LAND CORNER RECORD

GRANTOR/SURVEYOR/PUBLIC OFFICER: This corner record correctly represents work performed by me or under my direction, in conformance with the Survey Recording Act. VEYOR/PUBLIC OFFICER: This corner record correctly represents

COMPANY OR AGENCY:

USDA Forest Service

ADDRESS:

Gifford Pinchot National Forest 10600 NE 51st Circle Vancouver WA, 98682



Don Karsch Forest Land Surveyor

8/7/2003 Date

GRANTEE: PUBLIC

SEAL/SIGNATURE/DATE CORNER CODE: K-12 LEGAL: TWP: 4 North RGE: EAST CORNER CODE: K-12
ADDITIONAL IDENTIFIER: (BLM designation, street, or plat names, block, lot,

NE 1/16 SEC 16

COUNTY: SEAMANIA WASHINGTON PLANE COORDINATES: N:

ORDER: ZONE: DATUM: (DATE OF ADJUSTMENT:
CORNER INFORM:.ION: Discuss the history, evidence found, and perpetuation of the
corner. Diagram the references; provide the date of work; and if applicable, a
reference to a map of record and/or the field book/page no. Use the back, if needed.

Corner History:

This corner was originally established by Larry D. Bishop, PLS #16337 in May of 1982, and monumented with a 2 ½" x 30" aluminum pipe with a 2 ½" cap. He also marked 2 bearing trees

7" D-Fir S74°W, 18.9 ft. scribed "NE 1/16 S16" upper blaze and a lower blaze scribed "BT" Saze 16" D-Fir S4°W, 20.4 ft. scribed "NE 1/16 S16" upper blaze and a lower blaze scribed "BT"

On July 16, 2003 I found the corner monument, set 4" above ground, in good condition. Found Bishop BT's:

A 7" now 8" D.Fir found fallen. Root wad at record S74°W, 18.9 ft. with BT tag and visible overgrown faceblaze. A 16" new 19" D. Fir found live with visible overgrown face blaze bears S4°W, 20.4 ft.

New BT's Established:

A 23" D.Fir bearing S85°E, 43.7' was scribed "NE 1/16 S16 BT" $\,$

Placed "BT" tags and "Land Survey Monument" signs on all BT's. Painted 6" red band and faces on all Bt's. Set location tag on 19" D. Fir bearing N50°W 2.8'

Corner sits on flat ground in stand of 2nd growth Douglas Fir trees. Forest service property lies south and west of corner. Property lines leading north and east from corner are brushed, blazed, and posted w/USFS carsonite posts. Bearings are by Forest service compass w/ 18° East declination. Distances are to nail in side center of bearing tree.


Witnessed by: Georgene Wheatley, U.S.F.S., John Hodges, Stevenson High School.

This form is in compliance with the intent of RCW 65.04.045 and prescribed by the Public Land Land Survey Office, Department of Natural Resources - 1/97.

MARK THE CORNER LOCATION BELOW AND FILL IN THE CORNER CODE JLANK ON THE OTHER SIDE: For corners at the intersection of two lines, the corner code is the alphanumeric coordinate that corresponds to the appropriate intersection of lines.

For corners that are only on one line, the corner code is the line designation and the related line segment; i.e., a corner on line 5 between 'B' and "C" is designated BC-5.

For corners that are between lines, the corner code is both line segments; i.e., corner in the SE1/4 of the SE1/4 of section 18 is designated MN 4-5.

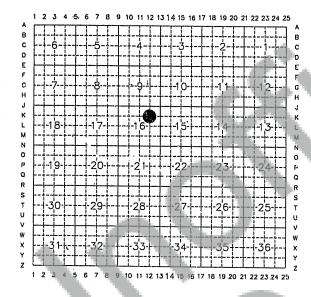

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

ACE FOR ADDITIONAL COMMENT:

Found 21/2" x 30" Aluminum pipe w/21/2" Location Tag [aluminum cap about 4" above ground. N50°W _ 2.8ft. NE YIL S85° E My New BT 3V 23" D-FIR Bishop BT