

93979

3/8 PAGE 34

T. N. TRANTOW SURVEYING

P.O. Box 287
Bingen, Washington 98605

LAND CORNER RECORD

T. 3 N, R. 8 E, W.M. SKAMANIA County
Segregated Surveys: Corner Code No. 0-3Name: S-C 1/16 of Section 19 Corner No.:
DLC, IES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:

No record of previous establishment

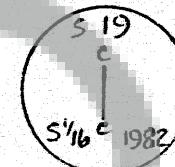
2. Description of Evidence Found:

No evidence of previous establishment

3. Describe Monument, Accessories and Corellary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 30819 Page No. 48 Date of work April 19, 1982

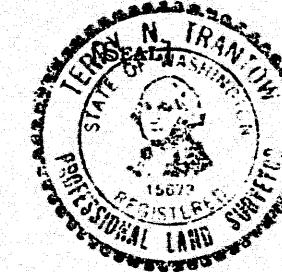
Set a $1\frac{1}{4}$ x 30" galvanized iron pipe with 2 $\frac{1}{2}$ " brass cap 18" in the ground, from which bear:8" D-fir, N46W, 5.51 ft. to nail in face on root collar scribed 1/16WT
6" D-fir, S25W, 22.77 ft. to nail in face on root collar scribed 1/16WT

Both trees are marked with SDS Lumber Company witness tags

Registered
Indexed
Indirect
Recorded
MailedWashington Plane Coordinates: South Zone, Y 147396.97, X 1656593.12
Third Order Accuracy. Derived From: Skamania County control surveys, 1977

Pin Pointed on Photo No. 92-7 Date SW-74 Located at Trantow Surveying, Bingen

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or
under my direction in compliance with the provisions of Chapter
50, Laws of 1973. Date 17 May 1982Signature Terry N. Trantow 15673 Certificate No.

AUDITOR'S CERTIFICATE

Filed for record this 1st day of May 1982 at 12 M. In
Book 31 at page 34 at the request of
TRANTOW SURVEYINGSigned Gregory W. Johnson
County AuditorForm prescribed by Bureau of Surveys and Maps pursuant to the provisions of Section 5 (2),
Chapter 50, Laws of 1973.

HAGEDORN, INC.
"SUITE B"
1924 BDWY Vancouver, Wash.
Ph.(206) 696-4428

LAND SURVEYORS

*Subdivisions, Boundaries, Control, Topography,
Construction Surveys, & Road Layout*

T 1 N. R. 5E . W.M.
Segregated Surveys.

1/5 16

LAND CORNER RECORD

Skamania County
Corner Code No. A-23

Name Quarter corner common to Sections 1 (1N-5E) & 36 Corner No.:
S40:34 DLC HES Tract. Mining Claim. Indian Allotment. Federal Reserve. Townsite.
(2N-5E)

1. History of Corner Establishment and Subsequent Restoration:

Wood post in stone mound originally set by Van Fleet and Newsome in 1860 from which a Fir 30 inches bears North 88° West 58.7 feet (89 links). I found a 40 inch rotting stub which is the only likely BT of the correct age in the probable area. At record bearing and 60.3 feet from this tree (no marks visible) I uncovered what appeared to be the remnants of a rock pile with the rotted remains of a wood stake that went down into the rocks in a vertical position, (penetrated approximately 8 inches from present surface). This area has been cat logged and it is very possible that a machine or log has disturbed this evidence. Because the whole area is very rocky the appearance of this rock mound does not differ substantially from natural rock outcrops. However, because it is at record distance and bearing from a likely BT snag, and had a vertical wood stake within the rocks, I feel that this was the original quarter corner, (especially in light of its relationship to adjacent corners East and West). I chained West to check the "call" for the "foot of precipice" and find it to be almost 2 chains long. This is understandable, though, when you consider that Van Fleet was going East, called the top of the bluff (400 feet vertical), and set a flag at the "foot", measured a base 5.00 chains North, and sighted back to top of cliff. He could not possibly have set the "flag" at what we would consider the "foot of precipice" because you cannot see it from the top. Also, since the bluff runs Northeasterly, he could not run a base 5.00 chains North without tunneling into it, let alone sighting back. It becomes obvious that in this case, (and probably the line between 1 and 2 and others) the call for the "foot" is not reliable and the actual point used was several chains out from the base of the cliff. If you measure the record distance West from the quarter corner above described, it falls in a spot that could easily been sighted from above.

Set 5/8 inch iron rod with plastic cap

RPS (with railroad spike at base and metal tage at DBH)

8" Grand Fir North 48° East 10.54 feet.
14" Fir South 37° East 22.11 feet.
20" Fir South 62° West 13.15 feet.

Washington Plane Coordinates: Zone, Y. X.
Order Accuracy. Derived From:

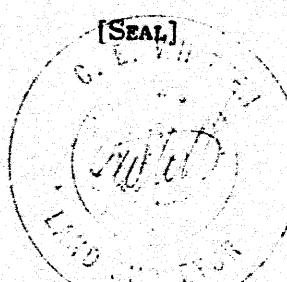
Pin Pointed on Photo No. Date. Located at.

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date 4-20-82

Signature

12412
Certificate No.



AUDITOR'S CERTIFICATE

Filed for record this 27th day of May 1982 at 3:00 P.M. In
Book 115 of Monuments at page 16 at the request of

Gary H. Olson, Valentine, Asst.
County Auditor

Form prescribed by Bureau of Surveys and Maps pursuant to the provisions of Section 5 (2), Chapter 50, Laws of 1973.

ROLL 682.1
DAILY RECORDINGS
BOARD OF COUNTY COMMISSIONERS
MARKING & APPLICATING

HAGEDORN, INC.

"SUITE B"

1924 BDWY. Vancouver, Wash.

Ph.(206) 696-4428

LAND SURVEYORS

Subdivisions, Boundaries, Control, Topography,
Construction Surveys, & Road Layout

T 1 N. R. 5E. W.M.

Segregated Surveys:

Name Quarter corner common to Sections 1 & 2

1/5 17

LAND CORNER RECORD

Skamania

County

Corner Code No. C-21

Corner No.

D.L.C. H.E.S. Tract. Mining Claim. Indian Allotment. Federal Reserve. Townsite

94025

1. History of Corner Establishment and Subsequent Restoration:

Wood post originally set by "Van Fleet and Newsome" in 1860, from which a Fir 30" bears South 68° West 48.2 feet (73 links) and a 30 inch Fir bears South 70° East 34.3 feet (52 links). This corner was set on a true line running South from the North boundary of the Township and a call was made at the corner for "commence ascending". I found the Section 2 BT with scribing visible on upper blaze "1/4" and axe marks on lower blaze (both blazes being burned). This BT is an uproot stump lying on its side (pointing Southerly). At first glance, it appears that the uproot was pushed down to its present position by a cat (area was logged in approximately 1940). Upon closer inspection, I noticed that the inverted roots are not weathered as are other blowdown trees, indicating that the stump has only tipped over in the last year or two. It is lying on top of the "shell" of a down log which has rotted away, allowing the BT to fall over recently. I also found rotted wood in the ground under the exposed roots indicating that it had been attached at this point. If you were to stand the uprooted stump back up, the scribed face would bear exactly as called for in the GLO notes and the corner position is immediately at the base of a 150 foot high knoll to the South (matching the "commence ascending" call). I could not locate the other BT called for. Approximately North 70° West, 5 links (GLO: South 70° East, 52 links) would be the position of the only other tree of the appropriate age and size in the area. This tree is also an uproot, tree length that has broken and rolled slightly upon impact or during logging. I can find no axe marks on it at all. A corner position at record bearing and distance from this tree would be up on the South slope among a group of stumps that may have been young trees at the time of the original survey. This location does not fit the call for ascent by about a chain. I discard this point as unsatisfactory and set 5/8 inch iron rod at record bearing and distance from the Section 2 BT.

RPS: 24" Fir South 45° West 22.26 feet
12" Alder East 23.80 feet
8" Alder North 52° West 16.06 feet.

Note: Post in rock pile and 1962 DNR tags (immediately above logging road)
188 feet North 03° West of true quarter corner.

ROLL 682.1
DAILY RECORDINGS
BOARD OF COUNTY COMMISSIONERS
MARKING TRIPULATIONS

Washington Plane Coordinates: Zone, Y, X
Order Accuracy. Derived From:

Pin Pointed on Photo No. Date Located at

[SEAL]

SURVEYOR'S CERTIFICATE
This corner record correctly represents work performed by me or
under my direction in compliance with the provisions of Chapter
50, Laws of 1973. Date 4-20-82

Signature

12412
Certificate No.

94025

AUDITOR'S CERTIFICATE

Filed for record this 27th day of May 1982 at 3:00 P. M. In
Book 1/5 of Monuments at page 17 at the request of

Hagedorn, Inc.
J. B. Dean, Auditor
County Auditor

Form prescribed by Bureau of Surveys and Maps pursuant to the provisions of Section 5 (2),
Chapter 50, Laws of 1973.