BOOK 33 PAGE 142

Jan 29 -LOLSON GAR

> # arteind indexed. Indirect Februs 2 Mailed AUDITOR'S USE

LAND CORNER RECORD

(THIS FORM PRESCRIBED BY THE PUBLIC LAND SURVEY OFFICE, DEPARTMENT OF NATURAL RESOURCES, PURSUANT TO RCW 58.09. ALPHA-HUMERIC INDEX DIAGRAM ON THE BACK.)

CORNER INDEXING INFORMATION:

RGE

CORNER CODE

(Villamette Heridian)

(See instructions on back of LCR)

ADDITIONAL IDENTIFIER: (e.g., 8LM designation for the corner, street intersection, plat name, block, lot, etc.)

NORTH 1/4 CORNER SECTION 34

SKAMANIA COUNTY:

DATUM (Date of adjustment):

LAND SURVEYOR INFORMATION: (or Public Officer as per RCW 58.09.090)

This corner record correctly represents work performed by me or under my direction in conformance with the Survey Recording Act.

COMPANY OR AGENCY:

OLSON ENGINEERING INC.


ADDRESS:

IIII BROADWAY VANCOUVER, WA 98660

WASHINGTON PLANE COORDINATES:

ZOME:

CORNER INFORMATION: Use the space below to provide the following information regarding the corner: (1) Pertinent Corner History. (2) Evidence Found at the Corner, and (3) Corner Perpetuation Information. Please title and number the parts of your discussion accordingly. If additional space is needed use the back. (For (3), diagram the references. Also, provide the cross-reference to a map of record, if applicable, the surveyor's field book no./page no., and the date of work.) (See the back of this form for the requirements of the Survey Recording

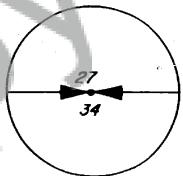

In 1875, Smith and Spray, Surveyors for the General Land Office set a willow post for the North quarter of Section 34. The bearing trees are as follows:

An Ash 5" in diameter bears North 75° East 30 links distance. An Ash 4" in diameter bears South 35° East 10 links distance. No evidence

remains of the post or bearing trees. In 1935, for a survey for the "Bonneville Project Lands", the U.S. Corp of Engineers shows an iron pipe at the quarter corner, being 308.27 West of the Murphey-Robbins Donation Land Claim line.

In 1955, Wall and Tenneson also show an iron pipe at 308.27 West of the said Donation Land Claim line.

In June, 1988, Trantow surveying does not mention monumentation of the said corner, however it shows it being 308.27' West of the said Donation Land Claim line.

In September 1990, we calculated the said guarter corner, based on the 1935 U.S. Corp of Engineers Plat. Reference Surveys:

Weiss and Perkins May 1952 U.S. Corp of Engineers R-O-17-6 Tranton Surveying Book 2 Page 291 Wall and Tenneson Rec. February 1955 MARK THE CORNER LOCATION ON THE DIAGRAM BELOW AND FILL IN THE CORNER CODE BLANK ON THE DIHER SIDE: (1) For corners located at the intersection of two lines (Section corners, quarter corners and sixteenth corners):


(a) The correr code is the alpha-numeric coordinate from the diagram below that corresponds to the appropriate intersection of lines.


(2) For corners that are not located at the intersection of two lines (Meander corners, DLC's, HES's, reservation boundaries, mining claims, etc.):

(a) For corners that are on one line only the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "8" and "C" is designated 8C-5.

(b) For corners that are between lines tre corner code is both line segments; i.e., a corner in the

SEI/4 of the SEI/4 of section 18 is designated MM-4-5.



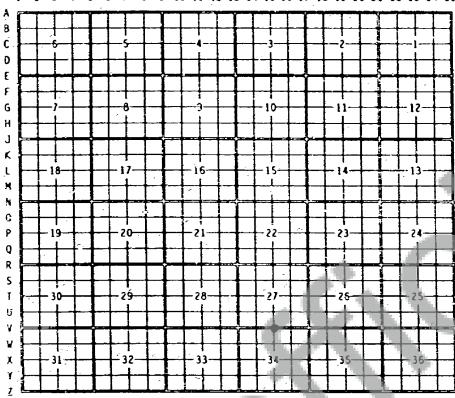

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT: