

116155

BOOK 135 PAGE 61

FILED FOR RECORD
SKAMANIA CO WASH
By Robert GlaeserMAY 4 9 15 AM '93
A. Hallem

GARY M. OLSON

LAND CORNER RECORD(THIS FORM PRESCRIBED BY THE PUBLIC LAND SURVEY
OFFICE, DEPARTMENT OF NATURAL RESOURCES, PURSUANT
TO RCW 58.09. ALPHA-NUMERIC INDEX DIAGRAM ON
THE BACK.)

SEARCHED	
INDEXED	
SERIALIZED	
FILED	

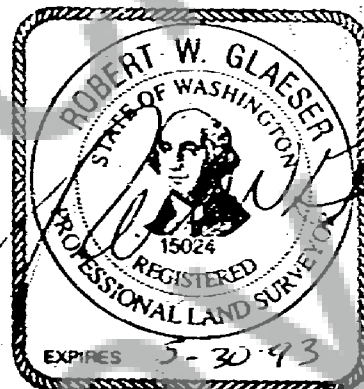
Corner Indexing Information:TWP 2 North RGE 6 East Corner Code X-9
(Willamette Meridian)ADDITIONAL IDENTIFIER: (e.g., BLM designation
for the corner, street intersection, plat name,
block, lot, etc.)

West quarter, Section 33, T2N, R6E, Willamette Meridian.

Skamania County Washington:

AUDITOR'S USE

Land Surveyor Information: (or Public Officer as per RCW 58.09.020)

This corner record correctly represents work performed by me or
under by direction in conformance with the Survey Recording Act.Company or agency:
Minister & Glaeser Surveying, Inc.
2208 E. Evergreen Blvd.
Vancouver, WA. 98661
Phone: (206) 694-3313
Fax: (206) 694-8410Signature [Signature] Date: 4-20-93 Seal: 15024Washington Plane Coordinates: N: _____ E: _____
Order: _____ Zone: _____ Datum (Date of adjustment): _____**Corner Information:** Use the space below to provide the following
information regarding the corner.**(1) Pertinent Corner History:**The original survey was conducted by Deputy Surveyor Charles E.
Sears under Contract No. 287, dated December 23, 1882. The
survey was performed between March 16, and June 26, 1883. Set a
post 3' long and 3" square, 24" in mound of stones, 40.00 chains
North from the Southwest corner of Section 33.

B.T.'s as follows:

24" Diameter Dead Fir, North 85° East, 60 links

30" Diameter Fir, South 23° - 30' East, 300 links

On May 8, 1969 C.E. Whitten & Jerry Otto set a standard DNR
Monument, stamped as shown at the above corner. They found what
was believed to be the Section 33 BT. It was in the same
condition as the Southeast BT for the corner common to sections
27, 28, 33 & 34, Township 2 North, Range 6 East. A large portion
of overgrowth was found on the ground. (No reverse scribing). The
stump was cut close to the ground and C.E.W. believed this to be
the overgrowth covering the bottom of the face. Distance South of
the closest good corner is 5258 (tellurometer). For the above
reasons C.E.W. believe this to be the original position of the
corner.

SEARCHED	
INDEXED	
SERIALIZED	
FILED	

Set 3 tags R.D.S.

B.T. 50" Fir Stump, South 23 1/2° East, 198.0 ft.

B.T. 14" Fir, South 31° West, 21.4 ft.

B.T. 16" Fir, North 44° West, 18.6 ft.

(2) Evidence Found at the Corner: BOOK 135 PAGE 62

No original evidence was found.

Standard D.N.R. Monument was accepted as the corner based on reputation and use.

(3) Corner Perpetuation Information:

Surveys

Book 2, Page 144

Book 2, Page 237

Book 1, Page 97

Short Plats

HAVE THE CORNER LOCATION ON THE DIAGRAM BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE.

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C			6				5				4				3				2						
D																									
E																									
F																									
G			7				8				9				10				11						
H																									
J																									
K																									
L			19				17				16				15				14						
M																									
N																									
O																									
P			19				20				21				22				23						
Q																									
R																									
S																									
T			30				29				28				27				26						
U																									
V																									
W																									
X			31				32				33				34				35						
Y																									
Z																									

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENTS:

IN NOVEMBER, 1988 JERRY C. OLSON HAD REFERENCED FOUND D.N.R. CONC. MON. WITH BRASS CAP. WE FOUND R.P.'S IN GOOD ORDER, AS PER J.C. OLSON SURVEY AT REQUEST OF SAFECO INSURANCE CO.

R.P.'S
AS FOLLOWS:
22" FIR W/R.R. SPIKE & O.E. TAG, N47°W 18.08
12" FIR W/R.R. SPIKE & O.E. TAG, N83°E 15.69
16" FIR W/R.R. SPIKE & O.E. TAG, S26°W 20.85