

127151

BOOK 162 PAGE 21

FILED IN RECORD
SKAMIA COUNTY WASH
BY Jerry Olson


JAN 21 12 35 PM '97

GARY H. OLSON
AUDITOR

LAND CORNER RECORD

GRANTOR: JERRY C. OLSON This corner record correctly represents work performed by me or under my direction in conformance with the Public Land Survey Act.

COMPANY OR AGENCY: Olson Engineering Inc.

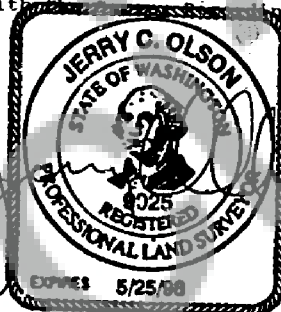ADDRESS: 1111 Broadway
Vancouver, Wa 98660**OLSON**
ENGINEERING INC.1111 Broadway Vancouver WA 98660
(206) 546-1288 • (206) 546-2121 • Fax (206) 546-2117

GRANTEE: PUBLIC

LEGAL: NE 5 TWP:

1N

RGE:

5E

CORNER CODE: A-9

ADDITIONAL IDENTIFIER: (BLM designation, street or plat names, block, lot, etc.)

NORTHEAST CORNER OF SECTION 5

COUNTY: SKAMANIA

WASHINGTON PLANE COORDINATES: N:

E:

ORDER:

ZONE:

DATUM (Date of adjustment):

CORNER INFORMATION: Discuss the history, evidence found, and perpetuation of the corner. Diagram the references; provide the date of work; and, if applicable, a reference to a map of record and/or the field book/page no. Use the back, if needed.

The original Northeast Section corner was established by L. Van Vleet and John Newsom under contract #47 in 1859 as a post with accessories of: A 40" fir South 36° East 96 links, an 18" Fir North 82° East 126 links an 8" Willow South 36° West 119 links and a 7" Willow North 75° West 37 links.

In 1911 C. La Barre visited the site and reset the post from 2 of the bearing trees "one a stump the other green and a stump of third." (Book 5, Page 4)

A survey by Fred Laws (date unknown) shows that during a dependent resurvey the topographic calls matched the general land office notes and at the Northeast corner he established new accessories of: A 30" Fir North 44° West 472 links, a 40" Fir North 55° East 227 links a 40" Fir South 15° East 39 links and a 30" Fir South 54° West 147 links.

In 1980 Olson Engineering crews found a Washington Department of Game Concrete Monument Set. West 2641.13 feet from the North quarter corner of Section 4 and South 2570.11 feet from the East quarter corner of Section 32, Township 2 North, East 5 East. Olson records do not indicate the existence of any original or secondary accessories.

REFERENCES:

Hagadorn Book 1, Page 6


(40380001.lcr)

This form is in compliance with the intent of RCW 65.04.045 and prescribed by the Public Land Survey Office, Department of Natural Resources - 1/97.

Registered	✓
Indexed, Fir	✓
Indirect	✓
Filmed	
Mailed	

MARK THE CORNER LOCATION ON THE DIAGRAM BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE:

- (1) For corners located at the intersection of two lines (Section corners, quarter corners and sixteenth corners):
- (a) The corner code is the alpha-numeric coordinate from the diagram below that corresponds to the appropriate intersection of lines.
- (2) For corners that are not located at the intersection of two lines (Meander corners, DLC's, HES's, reservation boundaries, mining claims, etc.):
- (a) For corners that are on one line only the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "B" and "C" is designated BC-5.
- (b) For corners that are between lines the corner code is both line segments; i.e., a corner in the SE1/4 of the SE1/4 of section 18 is designated MN-4-5.

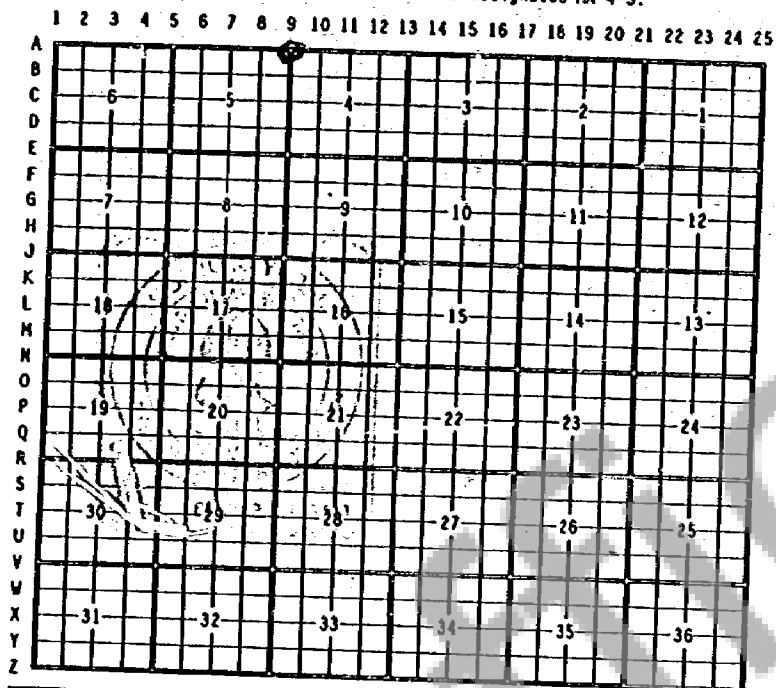

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT: