


SURVEY in S½ Sec. 21, T2N, R5E, W.M.

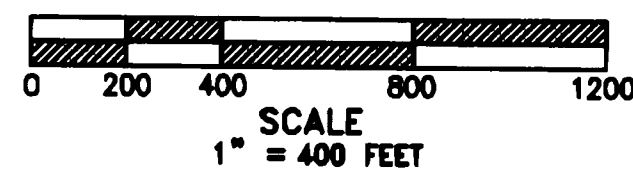

LEGEND

- Monument found
- () Call of record
- x-x Fenceline

REFERENCES (those listed are considered as part of this drawing and may provide survey information or detail not shown hereon):

1. B.2, P.91 of Surveys, #95169 [P.1 of 17]
2. B.2, P.107 of Surveys, #95169Q [P.17 of 17]
3. 1938 B.P.A. Plat, PLSO files, Olympia

Basis of bearings taken from 1971 DNR survey along West edge of Section, as shown

Trantow Surveying makes no warranty as to matters of unwritten title; environmental concerns; the accuracy or position of features shown without dimension.

TRANTOW SURVEYING, INC.
412 W. Jefferson-POB 287
Blingen, WA 98605-0287
Ph 509/493-3111 Fx 509/493-4309
Member of Land Surveyor's Assoc. of Washington

SURVEY FOR

HULL TRUST
Wilma Lee Hull, Trustee

SKAMANIA CO., WASHINGTON

#2106

© 2003

KW



TRAVERSE STATEMENT: A closed field traverse for the parcel shown was made with a Sokkia five-second total station and related measuring equipment, all of which met State standards of WAC 332-130 at the time of this survey. Acceptable raw distance closures were balanced by compass adjustment where necessary to effect mathematical closure. Physical appurtenances which may be in conflict with existing conditions or items of record are noted or depicted. Field work was conducted during the period of January 2 - February 25, 2003.

SURVEY NARRATIVE: All corners of the parcel were recovered in good condition. Some new witness trees were added to some corners, but new Land Corner Records were written for all corners. The entire perimeter of the property was flagged, painted and marked with steel fence posts. Line trees were blazed and painted. See additional note for the Southwest corner of Section 21.

DNR con.mon.
Tied 1/16/03

20 21

S89°13'09"E 5249.53

21 22

LS9025 BC
Tied 1/6/03

2635.43 (GLO 2640)
N 1°23'50"E
fence is on line
(Basis of bearings)

316.95 Ac. ±

(Tax Parcel No. 02-05-00-0-0-4200-00)

The DNR monument was established in 1963 from the original bearing trees. An unsigned, unrecorded corner record indicated a County IP & BC some 55 feet to the West was destroyed at the request of the County Engineer. A portion of the pipe still remains.

20 21

S89°12'26"E 2613.20 (GLO 2631.42)

Ska.Co.BC
Tied 1/7/03

21 28

S89°44'02"E 2635.08 (GLO 2632.08)

Ska.Co.BC
Tied 1/2/03

21 22

29 28

DNR con.mon.
Tied 1/8/03

North Bonneville Troutdale Lines 1 & 2 (R.3)

28 27

1428.96 (GLO 1452)
S 1°21'59"W

access road gate

1183.34 (GLO 1188)
S 1°24'55"W

LS9025 WC
for line tree
Tied 1/6/03

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Survey Recording Act at the request of Musselman & Associates, Inc. in December, 2002.

Terry N. Trantow
Terry N. Trantow, PLS 15673

3-03-03
Date

AUDITOR'S CERTIFICATE

Filed for record this 12th day of March, 2003 at 12:22pm
Book 3 of SURVEYS at Page 450, AF# 147913
at the request of Trantow Surveying.

J. Michael Harrison
County Auditor Deputy