

LAND CORNER RECORD

GRANTOR/SURVEYOR/PUBLIC OFFICER: This corner record correctly represents work performed by me or under my direction, in conformance with the Survey Recording Act.

COMPANY OR AGENCY: USDA Forest Service
ADDRESS:
Gifford Pinchot National Forest
10600 NE 51st Circle
Vancouver WA 98682



Don Karsch 9/01/2004
Forest Land Surveyor Date

GRANTEE: PUBLIC **SEAL/SIGNATURE/DATE**
LEGAL: SECTION CORNER 23,24,25,26 TWP: 4 NORTH RGE: 7 EAST CORNER CODE: R21

ADDITIONAL IDENTIFIER: BLM designation, street, or plat names, block, lot, etc.

COUNTY: SKAMANIA

WASHINGTON PLANE COORDINATES: N: E:

ORDER: **ZONE:** **DATUM:** (DATE OF ADJUSTMENT):

CORNER INFORMATION: Discuss the history, evidence found, and perpetuation of the corner. Diagram the references; provide the date of work; and if applicable, a reference to a map of record and/or the field book/page no. Use the back, if needed.

Corner History:

Brass cap set by Skamania County, date unknown. The corner was then perpetuated in 1974 by Shepherd LS# 7189, and then subsequently perpetuated in 1977 by Olson LS# 9025, in 1981 by Gaylord LS# 18731, and in 1982 by the Bureau of Land Management.

Olson BT's:

A 20" Douglas Fir - N50°E, 39 links, marked with a healed blaze and a railroad spike at base.

A 10" Douglas Fir - S68°E, 27 links, also marked with a healed blaze and a railroad spike at base.

BLM BT's:

A 19" Cedar - S34°30'W, 66 links, marked "T4N R7E S26 BT."

A 12" Douglas Fir - N17°30'W, 45 links, marked "T4N R7E S23 BT."

On Sept 8, 2004 I searched for the corner, and found that it has been obliterated by the 1996 Stabler Slide. Corner sits in the finger of slide and is not suitable for remonumentation.

Found BT's:

12" now 16" Douglas fir live with overgrown face blaze. Attention sign and BT tags are visible. Painted red 6" band and face of BT.

New RM's established:

Set a 5/8"X 30" iron rebar with a 2" aluminum cap, flush with ground, S85°46'47"W, 56.84 ft. from the section corner position as determined by record call from found NW BT. Placed carsonite guard post, marked Land Survey Monument, behind the RM facing the section corner.

Set a 5/8"X 30" iron rebar with a 2" aluminum cap, flush with ground, S47°16'34"E, 47.68 ft. from the section corner position as determined by record call from found NW BT. Placed carsonite guard post, marked Land Survey Monument, behind the RM facing the section corner.

New BT's established:

An 18" Cedar bearing S19°54'28"W, 81.79 ft. scribed "T4N R7E S26 BT."
Placed "BT" tag and "Land Survey Monument" signs on BT. Placed washer in tree face, and nail at side center. Painted red 6" band and face of BT.


Forest service property lines leading south and west from corner are brushed, blazed, painted, and posted w/USFS carsonite posts. Bearings are based on Survey BK 3/PG 310. Distances are to side center nail in each bearing tree.

Witnessed by: Georgene Wheatley, LSIT #74341

MARK THE CORNER LOCATION BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE:
For corners at the intersection of two lines, the corner code is the alphanumeric coordinate that corresponds to the appropriate intersection of lines.

For corners that are only on one line, the corner code is the line designation and the related line segment; i.e., a corner on line 5 between 'B' and 'C' is designated BC-5.

For corners that are between lines, the corner code is both line segments; i.e., a corner in the SE1/4 of the SE1/4 of section 18 is designated MN 4-5.

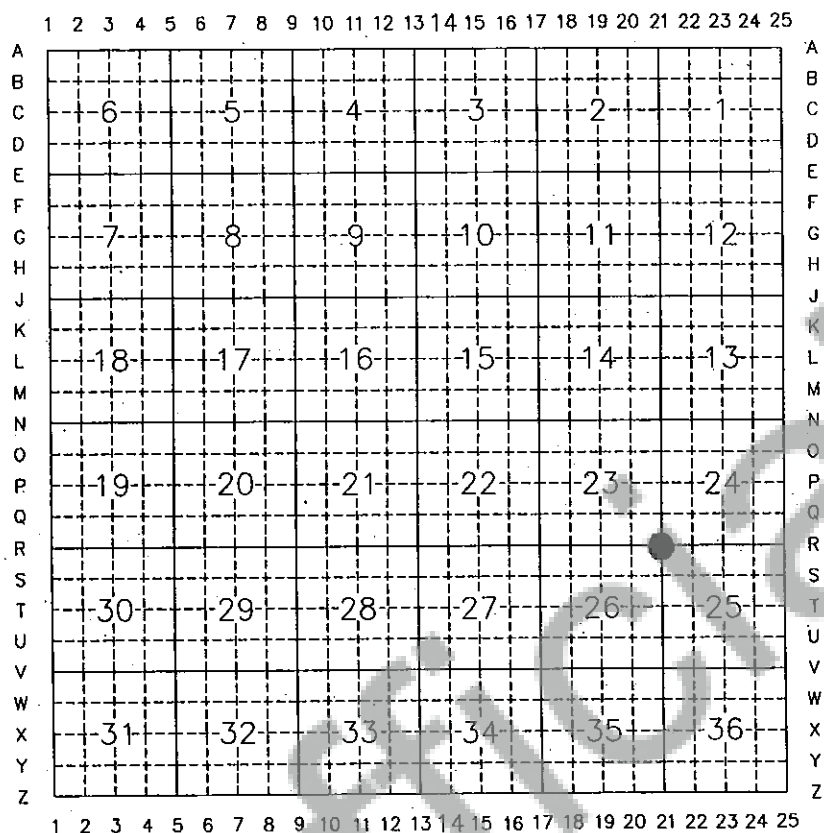

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT:

