Nov 08, 2016 AFN #2016002349 Recorded 08:15 AM DocType: LCR Filed by: AKS ENGINEERING & FORESTRY LLC Page: 1 of 2 File Fee: \$74.00 Auditor Robert J.

Waymire Skamania County, WA

LAND CORNER RECORD

GRANTOR/SURVEYOR/PUBLIC OFFICER: This corner record correctly represents work performed by me or under my direction in conformance with the Survey Recording Act.

COMPANY OR AGENCY: AKS Engineering & Forestry, LLC

ADDRESS: 9600 NE 126th Avenue, Suite 2520 Vancouver, WA 98682



11/3/2016 SEAL/SIGNATURE/DATE

LEGAL:

GRANTEE: PUBLIC

TWP: 2N RGE:

7E

CORNER CODE:

ADDITIONAL IDENTIFIER: (BLM designation, street or plat names, block, lot, etc.)

Closing corner Section 9 and 10

COUNTY:

WASHINGTON PLANE COORDINATES: N:

ORDER:

ZONE:

DATUM (Date of adjustment):

CORNER INFORMATION: Discuss the history, evidence found, and perpetuation of the corner. Diagram the references; provide the date of work; and, if applicable, a reference to a map of record and/or the field book/page no. Use the back, if needed.

Corner originally established by Gesner in 1901. Gesner notes setting a fir post with the following references;

13" Fir North 63.5° East 17 links (11.22)

13" Fir North 31° West 34 links (22.44)

In 1973 Olson Survey Book 1, Page 19, found the original BT's and set an iron pipe at the closing corner with the following references;

22" Fir North 22.40

12" Fir North 70° East 5.60

16" Fir South 20° West 12.10

Subsequent to the 1973 Survey the Pacific Crest Trail was relocated and removed the iron pipe.

Survey by the Longview Timber Corporation conducted by Jason Simes, PLS, in May 2011, recorded in Skamania County AF 2011178518, replaces with Iron pipe with a brass cap with the following references;

20" Fir North 83° East 5.49

24" Fir South 20° West 13.40

IN October of 2016, a field crew from AKS Engineering & Forestry, while posting and flagging the same line of Section 10 (running East to North quarter corner of Section 15), was unable to locate the iron pipe with brass cap as set in Survey AF 2011178518. Since the location of this corner falls so close to the Pacific Crest Trail, it has most likely been removed by a hiker.

Our firm used the previous reference points to replace with a ½" iron pipe with brass cap with the following references;

24" Fir North 5° West 22.35

20" Fir North 83° East 5.49

26" Fir South 23° West 13.68

Center of Pacific Coast Trail bears Southeasterly 5 feet.


i ne distance measured to the Northern Quarter of Section 15 was 0.51 foot short of the record distance reported in Survey Book 1, page 19.

This form is in compliance with the intent of RCW 65.04.045 and prescribed by the Public Land Survey Office, Department of Natural Resources - 1/97.

MARK THE CORNER LOCATION BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE: For corners at the intersection of two lines, the corner code is the alphanumeric coordinate that corresponds to the appropriate intersection of lines.

For corners that are only on one line, the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "B" and "C" is designated BC-5.

For corners that are between lines, the corner code is both line segments; i.e., a corner in the SE1/4 of the SE1/4 of section 18 is designated MN 4-5.

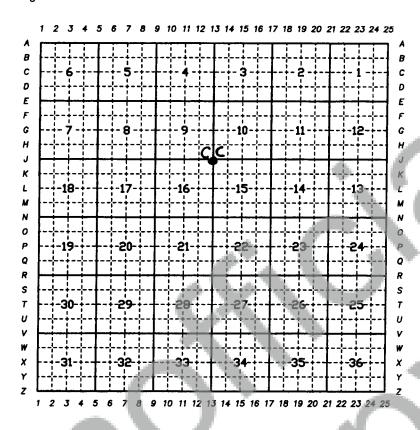

RCW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT:

SET 1/2" IRON PIPE

WITH 3" BRASS CAP

T 2N R 7 E

C C

S9 S10

S15

2016