

LAND CORNER RECORD ATTACHMENT

CORNER INFORMATION: DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

History:

(1897) Surveyor C. A. Homan, under contract #415 with the GLO, in October 1897, set a hemlock post 4 feet long, 4 inches square, 20 inches in the ground, marked "T4N S7" on the Northeast, "R5E S18" on Southeast, "S13" on the Southwest, and "R4E S12" on the Northwest, with 2 notches on the North and 4 notches on the South edges. The following references were taken:

- A 30" fir, N83°E, 80 links distance, marked "T4N R5E S7 BT"
- A 55" fir, S30°E, 22 links distance, marked "T4N R5E S18 BT"
- A 40" fir, S24°W, 68 links distance, marked "T4N R4E S13 BT"
- A 50" fir, N28°W, 46 links distance, marked "T4N R4E S12 BT"

(1966) Corner visited by Cadastral Surveyor James E. Jelley, under contract #231 with the GLO, in July 1966. Found cedar post, 3 inches square, 12 inches above ground, with scribe marks visible but illegible on NE, SE, SW, and NW sides. Also found is a 2 inch diameter iron pipe alongside post. Set an iron post, 28 inches long, 2-1/2 inches diameter, 24 inches in the ground, with brass cap marked "T4N S12 S13 R4E T4N R5E S18 1966", corner material was deposited alongside. The following references were found:

- A 24" fir stump, S25°W, 68 links distance, no marks remaining on decayed blaze
 - A 50" sawed fir stump, N25-1/4°W, 46 links distance, "T4N R4E S12" visible on partially healed blaze.
 - A 32" fir snag, N85°E, 80 links distance, no marks remaining on decayed blaze
 - A 55" sawed fir stump, S37°E, 22 links distance, "T4N R5E S18" visible on partially healed blaze
 - A 24" sawed fir stump, S54°W, 73 links distance, no marks remaining
- From set iron post and brass cap, the following references were taken:
- A 13" fir, S18°W, 172 links distance, marked "T4N R4E S13 BT"
 - A 9" fir, N26-1/2°W, 186 links distance, marked "T4N R4E S12 BT"

(1983) Archie B. Carpenter visited corner in 1983 for Weyerhaeuser Company, as recorded with Clark County as Book 16 Page 117. Found the 1966 BLM brass cap monument and noted the 1987, 1934 and 1966 bearing trees in existence.

(2018) PLS Phillip R. Gustin visited corner in February 2018, recorded as Book 67 Page 146 with Clark County. Found 2-1/2 inch galvanized iron pipe with 3 inch stamped brass cap as set in 1966. Also found the following references:

- A 34" fir, S18°W, 113.5' distance, with healed face and tag
 - A 30" fir, N86°E, 14.7' distance, with healed face and tag
 - A 2" iron pipe, West, 0.2' distance, 1 foot high
 - A 26" fir, N26°30'W, 122.8' distance, with healed face and tag
- Set a T-Post, South, 2.0' distance with tag

Evidence:

(2025) R. Ellis of USDA Forest Service, Columbia Land Zone, on 3/6/2025, recovered corner monument. Found 3-1/4 inch brass cap on 2-1/2 inch iron pipe as set in 1966. The following references were found:

- A 22" douglas fir, N86°E, 14.7' distance, with healed blaze
- A 29" douglas fir, N26-1/2°W, 122.76' distance, with healed blaze
- A 33" douglas fir, S18°W, 113.5' distance, with healed blaze at base and breast height
- A 2" iron pipe, West, 2" distance, 1' high
- T-Iron, South, 4' distance

Perpetuation:

- Painted 6" red bands around all existing bearing trees.
- Painted all healed blazes red.
- Tied pink flagging around monument.

LAND CORNER RECORD ATTACHMENT

CORNER INFORMATION: DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

29" Douglas Fir



N26°W

122.76




N86°E 14.70

22" Douglas Fir



S18°W 113.50

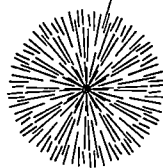

33" Douglas Fir