

94737

LAND CORNER RECORD

T. 7 N, R. 6E, W.M. Skamania County Corner Code No. E-17
Segregated Surveys:
Name: Section Corner Corner No.:
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:


This corner was originally set by Deputy Lewis D.M. Shelton in July 1899, Oct.-Dec. 1900 under Contract No. 552. Remonumented by Floyd A. Brooks, Cadastral Surveyor in Oct. & Nov. 1961.
Set concrete post with Brass cap.
Scribed 10" Wh. Fir N35 1/2 E-25 lks..
Scribed 6" Hemlock N46 E-146 lks..
12" Wh. Fir S17 1/2 E-25 lks..
10" Wh. Fir S78 1/2 E-38 lks..
10" Wh. Fir S5 1/2 W-12 lks..
3" Yew S9 W-69 1/2 lks..
6" Wh. Fir N53 1/2 W-16 lks..
19" Cedar N35 W-245 lks..

2. Description of Evidence Found:

Orig. 10" now 24" sawed rotted Wh. Fir stump N35 1/2 E-25 lks.-healed blaze.
Brooks 6" now 14" Hemlock N46 E-146 lks. scribing visible on partially healed blaze.
Brooks 10" now 11" sawed Wh. Fir stump S78 1/2 E-38 lks.-scribing visible on partially healed blaze.
Brooks 3" now down 4" Yew stood S9 W-69 1/2 lks. scribing visible.
Brooks 19" now 19" Cedar N35 W-245 lks. scribing visible on partially healed blaze.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 6 Page No. 4 Date of work July 1982

Set guard posts East-West & South with sign 54-4 and BM 102 decal.
Nailed 54-4 and BE signs to BE's and painted band and blazes red.
New Bearing Trees:
7" D-Fir S29 W, 40.4 ft. scribed T1166S10 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 16337.
9" Hemlock S63 E, 27.2 ft. scribed T1166S11 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 16337.

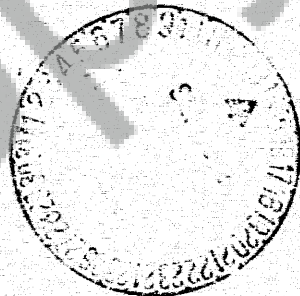

Washington Plane Coordinates: Zone, Y, X
Order Accuracy. Derived From:
Pin Pointed on Photo No. Date Located at

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date July 1982
Signature Larry D. Bishop Certificate No. 16337



AUDITOR'S CERTIFICATE

Filed for record this 14 day of Sept. 1982 at 1:30 P. M. In Book 7/6 of Monuments at page 25 at the request of Larry D. Bishop
Gary M. Olson County Auditor