

94741

LAND CORNER RECORD

T 7 N, R 6E, W.M. Skamania County Corner Code No. A-17
Segregated Surveys:
Name: Section Corner Corner No.:
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:

This corner was originally set by Deputy Lewis D.J. Shelton in July 1999, & Oct.-Dec. 1900 under Contract No. 552. Set Cedar post. Scribed 20" Fir N733/4E-10 lks.. 1" Fir S333/4E-12 lks.. 12" Fir S223/4W-20 lks.. 12" Fir N22W-10 lks..
Remonumented by Floyd A. Brooks, Cadastral Surveyor in Oct. & Nov. 1961. Set Iron post with Brass cap. Scribed 5" Hemlock N26W-38 1/2 l s..


2. Description of Evidence Found:

Nil. Iron post with Brass cap. Orig. 20" now 53" sawed Fir stump N 33/4E-10 lks.-healed blaze. Orig. 1" now 26" sawed Fir stump S333/4E-12 lks.-healed blaze. Orig. 12" now 20" sawed Fir stump S223/4W-20 lks. healed blaze. Orig. 12" now 26" broken Fir snag N26W-10 lks.-nearly healed blaze. Brooks 5" now 5" Hemlock N26W-37 1/4 lks. healed blaze.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 6 Page No. 2 Date of work July 1982

New Bearing Trees:


6" Fir N13E, 10.1 ft. scribed TNR61355 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 1637. 15" Hemlock S55E, 11.5 ft. scribed TNR61352 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 1633. 6" Hemlock S40E, 14.1 ft. scribed TNR61353 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 1633. Set guard post Northeast with sign 54-4 only. Nailed 54-4 and BT signs to all BT's and painted band and blazes red.

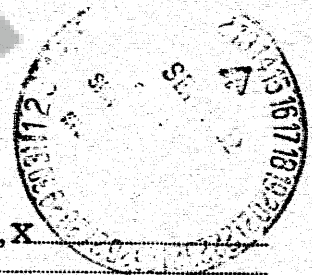

Washington Plane Coordinates: Zone, Y, X
Order Accuracy. Derived From:
Pin Pointed on Photo No. Date Located at

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date July 30, 1982
Signature Larry D. Bishop Certificate No. 16337

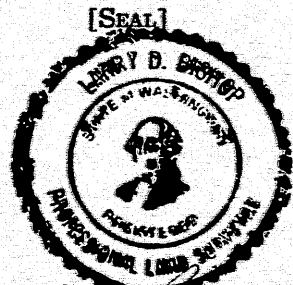

AUDITOR'S CERTIFICATE

Filed for record this 14 day of Sept 1982 at 1:30 P.M. In Book 76 of Monument at page 29 at the request of Larry D. Bishop County Auditor