

LEGEND

- SECTION CORNER FOUND AS NOTED
- 1/4 CORNER CALCULATED POSITION
- FOUND MONUMENT AS NOTED
- SET 5/8" X 30" REBAR WITH YELLOW PLASTIC CAP "FORD 22330"
- CALCULATED POSITION
- () RECORD BEARING AND/OR DISTANCE
- ROS RECORD OF SURVEY
- AFN AUDITOR'S FILE NUMBER
- LINE MARKED WITH 60" FIBER GLASS RODS RED AND WHITE RIBBON ON LINE BETWEEN RODS TREES ALONG LINE PAINTED WITH BLUE PAINT

NOTE: NEW REFERENCES HAVE A LOCATION TAG AND AN 8 INCH SPIKE ALL ORIENTED TOWARD CORNER DISTANCES MEASURED TO SPIKE, BEARING TAKEN WITH HAND COMPASS HAVING A DECLINATION OF 21° EAST

LONGVIEW TIMBERLANDS, LLC
LONGVIEW FIBRE COMPANY
AFN: 51193

PROPERTY CORNER

SET 5/8" REBAR WITH YELLOW PLASTIC CAP "FORD 22330"
NEW REFERENCES:
8" FIR S70°W AT 21.90'
STEEL FENCE POST S15°E AT 1.0'
FOUND 1" PIPE S 47°11'32" E - 9.6' FROM SET REBAR

CARLSON
AFN: 82835
SEE SHORT PLAT BOOK 2 PAGE 36

LONGVIEW TIMBERLANDS, LLC
LONGVIEW FIBRE COMPANY
AFN: 51193

THE PURPOSE OF THIS SURVEY WAS TO LOCATE THE EXCEPTION NOTED IN DEED FROM KONZ TO LONGVIEW FIBRE COMPANY DATED AUGUST 1956. THE EXCEPTION WAS SURVEYED BY LONGVIEW FIBRE FOR THE DESCRIPTION. THE NORTHWEST CORNER WAS NOTED AS DISTURBED IN MEMO DATED 11/16/71 IN PROJECT FILE. THE MEMO ALSO NOTES 2 ERRONEOUS PIPES FOUND AT THAT TIME. THE 1956 REFERENCE WAS FOUND AT THAT TIME. THE DEED DOES CALL FOR A PIPE AT THE NORTHWEST CORNER. THE FOUND PIPE DOES NOT AGREE WITH THE RECORD DISTANCE BY 9 FEET. I DO NOT BELIEVE THE FOUND PIPE IS IN THE LOCATION ESTABLISHED IN 1956. THE BEARINGS AND DISTANCES NOTED ON THIS SURVEY AS RECORD ARE FROM THE 1956 CALCULATIONS BASED ON THE ORIGINAL NOTES FROM THE PROJECT FILE. I WAS NOT ABLE TO FIND ANY EVIDENCE OF THE CORNERS TO THE SOUTH DUE TO THE WIDER RIGHT OF WAY ALONG WIND RIVER HIGHWAY. THE CORNERS SET ARE BASED ON THE SKAMANIA COUNTY MONUMENT AND THE FOUND PIPE AT THE NORTHEAST CORNER OF THE EXCEPTION. THIS SURVEY WAS DONE WITH A LEICA TCR 1203 TOTAL STATION.

PROPERTY CORNER

SET 5/8" REBAR WITH YELLOW PLASTIC CAP "FORD 22330"
NEW REFERENCES:
STEEL FENCE POST N15°W AT 1.0'

N 16°53'23" E - 40.70'
N 56°47'12" W - 175.61'
FOUND REMNANTS OF FENCE POST
S 1°08'28" W - 46.95'

SEE DETAIL

FOUND 5/8" REBAR WITH YELLOW PLASTIC CAP "OLSON ENG PLS 17686" SEE ROS BOOK 3 PAGE 397


SECTION CORNER

FOUND 2-1/2" PIPE WITH ALUMINUM CAP
SEE LCR BOOK 4/7 PAGE 34
SEE ROS BOOK 2 PAGE 65
AND ROS BOOK 3 PAGE 397

FOUND 3/4" PIPE WITH SKAMANIA COUNTY BRASS CAP N 56°09'16" E AT 10.92' FROM ALUMINUM CAP
THIS IS THE MONUMENT TIED BY LONGVIEW FIBRE IN 1961 SEE ROS BOOK 2 PAGE 75 AND ROS BOOK 2 PAGE 127 SHORT PLAT BOOK 3 PAGE 387

RECORD OF SURVEY
FOR
LONGVIEW TIMBER CORPORATION
IN THE SE 1/4 OF THE NE 1/4 AND
IN THE NE 1/4 OF THE SE 1/4 OF
SECTION 15, T 4 N, R 7 E, W.M.
SKAMANIA COUNTY, WASHINGTON

OCTOBER 29, 2008

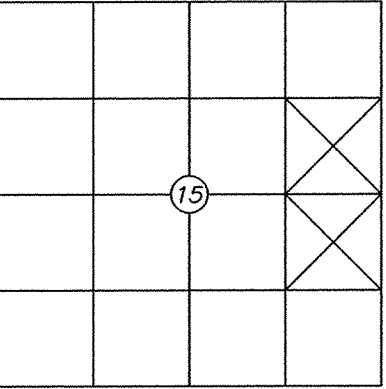

BASIS OF BEARING
RECORD OF SURVEY
BOOK 3 PAGE 397
THE EAST LINE OF SECTION 15

0' 200' 400' 800'

SCALE: 1 INCH = 200 FEET

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS 25th DAY OF November, 2008
AT 11:05 AM IN BOOK AF 2008171545 OF SURVEYS AT PAGE
AT THE REQUEST OF LONGVIEW TIMBER CORPORATION.
J Michael Garvison by
Melin Anderson
2008171545
AUDITOR'S FILE NUMBER COUNTY AUDITOR

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW TIMBER CORPORATION IN SEPTEMBER 2008.

GEORGE J. FORD, PLS
CERTIFICATE NO. 22330

LONGVIEW TIMBER CORPORATION
LONGVIEW, WA 98632

DRAWN BY GEORGE FORD

