


A DEPENDENT SURVEY for Weyerhaeuser Co.  
of the South line of  
SECTION 6, and the South line of the  
SW.1/4 of SECTION 5, TION R5E, W.M.  
as situated within  
SKAMANIA COUNTY, WASHINGTON



**BASIS OF BEARING**  
BETWEEN FOUND  
MONUMENTS ON THE EAST  
LINE OF THE NW.1/4 OF  
SECTION 12, TION R4E AS  
PREVIOUSLY RECORDED.  
SEE SR-1


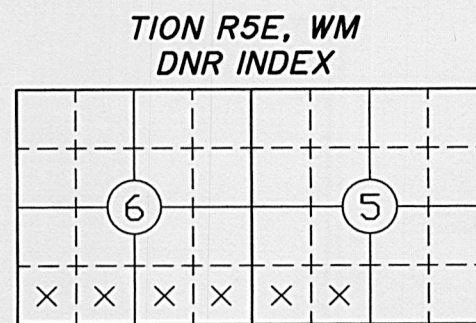


**STD. SEC. COR.**  
Fd. 20"x10"x8" scribed stone  
tied 11/15/22.  
(See LCR 507334)

**FOUND REFERENCES**  
-30" ROTTEN CEDAR STUMP W/PK.  
N36°W-43.0'

**NEW REFERENCES**  
-T-POST W/TAG, SOUTH-3.0'  
-8" FIR SCRIBED [TIONR4E S12BT].  
S47°W-12.8'  
-7" FIR SCRIBED [TIONR4E S1BT].  
N36°W-11.7'

WEYERHAEUSER CO.  
AFN 2022000082

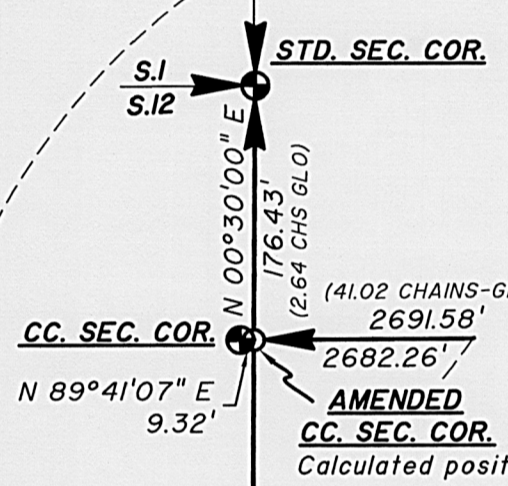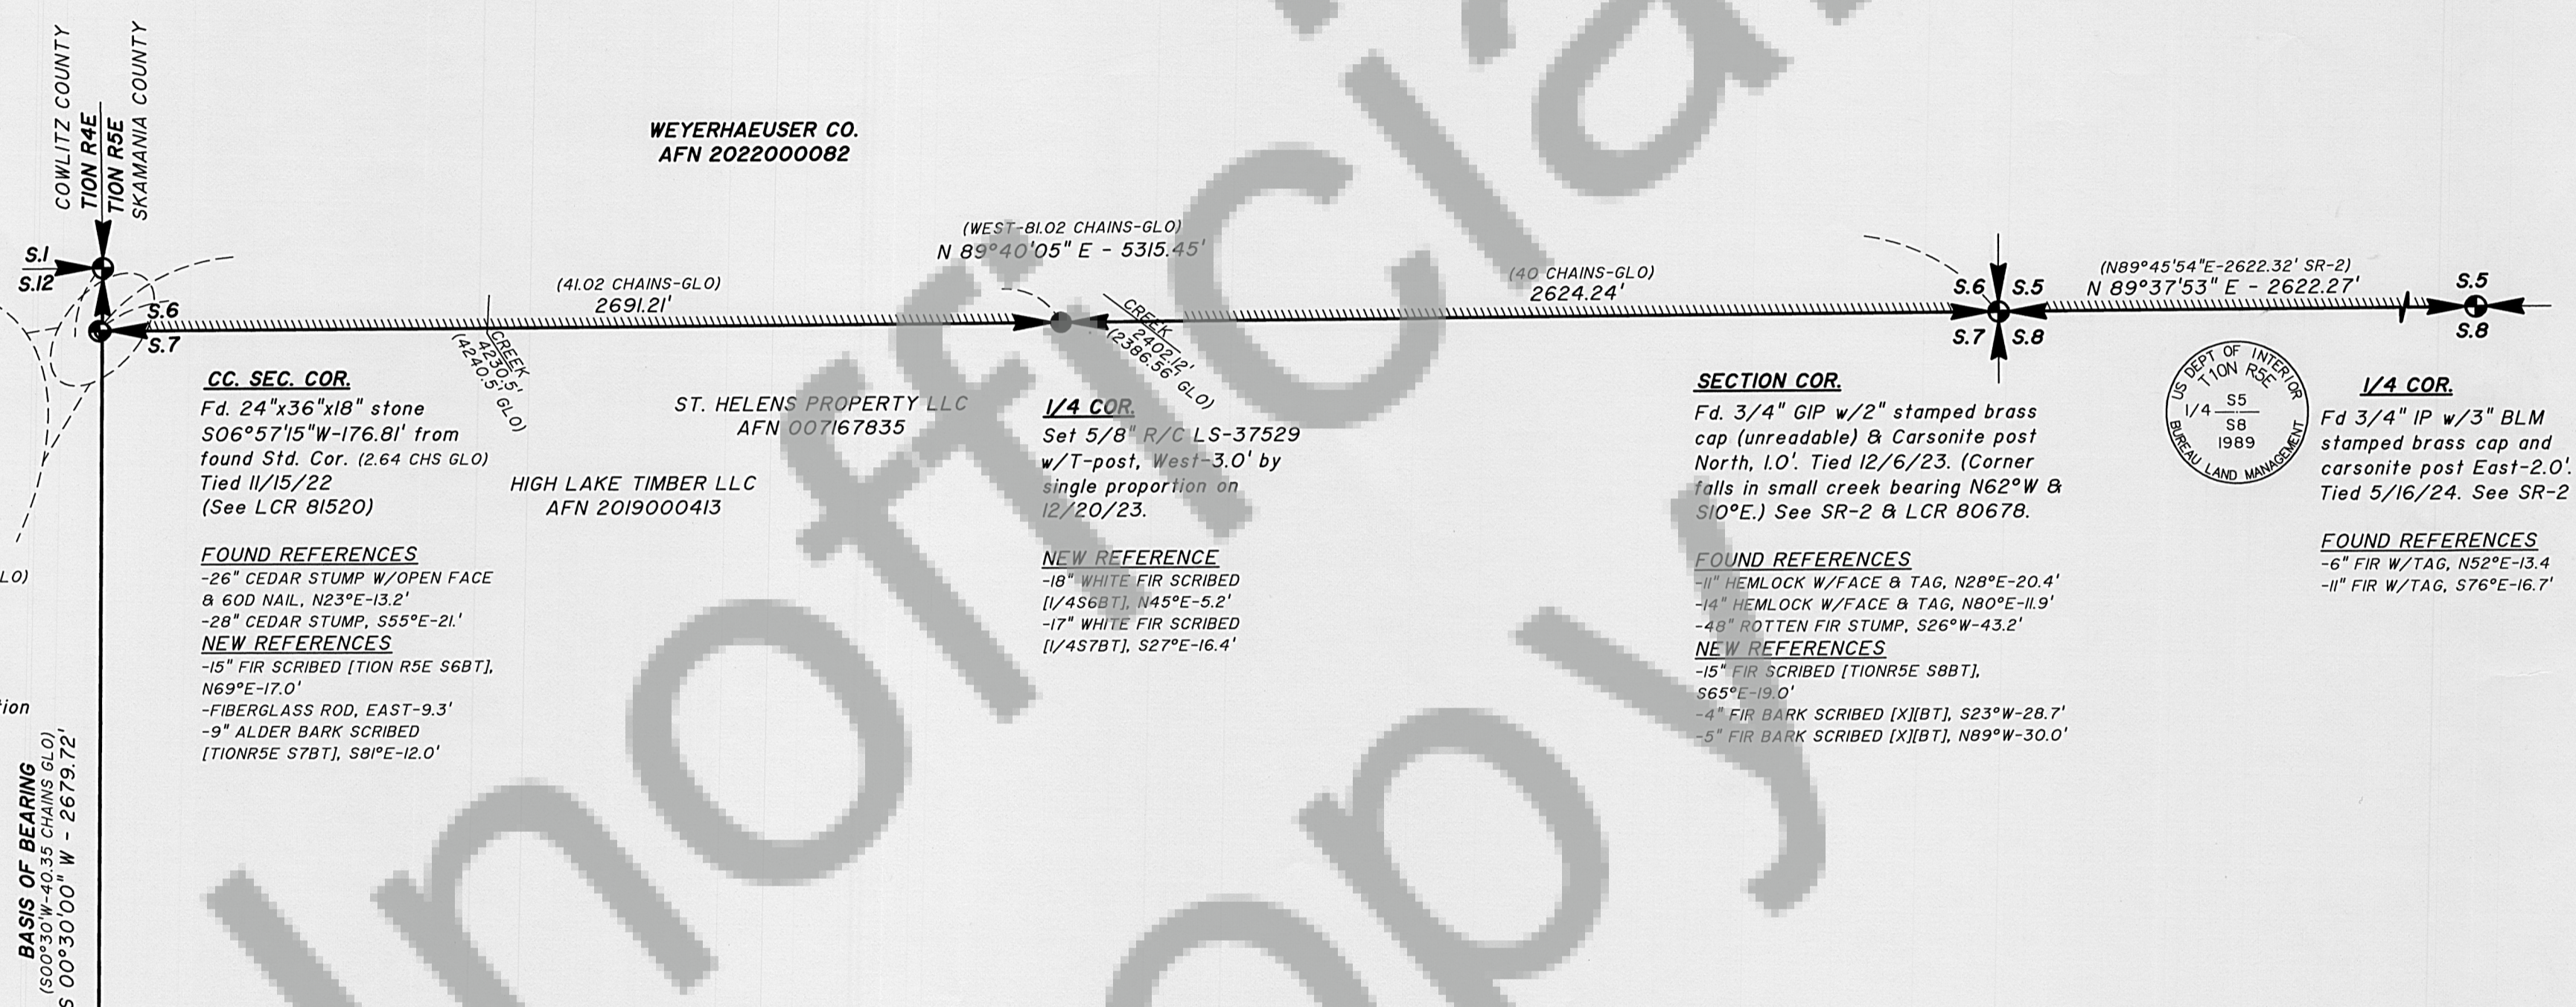

**CC. SEC. COR.**  
Fd. 24"x36"x18" stone  
S06°57'15"W-176.81' from  
found Std. Cor. (2.64 CHS GLO)  
Tied 11/15/22  
(See LCR 81520)

**FOUND REFERENCES**  
-26" CEDAR STUMP W/OPEN FACE  
& 60D NAIL, N23°E-13.2'  
-28" CEDAR STUMP, S55°E-21.1'

**NEW REFERENCES**  
-15" FIR SCRIBED [TION R5E S6BT].  
N69°E-17.0'  
-FIBERGLASS ROD, EAST-9.3'  
-9" ALDER BARK SCRIBED  
[TIONR5E S7BT], S81°E-12.0'

HIGH LAKE TIMBER LLC  
AFN 2019000413

ST. HELENS PROPERTY LLC  
AFN 007167835

**1/4 COR.**  
Set 5/8" R/C LS-37529  
w/T-post, West-3.0' by  
single proportion on  
12/20/23.

**NEW REFERENCE**  
-18" WHITE FIR SCRIBED  
[1/4S6BT], N45°E-5.2'  
-17" WHITE FIR SCRIBED  
[1/4S7BT], S27°E-16.4'

**SECTION COR.**  
Fd. 3/4" GIP w/2" stamped brass  
cap (unreadable) & Carsonite post  
North, 1.0'. Tied 12/6/23. (Corner  
falls in small creek bearing N62°W &  
S10°E.) See SR-2 & LCR 80678.

**FOUND REFERENCES**  
-11" HEMLOCK W/FACE & TAG, N28°E-20.4'  
-14" HEMLOCK W/FACE & TAG, N80°E-11.9'  
-48" ROTTEN FIR STUMP, S26°W-43.2'

**NEW REFERENCES**  
-15" FIR SCRIBED [TIONR5E S8BT].  
S65°E-19.0'  
-4" FIR BARK SCRIBED [X]BT, S23°W-28.7'  
-5" FIR BARK SCRIBED [X]BT, N89°W-30.0'



**1/4 COR.**  
Fd. 3/4" IP w/3" BLM  
stamped brass cap and  
carsonite post East-2.0'.  
Tied 5/16/24. See SR-2


**FOUND REFERENCES**  
-6" FIR W/TAG, N52°E-13.4'  
-11" FIR W/TAG, S76°E-16.7'

**1/4 COR. S.12**  
Fd. 5/8" rebar in 3" dia.  
concrete. Tied 11/16/22. (See  
LCR 507337 & 507338)

**FOUND REFERENCES**  
-16" ROTTEN HEMLOCK STUMP.  
N29°E-36.3'  
-30" HEMLOCK SNAG, S54°W-36.3'

**NEW REFERENCES**  
-9" FIR SCRIBED [1/4S12BT], N81°W-3.5'  
-4" FIR BARK SCRIBED [X]BT,  
N18°W-11.6'

**BASIS OF BEARING**  
(S00°30'00" W - 40.35 CHAINS GLO)  
S 00°30'00" W - 2679.72'

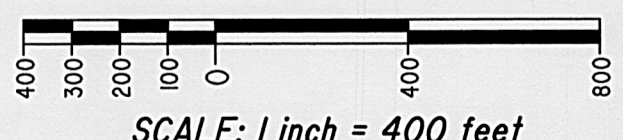


**LEGEND**

- = A corner FOUND during this survey as described.
- = A new corner SET during this survey, on 12/20/2023, consisting of a 5/8"x30" rebar with yellow plastic survey cap, stamped "HAMPSTUR CORP. LS 37529"
- ( ) = A Bearing and/or Distance of record
- R/C = A rebar with stamped plastic surveyor's cap
- T-POST = A 6" steel fence post w/location tag
- AFN = Auditor's File Number
- ===== = A line marked this survey with 1/2"x6" white fiberglass posts, painted blazes & flagging

**SURVEYOR'S CERTIFICATE**

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act, at the request of WEYERHAEUSER CO., in SEPTEMBER, 2023.

*Phillip R. Gustin*  
Phillip R. Gustin PLS  
Certificate no. 37529

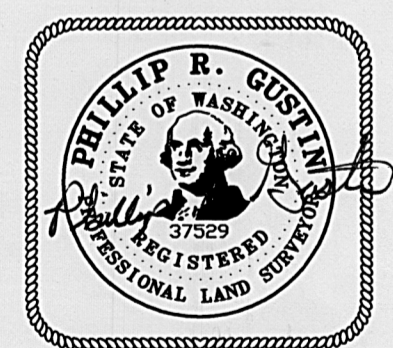

Date signed: 6/12/24

**SURVEY REFERENCES (SR)**

- 1) 2023 SURVEY BY P. GUSTIN, LS-37529, BK.44 PG.3
- 2) 2024 SURVEY BY C. BUTLER, LS-36792, AFN 2024-000019

\*This survey was conducted using a "LEICA GPS 1200 & TS06+ TOTAL STATION (least read 05"), obtaining a relative accuracy exceeding 1:10,000.

**AUDITOR'S CERTIFICATE**

Filed for record this 18th day of June, 2024  
at 8:20 A.M., in BOOK of SURVEYS, at  
PAGE, at the request of HAMPSTUR CORPORATION.  
AFN# 2024-000745  
COUNTY AUDITOR

*KATDM*  
DEPUTY AUDITOR

**HAMPSTUR CORPORATION**

Calculated by : PRG/TLG  
Checked by : PRG  
Drawn by : TLG  
Completion date : 5/16/2024  
Field Book no. : PS-938,  
Drawing No. : 23-664.DWG  
HAMPSTUR JOB no. : 23-664  
Sheet no. 1 of 1

P.O. Box 368  
Kelso, Washington 98626  
Phone: (360) 423-8166