

OLSON ENGINEERING

1111 BROADWAY, VANCOUVER, WASH.
PH: (206) - 695-1385
1 KANAKA CR. RD., STEVENSON, WASH.
PH: (509) - 427-8411

LAND CORNER RECORD

96322

Skamania

County

T 3 N, R 8E, W.M.

Corner Code No. P-21.

Segregated Surveys:

Name: 1/4 corner common to Section 23 & 24

Corner No.

DLC, HES MINING CLAIM, INDIAN ALLOTMENT, FEDERAL RESERVE, TOWNSITE

1. History of Corner Establishment and Subsequent Restoration; description of Evidence Found:

On August 16, 1938, EPA's survey crew tied a 2" IP for this corner. Their notes read as follows: "2" IP in rock mound which is 1/4 corner of Sec. 23 & 24, T3N-R8E, WM. Forest boundary sign on adjacent tree." The EPA plat reads, "30" fir scribed 1/4." There are no trees at recorded GLO from the iron pipe now. There has been a landslide to the North and West of the pipe, that has covered up a lot of stumps.


In 1911, G. E. Linn, county surveyor, ran from the Southeast corner of Section 23, to the East quarter corner, but didn't note what he found. In Feb. 1910, he ran from the East quarter corner of Section 23, to the West quarter corner of Section 23. Again he does not note what he found. His total distance for the mile is 56 feet shorter than our measurement from the West quarter corner to the IP. The creek call to the South fits the GLO distance. A proportioned position would place this corner about 150 feet to the West. The 2" pipe is within 60 feet of where the corner has been for 70 years. (using the distance across the Section and the creek call to the South as evidence.) Under the circumstances, we feel this IP is the best evidence of the original corner. One of the bearing trees was of the size that EPA notes on their plat. Perhaps they had other field notes, not on file, that noted finding a scribed bearing tree.

The 2" pipe at the East quarter corner of Section 23 is similar to the one at the Southeast corner of Section 23, that has a scribed bearing tree.

2. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner:

Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. Page No. Date of work

See recorded survey.

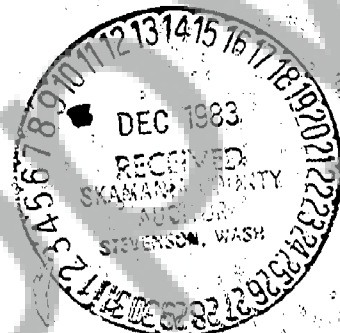

Washington Plane Coordinates: Zone, Y, X
Order Accuracy. Derived From

Pin Pointed on Photo No. Date Located at

96322

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction, in compliance with the provisions of Chapter 50, Laws of 1973. Date 21 Feb 80

Signature

Certificate No. 11989

AUDITOR'S CERTIFICATE

Filed for record this 9th day of Dec 1983 at 11:50 A.M. of 3/8 of Monuments at Page 72 at the request of Olson Engineering



County Auditor
Rep