

State of Washington
DEPARTMENT OF NATURAL RESOURCES
BUREAU OF SURVEYS AND MAPS
LAND CORNER RECORD

Skamania County

T 3 N, R 6 E, W.M.

Corner Code No. A-19

Segregated Surveys:

Name: N/A

Corner Number: N/A

1. History of Corner Establishment and Subsequent Restoration: Originally set by G.L.O. Surveyor, Robert F. Whitham, during 1903 survey.

2. Description of Evidence Found:

2 B.T.'s

1 22" fir stub at N 14°W - 46.86 feet.

1 hemlock root wad at S46°E - 24.42 feet.

Position fits creek calls to east and west.



3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 600.23, Page No. 56. Date of work 11-16-82.

Shown on D.N.R. F.M. #489

See corner diagram on reverse side.

Set std. D.N.R. concrete monument with stamped brass cap from 2 found B.T.'s.

Washington Plane Coordinates: South Zone, Y 166,196.49, X 1,608,792.55
Third Order Accuracy. Derived from ties to "Swanberg Photo Control" Tgt's 100 & 101.
Pin Pointed on Photo No. _____, Date _____, Located at _____

SURVEYOR'S CERTIFICATE

[Seal]

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973.
Date 2-6-84.

Signature

21490

Certificate No.



AUDITOR'S CERTIFICATE

Filed for record this 9TH day of FEBRUARY 19 84 at 1:15 P.M.
In Book 3/6 of MONUMENTS at page 24 at the request
of Washington State Department of Natural Resources.

H. M. Olson
County Auditor

G40 of 1903
 West between 2 & 35
 38.00 brook 3 L. flows South
 40.00 set post
 dead 24" hemlock S 48° 30' E 37 L. ^{24 42'}
 dead 24" Fir N 18 W 71 L 46.80'
 42.00 creek 15 L. flows South

West between 24 35

38.00 brook, 3 L. flows South

40.00	set post
-------	----------

dead 24" hemlock 5480 30'E 37L 2442'

Dead H. Fir N18W 71L 4686

2:00 Creek / 5 L. flows South

1/4 CORNER
58 7 40 7 32 R 6 5
-2


Found BT pattern as shown on sketch. Position fits creek calls to the east & west - see creek hrs on pages 21 & 22

Approx. 300' east of this position are 2 trees that had been blasted. Cutting out the blazes, it was determined by ring count that the blazes were made in the early 1950's.

COADON
Dressier

$$\begin{array}{r} 56 \\ 600.23 \end{array}$$

28-91-11

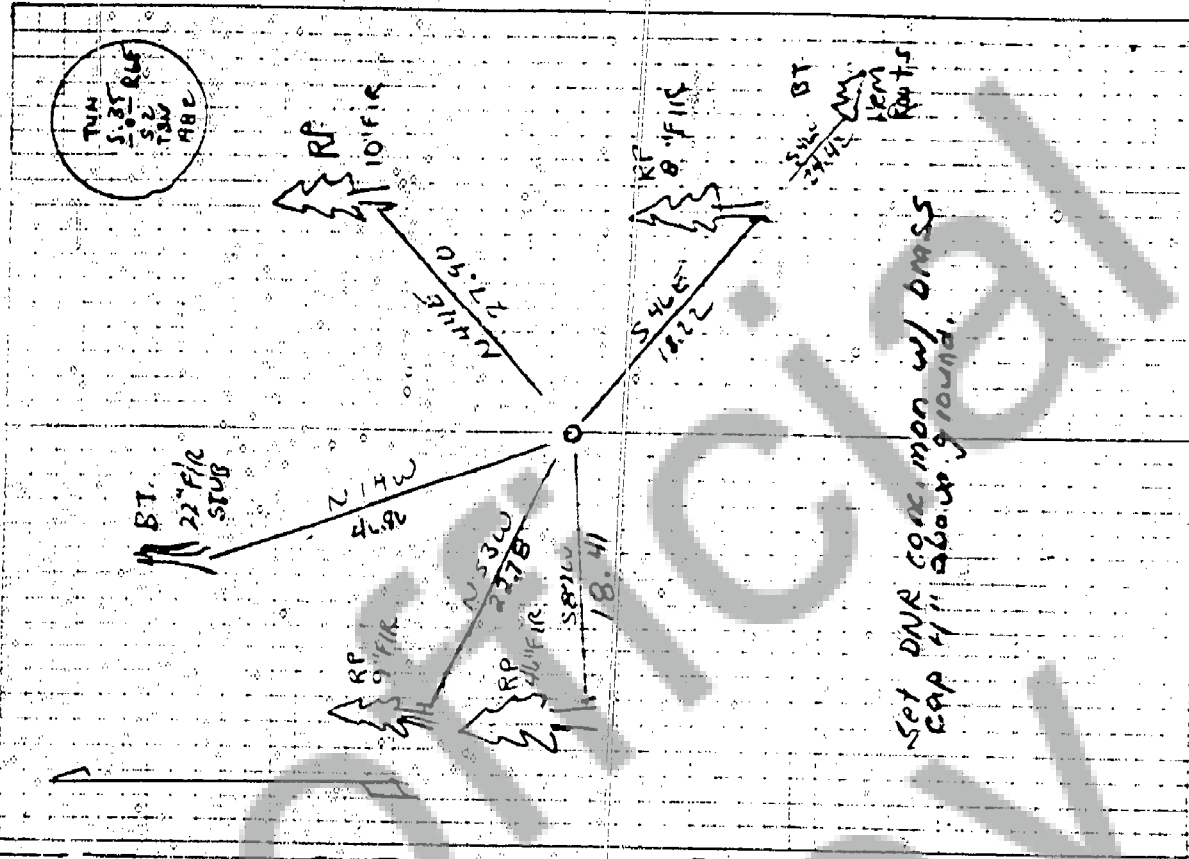

Set DNR core, mon w/ brass cap 4" above ground.