

102265

BOOK 5/5 PAGE 9

State of Washington
DEPARTMENT OF NATURAL RESOURCES
BUREAU OF SURVEYS AND MAPS
LAND CORNER RECORD

$$\frac{1}{4}$$
$$\frac{32}{5}$$

Skamania County

T 5 N., R 5 E., W.M.

Corner Code No. A-7

Segregated Surveys:

Name: n/a

Corner Number: n/a

1. History of Corner Establishment and Subsequent Restoration:

Originally established in 1909 by GLO Surveyor C. Frank Rhodes with a marked stone and 2 dead BTs.

Recovered in 1966 by James E. Jelley, BLM. He set a pipe with BLM cap and scribed 2 new BTs.

FILED FOR RECORD
SKAMANA CO. WASH
BY

Dec 1 1 10 PM '86

AUDITOR
GARY M. OLSON

2. Description of Evidence Found:

Original ctone marked 1/4 (closed four).

BLM pipe with stamped brass cap.

40" cedar windfall BT at S28W 43 feet.

27" fir at N27W 18.91 feet (1966 BT).

20" fir at S37E 15.09 feet (1966 BT).

The last two BT's were felled to allow for a photo target. They are now stumps.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 601.07, Page No. 45. Date of work June 17, 1986.

Corner is BLM pipe and cap.

See reverse side for corner diagram.

SURVEYOR'S CERTIFICATE

[Seal]

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973.
Date: November 18, 1986.

Signature H. P. ... Certificate No. 21490



AUDITOR'S CERTIFICATE

Filed for record this _____ day of _____ 19____ at _____ M.
In Book _____ of _____ at page _____ at the request
of Washington State Department of Natural Resources.

Registered

County Auditor

GLO Survey of 1909
 40.00 S - corner stone 20x14x10 marked
 1/4 on north face
 22" dead hemlock N20E 36L 23.8
 40" dead cedar S52W 65L 42.9

Corner recovered by James Valley, BLM,
 in 1966. He noted the bearing to the
 cedar was 30° off. He scribed 2

new BTS:
 22" fir N26W 29L 19.1
 12" fir S37E 23.5L 15.5

1/4 corner $\frac{32}{5}$ T S56W R SE
 Found original stone 20x14x10 marked
 1/4. BLM monument with stamped
 brass cap.


Found:
 40" cedar windfall @ S28W, 43'
 27" fir stump (cut) @ N27W 19.91'
 20" fir stump (cut) @ S37E 15.09

original stone is set on the north
 side of the BLM pipe/cap

Henlin
 Brassler 501.07

6-17-86

T6N
 532
 55
 T5N R5E
 1966

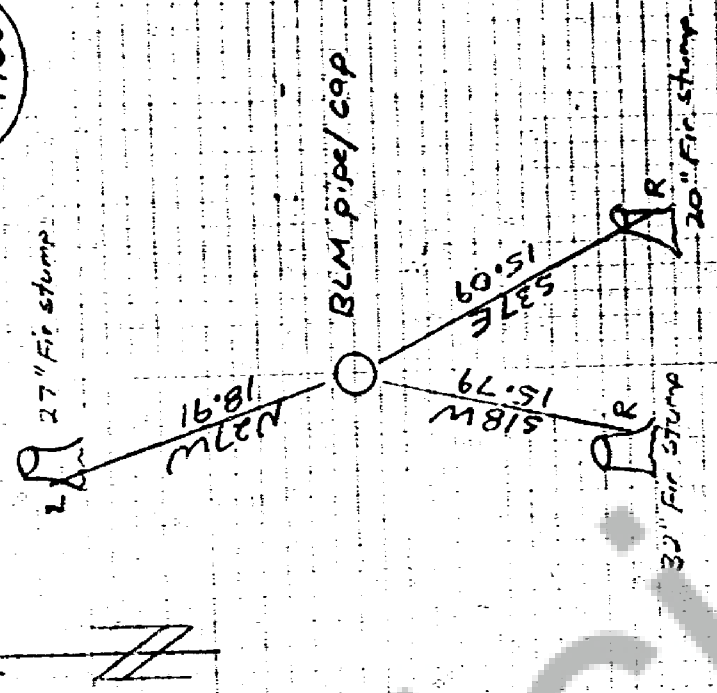

102265

State of Washington
DEPARTMENT OF NATURAL RESOURCES
BUREAU OF SURVEYS AND MAPS
LAND CORNER RECORD

$$\frac{1/4}{32} = \frac{1}{5}$$

Skamania County

T 5 N, R 5 E, W.M.

Corner Code No. A-7

Segregated Surveys:

Name: n/a

Corner Number: n/a

1. History of Corner Establishment and Subsequent Restoration:

Originally established in 1909 by GLO Surveyor C. Frank Rhodes with a marked stone and 2 dead BTs.

Recovered in 1966 by James E. Jelley, BLM. He set a pipe with BLM cap and scribed 2 new BTs.

FILED FOR RECORD
SKAMANIA CO. WASH
BY TOM LAIRD

2. Description of Evidence Found:

Original stone marked 1/4 (closed four).

BLM pipe with stamped brass cap.

40" cedar windfall BT at S28W 43 feet.

27" fir at N27W 18.91 feet (1966 BT).

20" fir at S37E 15.09 feet (1966 BT).

The last two BT's were felled to allow for a photo target. They are now stumps.

Dec 1 1 10 PM '86
d. New, Dip

AUDITOR
GARY M. OLSON

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 601.07, Page No. 45. Date of work June 17, 1986.

Corner is BLM pipe and cap.

See reverse side for corner diagram.

SURVEYOR'S CERTIFICATE

[Seal]

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973.
Date: November 18, 1986.

H. Thomas Laird Jr.
Signature

21490
Certificate No.



AUDITOR'S CERTIFICATE

Filed for record this _____ day of _____ 19____ at _____ M.
In Book _____ of _____ at page _____ at the request
of Washington State Department of Natural Resources.

County Auditor

Registered 51
11
5
1
1