

INSET - NO SCALE

SEE SHEET 2 OF 2 FOR CORNER NOTES.

INSET - NO SCALE

AUDITOR'S CERTIFICATE

Filed for record this 26th day of JANUARY, 19 89  
at 3:03 P.M. in Book 3 of Surveys at page  
3 at the request of the Washington State Department  
of Natural Resources.  
Auditor's File Number 106487  
A. Thomas, Jr.,  
Shannon County Auditor

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my  
direction in conformance with the requirements of the Survey Re-  
cording Act at the request of the Department of Natural Resources  
in November 3, 1988.  
H. Thomas Laird Jr., P.L.S.  
H. Thomas Laird Jr., P.L.S.  
Certificate Number 21490



A SURVEY IN  
SECTION 19 TOWNSHIP 3 NORTH, RANGE 7 EAST, W.M.


SURVEYED BY: H. THOMAS LAIRD JR., P.L.S.  
DRAWN BY: B. ERIK NEDERLAND  
STATE OF WASHINGTON  
DEPARTMENT OF NATURAL RESOURCES  
CHECKED BY: H. THOMAS LAIRD JR., P.L.S.  
DATE: OCTOBER 1988

SCALE: 1" = 750'  
BASIS OF MERIDIAN:  
WASHINGTON COORDINATE SYSTEM, 1927  
N.A.D. SOUTH ZONE DATUM DERIVED FROM  
TIES TO THE FOLLOWING CONTROL  
STATIONS:  
U.S.F.S. G.P.S. "3N-7E-4"  
U.S.C. & G.S. "SEDMO POINT"  
"GREENLEAF"  
D.N.R.  
#2-3N-6E  
#9-3N-7E  
#10-3N-7E  
GRID FACTOR: 0.9999094  
TRUE NORTH: -1° 05' 01" AT C 1/4  
SECTION 19.  
DESCRIPTION OF STATE OWNERSHIP  
SW 1/4 NW 1/4;  
SW 1/4 EXCEPT SW 1/4 SW 1/4;  
ALL IN SEC. 19, T.3 N., R.7 E., W.M.

6. L.O. CORNER SYMBOLS  
FOUND OR ACCEPTED  
CALCULATED - SET  
CALCULATED - NOT SET

LEGEND  
Set - Indicates standard D.N.R. monument unless  
otherwise noted.  
STANDARD D.N.R. MONUMENTS ARE:  
2" O.D. aluminum alloy pipe with "break-  
way" plastic base.  
3" diameter aluminum alloy cap stamped  
with proper corner identification, permanent,  
vertically oriented magnets are included in  
the monument base and cap.  
STANDARD D.N.R. CAPS ARE:  
3" diameter aluminum alloy disks with a  
vertically oriented magnet and stamped with  
proper corner identification set as noted.  
D.N.R. concrete monuments are 3" diameter with  
brass cap stamped with proper corner identification.  
D.N.R. iron pipes are 1" diameter with brass cap  
stamped with proper corner identification.

FILED FOR RECORD  
BY DAVID  
JUL 26, 2003 PM 03  
CLERK OF COURTS  
CLERK

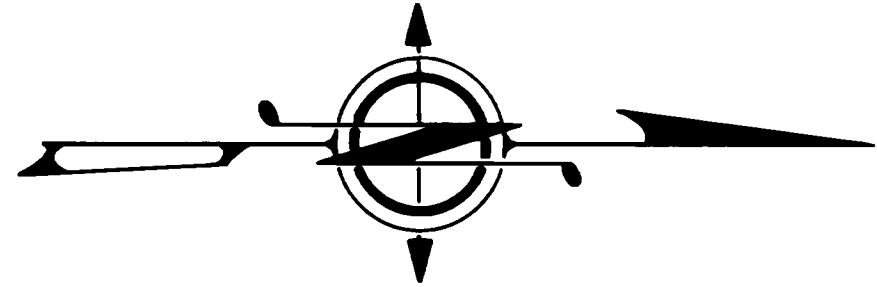

- (A) E 1/4 CORNER SECTION 13.  
FD. MOUND OF STONES WAS FOUND WITH CHARCOAL AND WOOD REMAINS TO THE DEPTH OF 18" BELOW GROUND SURFACE. HELD FOR ORIGINAL 6 L.O. CORNER POSITION.  
23 CEDAR BEARING TREE STUMP WITH A HEMLOCK AT N. 17 W. 44.80 FT. 10 THE CEDAR STUMP.  
26. TOP OF AN EAST-WEST RIDGE IS 97 FEET SOUTH OF CORNER POSITION.  
G.L.O. CALLED THIS RIDGE AT 99 FEET SOUTH.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 2" ABOVE GROUND AT FOUND LOCATION OF ORIGINAL CORNER AS THE EAST 1/4 CORNER OF SECTION 13 ONLY.  
4 RP S.:  
9" FIR AT S. 54 E. 20.08'  
15" FIR AT S. 50 W. 21.92'  
15" FIR AT N. 20 W. 19.48'  
20" FIR AT N. 2 W. 19.48'  
F.B. 600 28A P. 58
- (B) NE CORNER SECTION 18.  
FD. A 1" SKAMANIA COUNTY IRON PIPE WITH STAMPED BRASS CAP DATES SET UNKNOWN. HELD FOR CORNER THIS SURVEY.  
ROTTED REMAINS OF 70" FIR BEARING TREE AT N. 27 E. 27 FEET.  
ROTTED 30" FIR BEARING TREE STUMP AT S. 20 E. 33" BEARING TREE STUMP AT N. 80 W. 19.53 FEET TO SPIKE IN LEFT SIDE OF STUMP. THIS BEARING TREE WAS CALLED IN THE WRONG QUADRANT BY G.L.O.  
3 RP S.:  
20" FIR STUMP AT N. 79 E. 3.92'  
20" FIR STUMP AT S. 60 W. 3.92'  
55" FIR B.T. STUMP AT N. 80 W. 19.53'  
F.B. 600 28 P. 55
- (C) SE CORNER SECTION 13.  
FD. ROTTED LARCH BEARING TREE STUB AT N. 81 W. 41.58 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 13 AND 24 ONLY.  
4 RP S.:  
12" FIR AT N. 10 E. 4.29'  
17" FIR AT N. 54 E. 8.02'  
12" HEMLOCK AT S. 38 E. 6.89'  
9" HEMLOCK AT S. 22 W. 3.02'  
F.B. 600 28A P. 57
- (D) NW CORNER SECTION 19.  
FD. 30" ROOT COLLAR OF LARCH BEARING TREE AT S. 50 1/2 E. 24.42 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 18 AND 19 ONLY. MONUMENT NOT ON LINE.  
3 RP S.:  
15" FIR AT N. 47 E. 27.80'  
20" FIR AT S. 4 W. 4.80'  
18" FIR AT S. 53 W. 9.84'  
F.B. 600 28A P. 56
- (E) N 1/4 CORNER SECTION 19.  
CALCULATED CORNER.  
NO ORIGINAL CORNER WAS FOUND. THEREFORE THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT CALCULATED SINGLE-PROPORTIONED POSITION AS THE 1/4 CORNER BETWEEN SECTIONS 18 AND 19.  
3 RP S.:  
26" DOUGLAS FIR AT N. 65 E. 6.13'  
21" DOUGLAS FIR AT S. 16 E. 22.79'  
F.B. 600 28B P. 56
- (F) NE CORNER SECTION 19.  
FD. ALUMINUM PIPE WITH STAMPED 3" BRASS CAP SET IN 1878 BY LARRY BISHOP. PLUS #16337 AS NOTED ON LAND CORNER RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS ALP. PAGE 25 UNDER A.F. #85978. FOUND BEARING TREES HELD FOR CORNER THIS SURVEY.  
REMAINING OF 40" HEMLOCK BEARING TREE 6 FEET TALL AT N. 18 E. 71.3 FEET. 18" BEARING TREE SNAG WITH AXE MARKS AND VISIBLE SCRIBE AT S. 24 W. 25.5 FEET.  
HEMLOCK BEARING TREE REMAINS AT N. 73 W. 27.2 FEET.  
3 RP S.:  
16" FIR AT S. 37 E. 41.43'  
11" FIR AT S. 24 W. 18.83'  
F.B. 600 28B P. 24
- (G) N 1/16 COR. W. LINE SEC. 19  
CALCULATED CORNER.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND 20 FEET NORTH OF TOP OF RIDGE AT CALCULATED MID-POINT CORNER POSITION AS THE NORTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.  
4 RP S.:  
11" DOUGLAS FIR AT N. 53 E. 3.45'  
15" DOUGLAS FIR AT S. 74 W. 18.36'  
15" DOUGLAS FIR AT N. 74 W. 19.68'  
F.B. 600 28B P. 34
- (H) NW 1/16 CORNER SECTION 19.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND POSITION AS THE NORTHWEST 1/16 CORNER OF SECTION 19.  
4 RP S.:  
14" FIR AT S. 86 E. 25.61'  
25" FIR AT S. 10 W. 11.94'  
25" FIR AT N. 56 W. 32.07'  
19" HEMLOCK AT N. 12 W. 14.07'  
F.B. 600 28B P. 47
- (I) E 1/4 CORNER SECTION 24.  
FD. 24" LARCH BEARING TREE STUB AT N. 66 E. 12.95'  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AND DISTANCE FROM FOUND LARCH BEARING TREE STUB AS THE EAST 1/4 CORNER OF SECTION 24 ONLY.  
3 RP S.:  
9" FIR AT N. 65 E. 12.95'  
9" FIR AT S. 45 W. 20.126'  
12" FIR AT N. 18 W. 1.26'  
F.B. 600 28A P. 53
- (J) W 1/4 CORNER SECTION 19.  
CALCULATED CORNER.  
NO ORIGINAL CORNER WAS FOUND. THEREFORE THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT CALCULATED 1/4 CORNER AT MID-POINT POSITION. BUT DID NOT SET CORNER.  
CW 1/16 CORNER SECTION 19.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER-WEST 1/16 CORNER OF SECTION 19.  
3 RP S.:  
18" FIR AT S. 70 E. 9.48'  
18" FIR AT S. 72 W. 6.85'  
19" FIR AT N. 27 W. 6.85'  
F.B. 600 28B P. 42
- (K) C 1/4 CORNER SECTION 19.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER 1/4 CORNER OF SECTION 19.  
3 RP S.:  
7" FIR AT N. 87 E. 13.68'  
13" FIR AT S. 2 W. 20.10'  
9" FIR AT N. 88 W. 8.91'  
F.B. 600 28B P. 40
- (L) E 1/4 CORNER SECTION 19.  
FD. A 2" IRON PIPE WITH STAMPED 3" BRASS CAP AS SET IN JULY 1978 BY LARRY BISHOP. PLUS #16337 AS NOTED ON LAND CORNER RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS ALP. PAGE 25 UNDER A.F. #85978 FROM 1 FOUND BEARING TREE. HELD FOR CORNER THIS SURVEY.  
39" CEDAR BEARING TREE WITH BURNED FACE AND AXE MARKS AT S. 51 E. 38 FEET.  
3 RP S.:  
13" FIR AT S. 79 E. 30.98'  
13" SCRIBED BY BISHOP AS A B.T.  
13" FIR AT S. 48 E. 25.33'  
15" ALDER AT N. 28 W. 11.24'  
SCRIBED BY BISHOP AS A B.T.  
F.B. 600 28 P. 56
- (M) S 1/16 COR. W. LINE SEC. 19  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP AT CALCULATED MID-POINT POSITION AS THE SOUTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.  
3 RP S.:  
7" HEMLOCK AT S. 68 E. 13.06'  
21" DOUGLAS FIR AT S. 17 E. 19.56'  
14" DOUGLAS FIR AT S. 75 W. 7.74'  
F.B. 600 28B P. 56
- (N) SW 1/16 CORNER SECTION 19.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH NO VISIBLE SCRIBING AT S. 77 W. 29 FEET.  
THIS SURVEY REPLACED BROKEN MONUMENT WITH A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 6" ABOVE ROCK MOUND SURROUNDING MONUMENT AS THE 4 RP S.:  
11" FIR AT N. 41 E. 9.59'  
5" CEDAR AT S. 67 E. 15.04'  
9" TRUE FIR STUMP AT S. 36 W. 16.29'  
6" FIR AT N. 10 W. 6.98'  
F.B. 600 28 P. 57
- (O) E 1/4 CORNER SECTION 25.  
FD. 40" TRUE FIR BEARING TREE STUMP WITH NO MARKS AT N. 74 E. 23.76 FEET.  
TRUE FIR BEARING TREE STUB WITH NO MARKS AT N. 68 W. 28.40 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE STONE MOUND AT A DISTANCE-DISTANCE INTERSECTION OF FOUND BEARING TREES AS THE WEST 1/4 CORNER OF SECTION 25 ONLY.  
3 RP S.:  
20" TRUE FIR AT S. 42 E. 10.05'  
8" TRUE FIR AT S. 71 W. 13.58'  
6" TRUE FIR AT N. 30 W. 13.84'  
F.B. 600 28 P. 50
- (P) SE CORNER SECTION 24.  
FD. DECAYED REMAINS OF 18" SILVER PINE AT N. 32 E. 16.35 FEET.  
DECAYED REMAINS OF 20" SILVER PINE AT S. 57 30 E. 25.1 FEET.  
DECAYED REMAINS OF 24" SILVER PINE AT S. 9 30 W. 58.1 FEET.  
DECAYED REMAINS OF 24" SILVER PINE AT N. 33 W. 25.1 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT INTERSECTION OF FOUND 6 O. BEARING TREES AS THE STANDARD CORNER TO SECTIONS 24 AND 25 ONLY.  
3 RP S.:  
7" SILVER FIR AT EAST. 13.63'  
10" SILVER FIR AT S. 2 W. 10.49'  
11" FIR AT N. 4 S. 37.78'  
F.B. 600 28A P. 55
- (Q) SW CORNER SECTION 19.  
FD. AT LOCATION OF CORNER A SMALL MOUND OF STONE WAS FOUND WITH CHARCOAL FOR ORIGINAL 6 L.O. CORNER POSITION.  
A MOUND OF ROTTED WOOD AT S. 61 E. 34 FEET.  
A FALLEN AND DECAYED STUB AT N. 86 E. 36 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT FOUND LOCATION OF ORIGINAL 6 L.O. CORNER AS THE CLOSING CORNER TO SECTIONS 19 AND 30 ONLY. MONUMENT NOT ON LINE.  
3 RP S.:  
13" SILVER FIR AT N. 74 E. 13.65'  
13" SILVER FIR AT N. 8 W. 9.24'  
4" HEMLOCK AT N. 8 W. 9.30'  
F.B. 600 28A P. 54
- (R) W 1/16 COR. S. LINE SEC. 19  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED MID-POINT POSITION AS THE WEST 1/16 CORNER BETWEEN SECTIONS 19 AND 30.  
3 RP S.:  
9" TRUE FIR AT N. 58 E. 5.06'  
9" TRUE FIR AT N. 70 W. 9.95'  
9" TRUE FIR AT N. 4 W. 4.50'  
F.B. 600 28B P. 48
- (S) S 1/4 CORNER SECTION 19.  
FD. BROKEN DEPT. OF NATURAL RESOURCES CONCRETE MONUMENT IN A ROCK PILE. EMPLOYEES OF WASHINGTON HARBOUR FOUND BEARING TREES HELD FOR CORNER POSITION.  
20" FIR BEARING TREE STUMP WITH VISIBLE SCRIBING AT N. 77 E. 36 FEET.  
17" FIR BEARING TREE BLOWDOWN WITH NO VISIBLE SCRIBING AT S. 77 W. 29 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH NO VISIBLE SCRIBING AT S. 77 W. 29 FEET.  
THIS SURVEY REPLACED BROKEN MONUMENT WITH A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 6" ABOVE ROCK MOUND SURROUNDING MONUMENT AS THE 4 RP S.:  
11" FIR AT N. 41 E. 9.59'  
5" CEDAR AT S. 67 E. 15.04'  
9" TRUE FIR STUMP AT S. 36 W. 16.29'  
6" FIR AT N. 10 W. 6.98'  
F.B. 600 28 P. 57
- (T) SE CORNER SECTION 24.  
FD. DECAYED REMAINS OF 18" SILVER PINE AT N. 32 E. 16.35 FEET.  
DECAYED REMAINS OF 20" SILVER PINE AT S. 57 30 E. 25.1 FEET.  
DECAYED REMAINS OF 24" SILVER PINE AT S. 9 30 W. 58.1 FEET.  
DECAYED REMAINS OF 24" SILVER PINE AT N. 33 W. 25.1 FEET.  
THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT INTERSECTION OF FOUND 6 O. BEARING TREES AS THE STANDARD CORNER TO SECTIONS 24 AND 25 ONLY.  
3 RP S.:  
7" SILVER FIR AT EAST. 13.63'  
10" SILVER FIR AT S. 2 W. 10.49'  
11" FIR AT N. 4 S. 37.78'  
F.B. 600 28A P. 55

**LEGEND**  
Set - Indicates standard D.N.R. monument unless otherwise noted.  
STANDARD D.N.R. MONUMENTS ARE:  
2 1/2" O.D. aluminum alloy pipe with "break-away" plastic base.  
3 1/2" diameter aluminum alloy cap stamped with proper corner identification, permanent, vertically oriented magnets are included in the monument base and cap.  
STANDARD D.N.R. CAPS ARE:  
3 1/2" diameter aluminum alloy disks with a vertically oriented magnet and stamped with proper corner identification set as noted.  
D.N.R. concrete monuments are 3" diameter with brass cap stamped with proper corner identification.  
D.N.R. iron pipes are 1" diameter with brass cap stamped with proper corner identification.

AUDITOR'S CERTIFICATE

SURVEYOR'S CERTIFICATE

Filed for record this 26th day of JANUARY, 19 91 at 3:02 5 M. in Book 3 of Surveys at page 3 at the request of the Washington State Department of Natural Resources.  
106487  
Auditor's File Number

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Survey Recording Act at the request of the Department of Natural Resources in December 3, 19 88.  
H. Thomas Laird Jr.  
H. Thomas Laird Jr., P.L.S.  
Certificate Number 21490



SURVEYED BY: H. THOMAS LAIRD JR.  
DRAWN BY: PLS.  
B. ERIK NEDERGAARD

**A SURVEY IN SECTION 19 TOWNSHIP 3 NORTH, RANGE 7 EAST, W.M.**

**STATE OF WASHINGTON .**  
**DEPARTMENT OF NATURAL RESOURCES**

CHECKED BY: H. THOMAS LAIRD JR.  
DATE: PLS.  
OCTOBER 1998