



(A) AT LOCATION OF CORNER A SMALL MOUND OF STONES WAS FOUND WITH CHARCOAL AND WOOD REMAINS TO THE DEPTH OF 18" BELOW GROUND SURFACE. HELD FOR ORIGINAL G.L.O. CORNER POSITION.

(B) CEDAR BEARING TREE STUMP WITH A 2" IRON PIPE WITH STAMPED "A.F.# 85978" HELD FOR ORIGINAL G.L.O. CORNER POSITION. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT FOUND LOCATION OF ORIGINAL CORNER AS THE EAST 1/4 CORNER OF SECTION 13 ONLY.

(C) NE CORNER SECTION 18.

(D) A 1" SKAMANIA COUNTY IRON PIPE WITH STAMPED BRASS CAP DATUM SET HELD FOR CORNER THIS SURVEY.

(E) SE CORNER SECTION 13.

(F) ROTTED LARCH BEARING TREE STUB AT N. 27° E. 27 FEET.

(G) ROTTED 30" FIR BEARING TREE STUMP AT N. 27° E. 27 FEET.

(H) ROTTED 30" FIR BEARING TREE STUMP AT N. 80° W. 19.53 FEET TO SPIKE IN LEFT SIDE OF STUMP. THIS BEARING TREE WAS FOUND IN THE WRONG QUADRANT BY G.L.O.

(I) 3 RP S. 50" FIR STUMP AT S. 69° E. 3.92'. 55" FIR STUMP AT S. 69° E. 3.92'. 19.53' FIR B.T. STUMP AT N. 80° W. 19.53'. F.B. 600.28 P. 55

(J) SE CORNER SECTION 13.

(K) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 13 AND 24 ONLY.

(L) 12" FIR AT N. 40° E. 4.29'. 17" FIR AT N. 54° E. 8.02'. 12" HEMLOCK AT S. 22° W. 3.02'. F.B. 600.28A P. 57

(M) NW CORNER SECTION 19.

(N) 30" ROOT COLLAR OF LARCH BEARING TREE AT S. 50 1/2° E. 24.42 FEET. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 18 AND 19 ONLY.

(O) 15" FIR AT N. 47° E. 27.80'. 20" FIR AT S. 4° W. 4.80'. 18" FIR AT S. 53° W. 9.84'. F.B. 600.28A P. 56

(P) CALCULATED CORNER. NO DNR MONUMENT WAS FOUND. THEREFORE THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT CALCULATED SINGLE-PROPORTIONED POSITION AS THE 1/4 CORNER BETWEEN SECTIONS 18 AND 19.

(Q) 26" DOUGLAS FIR AT S. 65° E. 6.13'. 27" DOUGLAS FIR AT S. 16° E. 22.79'. F.B. 600.28B P. 56

(R) NE CORNER SECTION 19.

(S) ALUMINUM PIPE WITH STAMPED 3" BRASS CAP SET IN 1878 BY LARRY BISHOP. RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS. UNDER A.F.# 85978 FOUND BEARING TREES HELD FOR CORNER THIS SURVEY.

(T) REMAINS OF 40" HEMLOCK BEARING TREE 6 FEET TALL AT N. 18° E. 71.3 FEET. FIR BEARING TREE SNAG WITH AXE MARKS AND VISIBLE SCRIBE AT S. 24° W. 25.5 FEET. HEMLOCK BEARING TREE REMAINS AT N. 73° W. 27.2 FEET.

(U) 3 RP S. 16" FIR AT S. 37° E. 4.43'. 11" FIR AT S. 24° W. 18.83'. F.B. 600.28B P. 54

(V) N. 1/16 COR. W. LINE SEC. 19

(W) CALCULATED CORNER. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND 20 FEET NORTH OF TOP OF RIGGE AT CALCULATED MID-POINT CORNER POSITION AS THE NORTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.

(X) 11" DOUGLAS FIR AT N. 53° E. 3.48'. 13" DOUGLAS FIR AT S. 74° W. 18.36'. 9" DOUGLAS FIR AT N. 74° W. 19.88'. F.B. 600.28B P. 34

(Y) NW 1/16 CORNER SECTION 19.

(Z) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED 1/16 CORNER OF SECTION 19.

(AA) 14" FIR AT S. 86° E. 25.61'. 25" FIR AT S. 10° W. 11.94'. 49" HEMLOCK AT N. 12° W. 14.07'. F.B. 600.28B P. 47

(AB) E 1/4 CORNER SECTION 24.

(AC) 24" LARCH BEARING TREE STUB AT THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP AT BEARING AND DISTANCE FROM FOUND LARCH BEARING TREE STUB AS THE EAST 1/4 CORNER OF SECTION 24 ONLY.

(AD) 3 RP S. 9" FIR AT N. 85° E. 12.95'. 9" FIR AT S. 45° W. 20.49'. 12" FIR AT N. 18° W. 1.26'. F.B. 600.28A P. 53

(AE) M 1/4 CORNER SECTION 19.

(AF) CALCULATED CORNER. BY 1903 G.L.O. THIS SURVEY WAS NOT SET. 1/4 CORNER AT MID-POINT POSITION. BUT DID NOT SET CORNER.

(AG) CW 1/16 CORNER SECTION 19.

(AH) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER-WEST 1/16 CORNER OF SECTION 19.

(AI) 3 RP S. 18" FIR AT S. 70° E. 9.48'. 11" FIR AT S. 72° W. 6.80'. F.B. 600.28B P. 42

(AJ) C 1/4 CORNER SECTION 19.

(AK) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER 1/4 CORNER OF SECTION 19.

(AL) 7" FIR AT N. 87° E. 13.68'. 13" FIR AT S. 2° W. 20.10'. 9" FIR AT N. 89° W. 8.91'. F.B. 600.28B P. 40

(AM) E 1/4 CORNER SECTION 19.

(AN) A 2" IRON PIPE WITH STAMPED 3" BRASS CAP SET IN JULY 1978 BY LARRY BISHOP. RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS. UNDER A.F.# 85978 FROM 1 FOUND BEARING TREE HELD FOR CORNER THIS SURVEY. 39" CEDAR BEARING TREE WITH BURNED FACE AND AXE MARKS AT S. 51° E. 38 FEET.

(AO) 3 RP S. 3" FIR AT S. 79° E. 30.98'. 13" FIR AT S. 48° E. 25.33'. 15" ALDER AT N. 28° W. 11.24'. SCRIBED BY BISHOP AS A B.T. F.B. 600.28 P. 56

(AP) S. 1/16 COR. W. LINE SEC. 19

(AQ) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP AT CALCULATED MID-POINT POSITION AS THE SOUTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.

(AR) 7" HEMLOCK AT S. 68° E. 13.06'. 21" DOUGLAS FIR AT S. 17° E. 19.56'. 14" DOUGLAS FIR AT S. 75° W. 7.74'. F.B. 600.28B P. 58

(AS) SW 1/16 CORNER SECTION 19.

(AT) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 8" ABOVE GROUND AT CALCULATED POSITION AS THE SOUTHWEST 1/16 CORNER OF SECTION 19.

(AU) 3 RP S. 12" DOUGLAS FIR AT N. 45° E. 8.38'. 17" DOUGLAS FIR AT N. 45° W. 16.93'. 19" DOUGLAS FIR AT N. 45° W. 16.93'. F.B. 600.28B P. 51

(AV) SE CORNER SECTION 24.

(AW) DECAYED REMAINS OF 18" SILVER PINE AT N. 32° E. 16.52 FEET. 20" SILVER PINE AT S. 57° 30' E. 25.1 FEET. SILVER PINE AT S. 9° 30' W. 58.1 FEET. DECAYED REMAINS OF 24" SILVER PINE AT N. 33° W. 29.1 FEET.

(AX) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT INTERSECTION OF FOUND 6" O. BEARING TREES AS THE STANDARD CORNER TO SECTIONS 24 AND 25 ONLY.

(AY) 3 RP S. 7" SILVER FIR AT EAST. 13.63'. 10" SILVER FIR AT S. 2° W. 10.49'. F.B. 600.28A P. 57

(AZ) SW CORNER SECTION 19.

(BA) AT LOCATION OF CORNER A SMALL MOUND OF STONES WAS FOUND WITH CHARCOAL FOR ORIGINAL G.L.O. CORNER POSITION. A MOUND OF ROTTED WOOD AT S. 61° E. 34 FEET.

(BB) A FALLEN AND DECAYED STUB AT N. 86° E. 36 FEET. ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT FOUND LOCATION OF ORIGINAL G.L.O. CORNER AS THE CLOSING CORNER TO SECTIONS 19 AND 30 ONLY. MONUMENT NOT ON LINE.

(BC) 3 RP S. 12" SILVER FIR AT N. 74° E. 13.65'. 12" SILVER FIR AT N. 74° W. 9.24'. 14" HEMLOCK AT N. 8° W. 3.50'. F.B. 600.28A P. 54

(BD) M 1/16 COR. S. LINE SEC. 19

(BE) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED MID-POINT POSITION AS THE WEST 1/16 CORNER BETWEEN SECTIONS 19 AND 30.

(BF) 3 RP S. 9" TRUE FIR AT N. 58° E. 5.06'. 9" TRUE FIR AT N. 70° W. 9.95'. F.B. 600.28B P. 49

(BG) S 1/4 CORNER SECTION 19.

(BH) BROKEN DEPT. OF NATURAL RESOURCES CONCRETE MONUMENT IN A ROCK PILE. EMPLOYEES WERE HARDED FROM FOUND BEARING TREES HELD FOR CORNER POSITION.

(BI) 20" FIR BEARING TREE STUMP WITH VISIBLE SCRIBING AT N. 77° E. 36 FEET. 1 1/2" FIR BEARING TREE BLOWDOWN WITH NO VISIBLE SCRIBING AT S. 77° W. 29 FEET.

(BJ) THIS SURVEY REPLACED BROKEN MONUMENT WITH A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 6" ABOVE ROCK MOUND SURROUNDING MONUMENT AS THE 4 RP S.


(BK) 11" FIR AT N. 41° E. 9.59'. 5" CEDAR AT S. 67° E. 15.04'. 9" TRUE FIR STUMP AT S. 36° W. 16.29'. F.B. 600.28 P. 57

(BL) E 1/4 CORNER SECTION 25.

(BM) 40" TRUE FIR BEARING TREE STUMP WITH NO MARKS AT N. 74° E. 23.76 FEET. TRUE FIR BEARING TREE STUB WITH NO MARKS AT N. 88° W. 28.40 FEET.

(BN) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT A DISTANCE BEARING TREES AS THE INTERSECTION OF SECTION 25 ONLY.

(BO) 3 RP S. 20" TRUE FIR AT S. 42° E. 10.05'. 8" TRUE FIR AT S. 71° W. 13.58'. 6" TRUE FIR AT N. 30° W. 13.84'. F.B. 600.28 P. 50

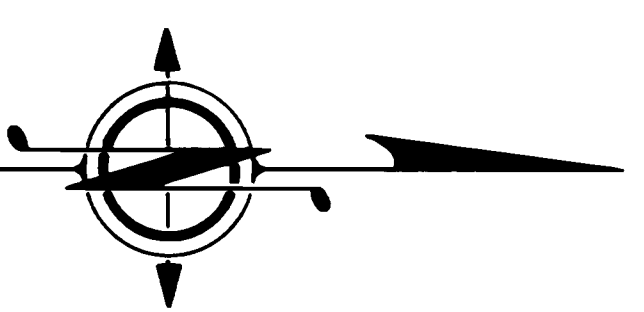

(C) SE CORNER SECTION 13.

(D) ROTTED LARCH BEARING TREE STUB AT N. 81° W. 41.58 FEET. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 13 AND 24 ONLY.

(E) 12" FIR AT N. 40° E. 4.29'. 17" FIR AT N. 54° E. 8.02'. 12" HEMLOCK AT S. 22° W. 3.02'. F.B. 600.28A P. 57

(F) NW CORNER SECTION 19.

(G) 30" ROOT COLLAR OF LARCH BEARING TREE AT S. 50 1/2° E. 24.42 FEET. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND FROM FOUND LARCH BEARING TREE STUB AS THE STANDARD CORNER FOR SECTIONS 18 AND 19 ONLY.

(H) 15" FIR AT N. 47° E. 27.80'. 20" FIR AT S. 4° W. 4.80'. 18" FIR AT S. 53° W. 9.84'. F.B. 600.28A P. 56

(I) CALCULATED CORNER. NO DNR MONUMENT WAS FOUND. THEREFORE THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT CALCULATED SINGLE-PROPORTIONED POSITION AS THE 1/4 CORNER BETWEEN SECTIONS 18 AND 19.

(J) 26" DOUGLAS FIR AT S. 65° E. 6.13'. 27" DOUGLAS FIR AT S. 16° E. 22.79'. F.B. 600.28B P. 56

(K) NE CORNER SECTION 19.

(L) ALUMINUM PIPE WITH STAMPED 3" BRASS CAP SET IN 1878 BY LARRY BISHOP. RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS. UNDER A.F.# 85978 FOUND BEARING TREES HELD FOR CORNER THIS SURVEY.

(M) REMAINS OF 40" HEMLOCK BEARING TREE 6 FEET TALL AT N. 18° E. 71.3 FEET. FIR BEARING TREE SNAG WITH AXE MARKS AND VISIBLE SCRIBE AT S. 24° W. 25.5 FEET. HEMLOCK BEARING TREE REMAINS AT N. 73° W. 27.2 FEET.

(N) 3 RP S. 16" FIR AT S. 37° E. 4.43'. 11" FIR AT S. 24° W. 18.83'. F.B. 600.28B P. 54

(O) N. 1/16 COR. W. LINE SEC. 19

(P) CALCULATED CORNER. THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND 20 FEET NORTH OF TOP OF RIGGE AT CALCULATED MID-POINT CORNER POSITION AS THE NORTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.

(Q) 11" DOUGLAS FIR AT N. 53° E. 3.48'. 13" DOUGLAS FIR AT S. 74° W. 18.36'. 9" DOUGLAS FIR AT N. 74° W. 19.88'. F.B. 600.28B P. 34

(R) NW 1/16 CORNER SECTION 19.

(S) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED 1/16 CORNER OF SECTION 19.

(T) 14" FIR AT S. 86° E. 25.61'. 25" FIR AT S. 10° W. 11.94'. 49" HEMLOCK AT N. 12° W. 14.07'. F.B. 600.28B P. 47

(U) E 1/4 CORNER SECTION 24.

(V) 24" LARCH BEARING TREE STUB AT THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP AT BEARING AND DISTANCE FROM FOUND LARCH BEARING TREE STUB AS THE EAST 1/4 CORNER OF SECTION 24 ONLY.

(W) 3 RP S. 9" FIR AT N. 85° E. 12.95'. 9" FIR AT S. 45° W. 20.49'. 12" FIR AT N. 18° W. 1.26'. F.B. 600.28A P. 53

(X) M 1/4 CORNER SECTION 19.

(Y) CALCULATED CORNER. BY 1903 G.L.O. THIS SURVEY WAS NOT SET. 1/4 CORNER AT MID-POINT POSITION. BUT DID NOT SET CORNER.

(Z) CW 1/16 CORNER SECTION 19.

(AA) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER-WEST 1/16 CORNER OF SECTION 19.

(AB) 3 RP S. 18" FIR AT S. 70° E. 9.48'. 11" FIR AT S. 72° W. 6.80'. F.B. 600.28B P. 42

(AC) C 1/4 CORNER SECTION 19.

(AD) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED POSITION AS THE CENTER 1/4 CORNER OF SECTION 19.

(AE) 7" FIR AT N. 87° E. 13.68'. 13" FIR AT S. 2° W. 20.10'. 9" FIR AT N. 89° W. 8.91'. F.B. 600.28B P. 40

(AF) E 1/4 CORNER SECTION 19.

(AG) A 2" IRON PIPE WITH STAMPED 3" BRASS CAP SET IN JULY 1978 BY LARRY BISHOP. RECORD DATED 5 AUG. 1978 FILED IN SKAMANIA COUNTY BOOK 3/7 OF MONUMENTS. UNDER A.F.# 85978 FROM 1 FOUND BEARING TREE HELD FOR CORNER THIS SURVEY. 39" CEDAR BEARING TREE WITH BURNED FACE AND AXE MARKS AT S. 51° E. 38 FEET.

(AH) 3 RP S. 3" FIR AT S. 79° E. 30.98'. 13" FIR AT S. 48° E. 25.33'. 15" ALDER AT N. 28° W. 11.24'. SCRIBED BY BISHOP AS A B.T. F.B. 600.28 P. 56

(AI) S. 1/16 COR. W. LINE SEC. 19

(AJ) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP AT CALCULATED MID-POINT POSITION AS THE SOUTH 1/16 CORNER ON THE WEST LINE OF SECTION 19.

(AK) 7" HEMLOCK AT S. 68° E. 13.06'. 21" DOUGLAS FIR AT S. 17° E. 19.56'. 14" DOUGLAS FIR AT S. 75° W. 7.74'. F.B. 600.28B P. 58

(AL) SW 1/16 CORNER SECTION 19.

(AM) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 8" ABOVE GROUND AT CALCULATED POSITION AS THE SOUTHWEST 1/16 CORNER OF SECTION 19.

(AN) 3 RP S. 12" DOUGLAS FIR AT N. 45° E. 8.38'. 17" DOUGLAS FIR AT N. 45° W. 16.93'. 19" DOUGLAS FIR AT N. 45° W. 16.93'. F.B. 600.28B P. 51

(AO) SE CORNER SECTION 24.

(AP) DECAYED REMAINS OF 18" SILVER PINE AT N. 32° E. 16.52 FEET. 20" SILVER PINE AT S. 57° 30' E. 25.1 FEET. SILVER PINE AT S. 9° 30' W. 58.1 FEET. DECAYED REMAINS OF 24" SILVER PINE AT N. 33° W. 29.1 FEET.

(AQ) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT INTERSECTION OF FOUND 6" O. BEARING TREES AS THE STANDARD CORNER TO SECTIONS 24 AND 25 ONLY.

(AR) 3 RP S. 7" SILVER FIR AT EAST. 13.63'. 10" SILVER FIR AT S. 2° W. 10.49'. F.B. 600.28A P. 57

(AS) SW CORNER SECTION 19.

(AT) AT LOCATION OF CORNER A SMALL MOUND OF STONES WAS FOUND WITH CHARCOAL FOR ORIGINAL G.L.O. CORNER POSITION. A MOUND OF ROTTED WOOD AT S. 61° E. 34 FEET.

(AU) A FALLEN AND DECAYED STUB AT N. 86° E. 36 FEET. ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT FOUND LOCATION OF ORIGINAL G.L.O. CORNER AS THE CLOSING CORNER TO SECTIONS 19 AND 30 ONLY. MONUMENT NOT ON LINE.

(AV) 3 RP S. 12" SILVER FIR AT N. 74° E. 13.65'. 12" SILVER FIR AT N. 74° W. 9.24'. 14" HEMLOCK AT N. 8° W. 3.50'. F.B. 600.28A P. 54

(AW) M 1/16 COR. S. LINE SEC. 19

(AX) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 3" ABOVE GROUND AT CALCULATED MID-POINT POSITION AS THE WEST 1/16 CORNER BETWEEN SECTIONS 19 AND 30.

(AY) 3 RP S. 9" TRUE FIR AT N. 58° E. 5.06'. 9" TRUE FIR AT N. 70° W. 9.95'. F.B. 600.28B P. 49

(AZ) S 1/4 CORNER SECTION 19.

(BA) BROKEN DEPT. OF NATURAL RESOURCES CONCRETE MONUMENT IN A ROCK PILE. EMPLOYEES WERE HARDED FROM FOUND BEARING TREES HELD FOR CORNER POSITION.

(BB) 20" FIR BEARING TREE STUMP WITH VISIBLE SCRIBING AT N. 77° E. 36 FEET. 1 1/2" FIR BEARING TREE BLOWDOWN WITH NO VISIBLE SCRIBING AT S. 77° W. 29 FEET.

(BC) THIS SURVEY REPLACED BROKEN MONUMENT WITH A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 6" ABOVE ROCK MOUND SURROUNDING MONUMENT AS THE 4 RP S.

(BD) 11" FIR AT N. 41° E. 9.59'. 5" CEDAR AT S. 67° E. 15.04'. 9" TRUE FIR STUMP AT S. 36° W. 16.29'. F.B. 600.28 P. 57

(BE) E 1/4 CORNER SECTION 25.

(BF) 40" TRUE FIR BEARING TREE STUMP WITH NO MARKS AT N. 74° E. 23.76 FEET. TRUE FIR BEARING TREE STUB WITH NO MARKS AT N. 88° W. 28.40 FEET.

(BG) THIS SURVEY SET A DNR ALUMINUM MONUMENT WITH STAMPED ALUMINUM CAP 4" ABOVE GROUND AT A DISTANCE BEARING TREES AS THE INTERSECTION OF SECTION 25 ONLY.

(BH) 3 RP S. 20" TRUE FIR AT S. 42° E. 10.05'. 8" TRUE FIR AT S. 71° W. 13.58'. 6" TRUE FIR AT N. 30° W. 13.84'. F.B. 600.28 P. 50

**LEGEND**

Set - Indicates standard DNR monument unless otherwise noted.

STANDARD D.N.R. MONUMENTS ARE:

- 2 1/2" O.D. aluminum alloy pipe with "break-away" plastic base.
- 3 1/2" diameter aluminum alloy cap stamped with proper corner identification, permanent, vertically oriented magnets are included in the monument base and cap.

STANDARD D.N.R. CAPS ARE:

- 3 1/2" diameter aluminum alloy disks with a vertically oriented magnet and stamped with proper corner identification set as noted.
- D.N.R. concrete monuments are 3" diameter with brass cap stamped with proper corner identification.
- D.N.R. iron pipes are 1" diameter with brass cap stamped with proper corner identification.

AUDITOR'S CERTIFICATE

Filed for record this 26th day of JANUARY, 19 91 at 3:02 P.M. in Book 3 of Surveys at page 3 at the request of the Washington State Department of Natural Resources.

Auditor's File Number 106487

*H. Thomas Laird Jr.*  
Skamania County Auditor

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Survey Recording Act at the request of the Department of Natural Resources in November 3, 19 88.

*H. Thomas Laird Jr.*  
H. Thomas Laird Jr., P.L.S.

Certificate Number 21490



**A SURVEY IN SECTION 19 TOWNSHIP 3 NORTH, RANGE 7 EAST, W.M.**

SURVEYED BY: H. THOMAS LAIRD JR.  
DRAWN BY: B. ERIK NEDERGAARD

**STATE OF WASHINGTON . DEPARTMENT OF NATURAL RESOURCES**

CHECKED BY: H. THOMAS LAIRD JR.  
DATE: OCTOBER 1998