

# LAND CORNER RECORD

T 5 N, R 9E, W.M.  
Segregated Surveys:  
Name: SC, S 1/4 S35 County SKAMANIA Corner Code No. Z-19  
Corner No.:  
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite

## 1. History of Corner Establishment and Subsequent Restoration:

CORNER ESTABLISHED BY DEPUTY SURVEYOR JACOB RICHARDSON  
UNDER CONTRACT No. 383, OCTOBER, 1892. SET POST FROM WHICH BEARS:  
6" FIR, S 50°W, 23 lks., SCRIBED "SC 1/4 S.B.T."  
14" FIR, N 18°30'E 71 lks., SCRIBED "SC 1/4 S.B.T."

## 2. Description of Evidence Found:


1/2" IRON SPIKE, UNKNOWN ORIGIN, FROM WHICH:  
6" DF, NOW 26" DF, BEARS S 50°W, 15.1 FT, HEALED BLAZE  
14" DF, NOW 41" DF, BEARS N 18°30'E, 46.6 FT, HEALED BLAZE

FILED FOR RECORD  
OCT 28 9 49 AM '87  
J. New, Dep  
AUDITOR  
CLYDE

## 3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 4 Page No. 6 Date of work 3-23-87

SET STD. 2 1/2" x 30" ALUMINUM PIPE AND CAP, 24" IN THE GROUND  
FROM WHICH:  
17" DF BEARS S 12°W, 14.15 FT, SCRIBED "S2 BT"  
22" DF BEARS N 79°30'E, 5.35 FT, SCRIBED "1/4 S35 BT"

TREES ARE PAINTED, SIGNED AND HAVE BRASS WASHERS  
"PLS 18731" SET GUARD POST WITH 54-2 AND 54-9 SIGNS  
PLACED SPIKE IN HOLE WITH MONUMENT

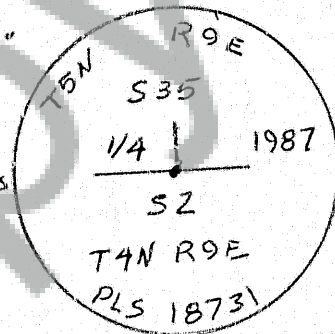

Washington Plane Coordinates: Zone, Y, X  
Order Accuracy. Derived From:  
Pin Pointed on Photo No. Date. Located at.

## SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date 10/18/87 Certificate No. 18731

Signature



## AUDITOR'S CERTIFICATE

Filed for record this day of 19 at M. In Book of at page at the request of

County Auditor

Registered S  
Ind. x. d. in  
Ind. rec.  
Filed (2)  
Mailed

Form prescribed by Bureau of Surveys and Maps pursuant to the provisions of Section Chapter 50, Laws of 1973.