

107748

BOOK 6/6 PAGE 56

LAND CORNER RECORD

HAMPSTUR CORPORATION
1010 Douglas A3
LONGVIEW, WASHINGTON 98632

T 6 N.R. 6 E. W.M. SKAMANIA County
Segregated Surveys: Corner Code No. J-1
Name: SW corner of Section 7 Corner No.:
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.


1. History of Corner Establishment and Subsequent Restoration:
This corner was originally established in 1909 by C.F. Rhodes, while working under GLO contract #674, at which time he set a 18"x14"x12" sandstone. In 1984, B.L. Jones, LS #18,734 found the stone and remonumented the corner with the USFS alum. monument shown in the diagram below. He set 2 Ref. mon's and scribed 1 new RP at that time, as shown on his LCR filed in BOOK 6/6, page 20. On August 17, 1988, R. Bogdon (from HAMPSTUR CORP.) located the above mon., refreshed the references and added the steel ref. post indicated in the diagram below, under the direction of C. Hampton, PLS #18,087.

2. Description of Evidence Found:
ORIGINAL GLO MONUMENT: an 18"x14"x12" sandstone; replaced in 1984 and buried, as mentioned above and shown in the diagram below.
ORIGINAL 1909 BT's:
-22" Hemlock, N56°E--19 lks.; fd. 36" Hemlock snag at N52°E--12.9 ft. (see diagram).
-6" Hemlock, S69°E--10 lks.; fd. 11" Hemlock with over grown face at S74°E--6.0 ft.
-12" Fir, S77°W--27 lks.; gone.
-5" Hemlock, N51°W--27 lks.; fd. 14" Hemlock stump, 2 ft. high.
SUBSEQUENT RESTORATIONS:
Found the USFS mon. shown below along with 2 reference mon's., as mentioned above and shown below, also found 1 RP also shown in the diagram below.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. PS-056 Page No. 37-38 Date of work 8-17-88

LOCATION:

- on a 50% North slope.
- at the existing SW corner of a mature stand of conifers.
- 50 ft. South of a spur road.
- S60°W--approx. 500 ft. from a switch-back and creek crossing in main logging road.

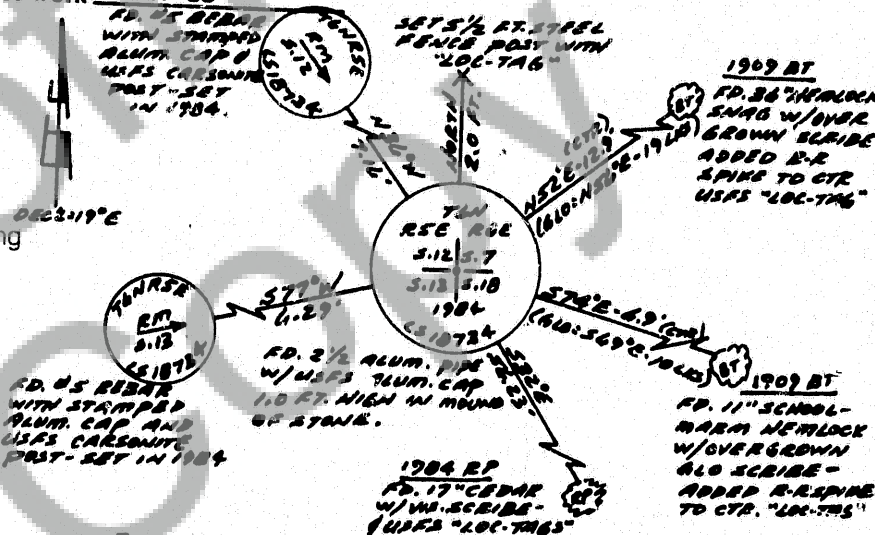

Washington Plane Coordinates: _____ Zone, Y _____
Order Accuracy. Derived From: _____ X _____
Pin Pointed on Photo No. _____ Date _____ Located at _____

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date August 28, 1989

Signature Calvin J. Hampton, PLS LS #18,087
Certificate No



AUDITOR'S CERTIFICATE

Recorded for record this _____ day of _____ 19 _____ at _____ M. In _____ of _____ at page _____ at the request of _____

County Auditor

Registered
Indexed, Jir
Indirect
Filed 9-1-89
Mailed