

LAND CORNER RECORD

(THIS FORM PRESCRIBED BY THE PUBLIC LAND SURVEY OFFICE, DEPARTMENT OF NATURAL RESOURCES, PURSUANT TO RCW 58.09. ALPHA-NUMERIC INDEX DIAGRAM ON THE BACK.)

FILED FOR RECORD
SKAMANIA CO. WASH
BY Bob Glaeser

FEB 1 4 33 PM '94
J. Laury
AUDITOR
GARY M. OLSON

Corner Indexing Information:

TWP 1 N RGE 5 E Corner Code A-5
(Willamette Meridian)

ADDITIONAL IDENTIFIER: (e.g., BLM designation for the corner, street intersection, plat name, block, lot, etc.)

Northwest corner of Section 5, Township 1 North, Range 5 East, Willamette Meridian.

118649

BOOK 141 PAGE 236


Skamania County Washington:

Land Surveyor Information: (or Public Officer as per RCW 58.09.090)

AUDITOR'S USE

This corner record correctly represents work performed by me or under by direction in conformance with the Survey Recording Act.

Company or agency:
Minister & Glaeser Surveying, Inc.
2208 E. Evergreen Blvd.
Vancouver, WA. 98661
Phone: (206) 694-3313
Fax: (206) 694-8410

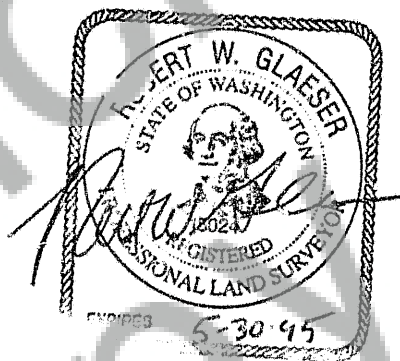

Signature [Signature] Date: 1/19/94 Seal:

Washington Plane Coordinates: N: _____ E: _____
Order: _____ Zone: _____ Datum (Date of adjustment): _____

Corner Information: Use the space below to provide the following information regarding the corner.

(1) Pertinent Corner History: The original survey was conducted by Deputy Surveyors, Lewis Van Vleet and John Newsom, under Contract No. 47, dated the 23rd day of April, 1859. The survey was conducted between April 26 and April 29, 1859. Set a post common to Sections 5, 6, 31 and 32, R.P.'s were as follows:
6" diameter Fir, North 61° East, 75 Links.
8" diameter Alder, South 71° East, 112 Links.
8" diameter Maple, South 32° West, 39 Links.
6" diameter Fir, North 55° West, 96 Links.

In approximately 1910, Clark LaBarre, set a point which is marked with a Skamania County Concrete Monument with Brass Cap bears North 18°24'15" East, 140.31 from the proportioned Northwest corner of Section 5. As stated in Hagedorn Short Plat Book 3, page 207, said found Concrete Monument was set erroneously by Clark LaBarre and is not the true section corner.

In January of 1992, W.F. Hagedorn conducted a survey (Book 3, page 73, of Skamania County records), and calculated the position of said section corner by single proportion.

Registered
Surveyor
No. 12024
Date 5-30-95
Seal

(2) Evidence Found at the Corner: No original evidence found. The position of this corner was calculated based on Hagedorn survey found in records of Skamania County, Survey Book 3, page 73. (Position of corner falls in building, not set).

(3) Corner Perpetuation Information: Refer to the following records of surveys:

Surveys

Book 3, page 73
Book 3, page 207
Book 3, page 41
Book 1, page 6

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C																									
D																									
E																									
F																									
G																									
H																									
I																									
J																									
K																									
L																									
M																									
N																									
O																									
P																									
Q																									
R																									
S																									
T																									
U																									
V																									
W																									
X																									
Y																									
Z																									

RCW 58.07.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENTS: