

93577

T. N. TRANTOW SURVEYING

P.O. Box 287
Bingen, Washington 98605

LAND CORNER RECORD

SKAMANIA

County

Corner Code No. T-1

T 3 N, R 8 E, W.M.
Segregated Surveys:Name: 1 corner common to S. 30/3-8 & S. 25/3-7½ Corner No: _____
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:

GLO in 1878 set a post for this corner, from which bear:
24" fir, N80E, 11 links (7.26 ft.)

14" fir, S85W, 12 links (7.92 ft.)

GLO in 1893 retraced this corner, set a new post, and made new calls to the old BT's:

24" fir, N73E, 10 links (6.60 ft.)

15" fir, West, 12 links (7.92 ft.)

Longview Fibre Co. set an iron pipe for this corner in 1968, and marked two new witness trees.

2. Description of Evidence Found:

Found $\frac{1}{2}$ " pipe protruding 12" above ground
24" rotted fir stump, fits call, no scribing
14" rotted fir stump, fits call, no scribing
6" D-fir with partially healed face with visible scribing
8" D-fir with healed face.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 30819 Page No. 5 Date of work 15 February 1982

Replace pipe with a $1\frac{1}{4}$ x 30" galvanized iron pipe with $2\frac{1}{2}$ " brass cap, from which bear:

BT: 24" rotted D-fir stump, N77E, 6.50 ft. to center

BT: 14" rotted D-fir stump, S86W, 8.50 ft. to center

WT: 6" D-fir, S62E, 2.50 ft. to a healed, scribed face

WT: 8" D-fir, S48E, 17.42 ft. to partially healed face with visible scribing

Both witness trees are marked with Longview Fibre Co. witness tags. Corner lies approx. 900 ft. North of powerline road, about 10 feet below the crest of a steep slope, which breaks to both the North and East. Area around corner is in a stagnated thicket of Douglas-fir, and presently on the east edge of a large clearcut area.

Washington Plane Coordinates: South Zone, Y 143575.29, X 1654031.62
Third Order Accuracy. Derived From: Skamania County control surveys, 1977

Pin Pointed on Photo No. 92-6 Date SW-74 Located at Trantow Surveying, Bingen


SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or
under my direction in compliance with the provisions of Chapter
50, Laws of 1973. Date 17 May 1982

Signature

15673

Certificate No.

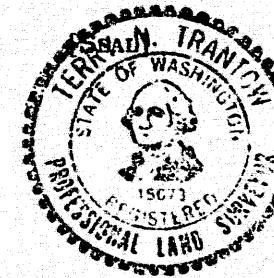

AUDITOR'S CERTIFICATE

Filed for record this 11 day of May 1982 at 2 P.M. In
Book 31 of Land Records at page 32 at the request of
TRANTOW SURVEYING

County Auditor

Form prescribed by Bureau of Surveys and Maps pursuant to the provisions of Section 5 (2),
Chapter 50, Laws of 1973.