

LAND CORNER RECORD

Skamania

County

T 4 N, R 7E, W.M.

Corner Code No. L-13

Segregated Surveys:

Name: One-quarter corner

Corner No.:

DLC, HES Tract, Mining Claims, Indian Allotment, Federal Reserve, Townsite

1. History of Corner Establishment and Subsequent Restoration:

Corner originally established by Deputy Jacob Richardson under Contract No. 459 in July/Aug. 1895.

Set post

Scribed 15" Fir N48E-33 lks..

13" Hemlock N51W-37 lks..

2. Description of Evidence Found:

Set Hemlock post 5"x4" scribed 1/4 on North 15 on East & 16 on West. (not orig.)

Orig. 15" now 30" rotted D-Fir stump N48E-19.2 (record 21.8) no marks remain.

Orig. 13" now rotted Hemlock mound N51W-27 (record 24.4).

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. 5 Page No. 2 Date of work 4/82

Set 2"x30" Gal. steel pipe with a 2" Brass cap. Marked: T4N R7E

New bearing Trees:

10" D-Fir S64W, 7.2 ft. scribed NS15 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 16337.

12" D-Fir S4E, 13.2 ft. scribed NS15 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 16337.

NS15
1982
PLS 16337

Set guard post South with sign 54-4 and BM 102 decal. Nailed 54-4 and BT signs and painted band and blazes red to all BT's.

Washington Plane Coordinates: Zone, Y

Order Accuracy. Derived From: X


Pin Pointed on Photo No. Date Located at

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date

Signature

Certificate No.

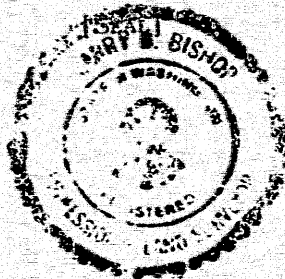

AUDITOR'S CERTIFICATE

Filed for record this day of 19 at M. in Book of at page 6 at the request of

County Auditor