

LAND CORNER RECORD

Stamania
 T. 7 N, R. 6E, W.M. County T-17
 Segregated Surveys: Corner Code No.
 Name: One-quarter Corner Corner No.:
 DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:

This corner was originally set by Deputy Lewis D.W. Shelton in July 1899, & Oct.-Dec. 1900 under Contract No. 552.

Set Fir post.
 Scribed 10" Cedar N59E-25 lks..
 5" Cedar N46W-18 lks..


2. Description of Evidence Found:

5/8"x30" Iron Rod.
 26" Cedar face rotted out N45E, 3.2 ft. possible original with miscalled distance.
 Unrecorded 24" D-Fir stump scribing visible N30W, 4.4 ft..

Accepted as perpetuation of original corner point-the unrecorded BT was marked about 1920.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. _____

Page No. 5 Date of work June 1982
 Set 2"x30" Aluminum pipe with a 2" Aluminum cap. Marked: T. 7N R. 6E
 Buried Iron Rod along side monument. S27 1 S26
 1982
 PLS 16337
 New Bearing Trees:
 16" D-Fir S03E, 11.2 ft. scribed 1/2 S26 upper blaze and a lower blaze scribed BT and with a 3/4" Brass disk stamped PLS 16337.
 Nailed signs 54-4 and BT signs to BT's.
 Painted red band and blazes red.
 Set guard post 5 ft. South with sign 54-4 and BH 102 decal.

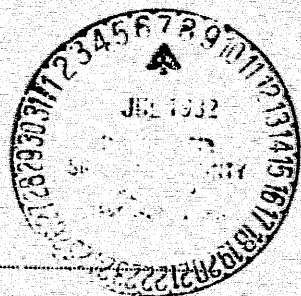

Washington Plane Coordinates: _____ Zone, Y _____, X _____
 Order Accuracy. Derived From: _____
 Pin Pointed on Photo No. _____ Date _____ Located at _____

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date _____

Signature Larry D. Bishop Certificate No. 16337



AUDITOR'S CERTIFICATE

Filed for record this 7th day of JULY 1982 at 11:30 A.M. In Book 7/6 of RECORDS at page 6 at the request of

J.M. Wilson
 County Auditor