

LAND CORNER RECORD

T 7 N, R 6E, W.M. Skamania County
Segregated Surveys: Corner Code No. A-13
Name: _____ Corner No.: _____
DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration:


1900 Lewis D.W. Shelton, GLO
Set: 4" sg. yew post
18" cedar N31E, 25 lks
14" white fir S46 1/2 E, 22 lks
36" fir S55 1/2 W, 15 lks
8" hemlock N16 1/4 W, 34 lks

1961 Floyd A. Brooks, BLM
Found evidence of all 4 BT's
plus unrecorded 20" sawed
hemlock stump S10E, 32 lks
scribe, 53 BT visible.
Set: standard BLM iron pipe with
brass cap.
5" hemlock N19 1/2 E, 36 1/2 lks
10" white fir S79E, 77 lks
9" yew S68 1/2 W, 43 lks
8" white fir N64W, 26 lks

1982 L.D. Bishop
Found Shelton's SW and NE
BT's. Found Brooks'
SW and SE BT's.
Set: 20" hemlock stump
N51W, 43.9 ft. scribed
T8N R6E S33 BT on
face of stump and drove
R/R spike in the center.

2. Description of Evidence Found:


BLM brass cap monument 4" above ground, marked
48" burned stump S55 1/2 W, 9.9 ft. - Shelton BT
26" cedar stump N31E, 16.5 ft. - Shelton BT
9" snag S68 1/2 W, 28.4 ft. - Brooks BT
20" hemlock stump N51W, 43.9 ft. - Bishop BT

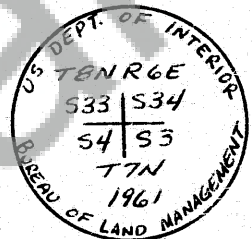

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No.

Page No. 21 Date of work 6/22/83

Set 2" aluminum cap on 5/8" rebar for reference, marked:
N 10 E, 14.71 ft. from corner.

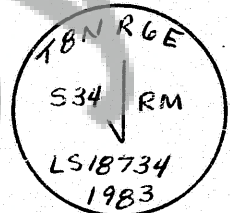

Registered T
Indexing E
Index W
26 W
10 W

Washington Plane Coordinates _____ Zone, Y _____, X _____
Order Accuracy. Derived From: _____
Pin Pointed on Photo No. _____ Date _____ Located at _____

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973. Date 10/26/83
Beulah L. Jones Signature
18734 Certificate No.



AUDITOR'S CERTIFICATE

Filed for record this 31 day of Oct 1983 at 9:14 A.M. In
Book 7/6 of Monuments at page 61 at the request of
U. S. Forest Service

Gary M. Olson
County Auditor