

## T. N. TRANTOW SURVEYING

412 W. Jefferson P.O. Box 287

Bingen, Washington 98605 (509) 493-3111

## LAND CORNER RECORD


T. 3 N, R. 10 E, W.M. KLICKITAT & County Corner Code No. A-15  
SKAMANIAName: 1/4 cor. to S. 34, T4NR10E & S. 3, T3NR10E Corner No.:  
D.L.C., H.P.S., Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration: 2. Description of Evidence Found:  
GLO in 1875 set a post and marked two 6" D-fir BT's for this corner. The NW Electric Survey of 1912 appears to have used (or set) a corner based on single proportion, but their field notes do not indicate any information. The 1938 Office of Indian Affairs found a scribed stake and a 1919 witness tree, but no original evidence. Based on testimony from an adjacent landowner, the Forest Examiner reset the corner with an iron pipe & brass cap. (See his 1938 corner record for details), from which bear:  
14" white fir, 1919 BT, S35W, 52 links (34.32 ft.), scribed 1/4S3BT  
18" D-fir, N71E, 133 links (87.78 ft.), scribed 1/4S34BT  
He destroyed the scribed cedar post found lying on the ground.

## 2. Found IP &amp; BC as described


14" white fir stump, rotted, no visible scribing

remains of what may have been the D-fir at the call given. Too indefinite

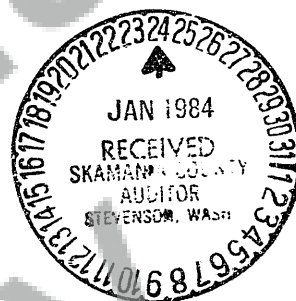

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record.  
F.B. No. 31003 Page No. 42 Job No. 83121 Date of Work 1. December. 1983

From the 1 1/2 x 36" iron pipe and brass cap, set 27" in the ground, bear the following:  
14" rotted white fir stump, S35W, 34.70 ft. to center  
4" oak, S44W, 28.96 ft. to nail at center of tree with root crown scribed S3WT  
Fencepost, west, 5.82 ft.  
DNR line post, west, 1.0 ft.  
New witnesses are marked with witness tags.  
Corner lies 60 ft. South of centerline of gas line, and  
in west ditchline of County Road.

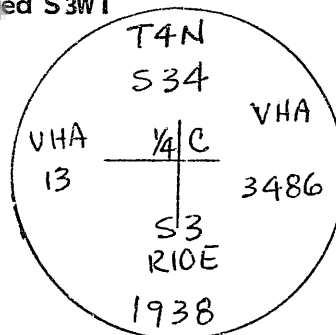

Washington Plane Coordinates: South Zone, Y NA, X  
Order Accuracy. Derived From:

Pin Pointed on Photo No. 4-9 Symbol KYK-79 Located at Trantow Surveying, Bingen

## SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 50, Laws of 1973.

Signature

Date 20 Dec 83  
Certificate No. 15673

## AUDITOR'S CERTIFICATE

Filed for record this 24th day of JANUARY 1984 at 9:35 A.M. In Book 3/10 of MONUMENTS at page 36 at the request of

T. N. TRANTOW SURVEYING

County Auditor