

T. N. TRANTOW SURVEYING

412 W. Jefferson P.O. Box 287

Bingen, Washington 98605 (509) 493-3111

LAND CORNER RECORD


T. 3 N, R. 10 E, W.M. SKAMANIA County Corner Code No. C-15

Name: Center of Section three

Corner No.:

DLC, HES, Tract, Mining Claim, Indian Allotment, Federal Reserve, Townsite.

1. History of Corner Establishment and Subsequent Restoration: 2. Description of Evidence Found: Attached affidavit indicates a pipe set for this corner prior to 1919, for which there is no record of establishment. The parcel to which this is the northeast corner was created as a homestead in 1911. A survey of record, circa 1919-1922, indicates a found 'gass' pipe set in concrete for this corner. The 1911-12 survey for Condit Dam in this section indicates a center of section, but distances of record for that survey do not confirm this position of the pipe. A 1950 Klickitat Co. P.U.D. plat shows a fence corner at indicated center of section, which fence corner is next to this found pipe. The plat tie is used only to locate a utility line in the vicinity. Without regard to lines of possession, this found pipe was considered not acceptable as the true center of section.

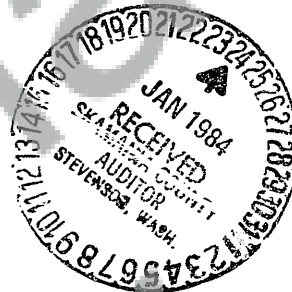


3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record.
F.B. No. 31003 Page No. 44 Job No. 83121 Date of Work 4 December 1983

At the proper position, set a $1\frac{1}{4} \times 30$ " galvanized iron pipe with $2\frac{1}{2}$ " brass cap 10" below the ground, in an old field, from which bear:

Fencepost, N43E, 60.60 ft. to nail in post
Fencepost, S66E, 76.56 ft. to nail in post
Both posts marked with aluminum witness tags

Found iron pipe at obliterated fence intersection lies 87 ft. South and 140 ft. East of new corner (calculated, S 58°05'40" E, 165.05 ft.)

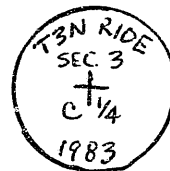

Washington Plane Coordinates: South Zone, Y NA, X
Order Accuracy. Derived From:

Pin Pointed on Photo No. 4-9 Symbol KYK-79 Located at Trantow Surveying, Bingen

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of Chapter 30, Laws of 1973.

Signature

Date 20 December 1983

Certificate No. 15673



AUDITOR'S CERTIFICATE

Filed for record this 24 TH day of JANUARY 1984 at 9:40 A.M. In Book 3/10 of MONUMENTS at page 39 at the request of

T. N. TRANTOW SURVEYING

County Auditor