

115413

BOOK 133 PAGE 180

**LAND CORNER RECORD**

(THIS FORM PRESCRIBED BY THE PUBLIC LAND SURVEY OFFICE, DEPARTMENT OF NATURAL RESOURCES, PURSUANT TO RCW 58.09. ALPHA-NUMERIC INDEX DIAGRAM ON THE BACK)

FILED RECORD  
BY Olson Engineering

3-18-93

J. Lowry

**CORNER INDEXING INFORMATION:**TWP 1N RGE 5E CORNER CODE A-17  
(Willamette Meridian) (See Instructions on back of LCR)

ADDITIONAL IDENTIFIER: (e.g., BLM designation for the corner, street intersection, plat name, block, lot, etc.)

Registered  
Index  
Date  
2/12/93**NE CORNER SECTION 3**COUNTY: **SKAMANIA**

AUDITOR'S USE

**LAND SURVEYOR INFORMATION:** (or Public Officer as per RCW 58.09.090)

This corner record correctly represents work performed by me or under my direction in conformance with the Survey Recording Act.


COMPANY OR AGENCY: **OLSON ENGINEERING INC.**  
**1111 BROADWAY**  
ADDRESS: **VANCOUVER, WA 98660**

1/20/93

**WASHINGTON PLANE COORDINATES:** N: E:

ORDER: ZONE: DATUM (Date of adjustment):

**CORNER INFORMATION:** Use the space below to provide the following information regarding the corner: (1) Pertinent Corner History, (2) Evidence Found at the Corner, and (3) Corner Perpetuation Information. Please title and number the parts of your discussion accordingly. If additional space is needed use the back. (For (3), diagram the references. Also, provide the cross-reference to a map of record, if applicable, the surveyor's field book no./page no., and the date of work.) (See the back of this form for the requirements of the Survey Recording Act.)

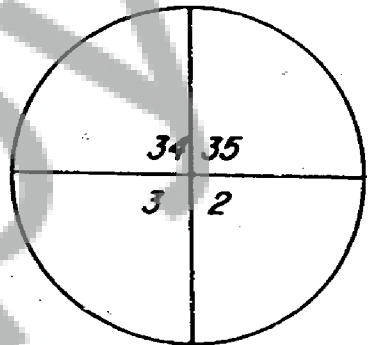

The original corner post was established on April 27, 1859 by United States Deputy Surveyor, Lewis Van Vleet. Bearing trees were a 15" fir North 34° East, 79 links a 6" dogwood North 57° West, 64 links, a 20" fir South 34° East, 87 links, and a 12" fir South 14° West, 134 links.

During a DNR "setting of concrete monument" record dated February 20, 1970, C.E. Whitten notes find the bearing trees in Section 2 and 3 as live 60" fir trees. Mr. Whitten also notes sawing into the section three bearing tree and finding scribing and a reverse face. He then arced the GLO distances from the tree centers and set the monument. Found a DNR monument.

MARK THE CORNER LOCATION ON THE DIAGRAM BELOW AND FILL IN THE CORNER CODE BLANK ON THE OTHER SIDE:

(1) For corners located at the intersection of two lines (Section corners, quarter corners and sixteenth corners):

(a) The corner code is the alpha-numeric coordinate from the diagram below that corresponds to the appropriate intersection of lines.

(2) For corners that are not located at the intersection of two lines (Meander corners, DLC's, HES's, reservation boundaries, mining claims, etc.):

(a) For corners that are on one line only the corner code is the line designation and the related line segment; i.e., a corner on line 5 between "B" and "C" is designated 8C-5.

(b) For corners that are between lines the corner code is both line segments; i.e., a corner in the SE1/4 of the SE1/4 of section 18 is designated MM-4-5.

A 26x26 grid with letters A-Z on the left and numbers 1-26 on the top. A large, faint watermark 'X' is visible across the grid.

ACW 58.09.060 (2) requires the following information on this form: an accurate description and location, in reference to the corner position, of all monuments and accessories (a) found at the corner and (b) placed or replaced at the corner; (c) basis of bearings used to describe or locate such monuments or accessories; and (d) corollary information that may be helpful to relocate or identify the corner position.

SPACE FOR ADDITIONAL COMMENT:

THE FOLLOWING REFERENCES ARE FROM DNR RECORDS:

