



SURVEY

IN A PORTION OF THE
NW 1/4 AND THE NE 1/4
OF THE SW 1/4 OF SECTION 33,
T2N, R6E, W.M.
SKAMANIA COUNTY, WA

POSITION OF DNR
CONCRETE MONUMENT
AS SHOWN IN S.R. #1
(HELD)
L.C.R. BK. 135
PG. 61 & 62

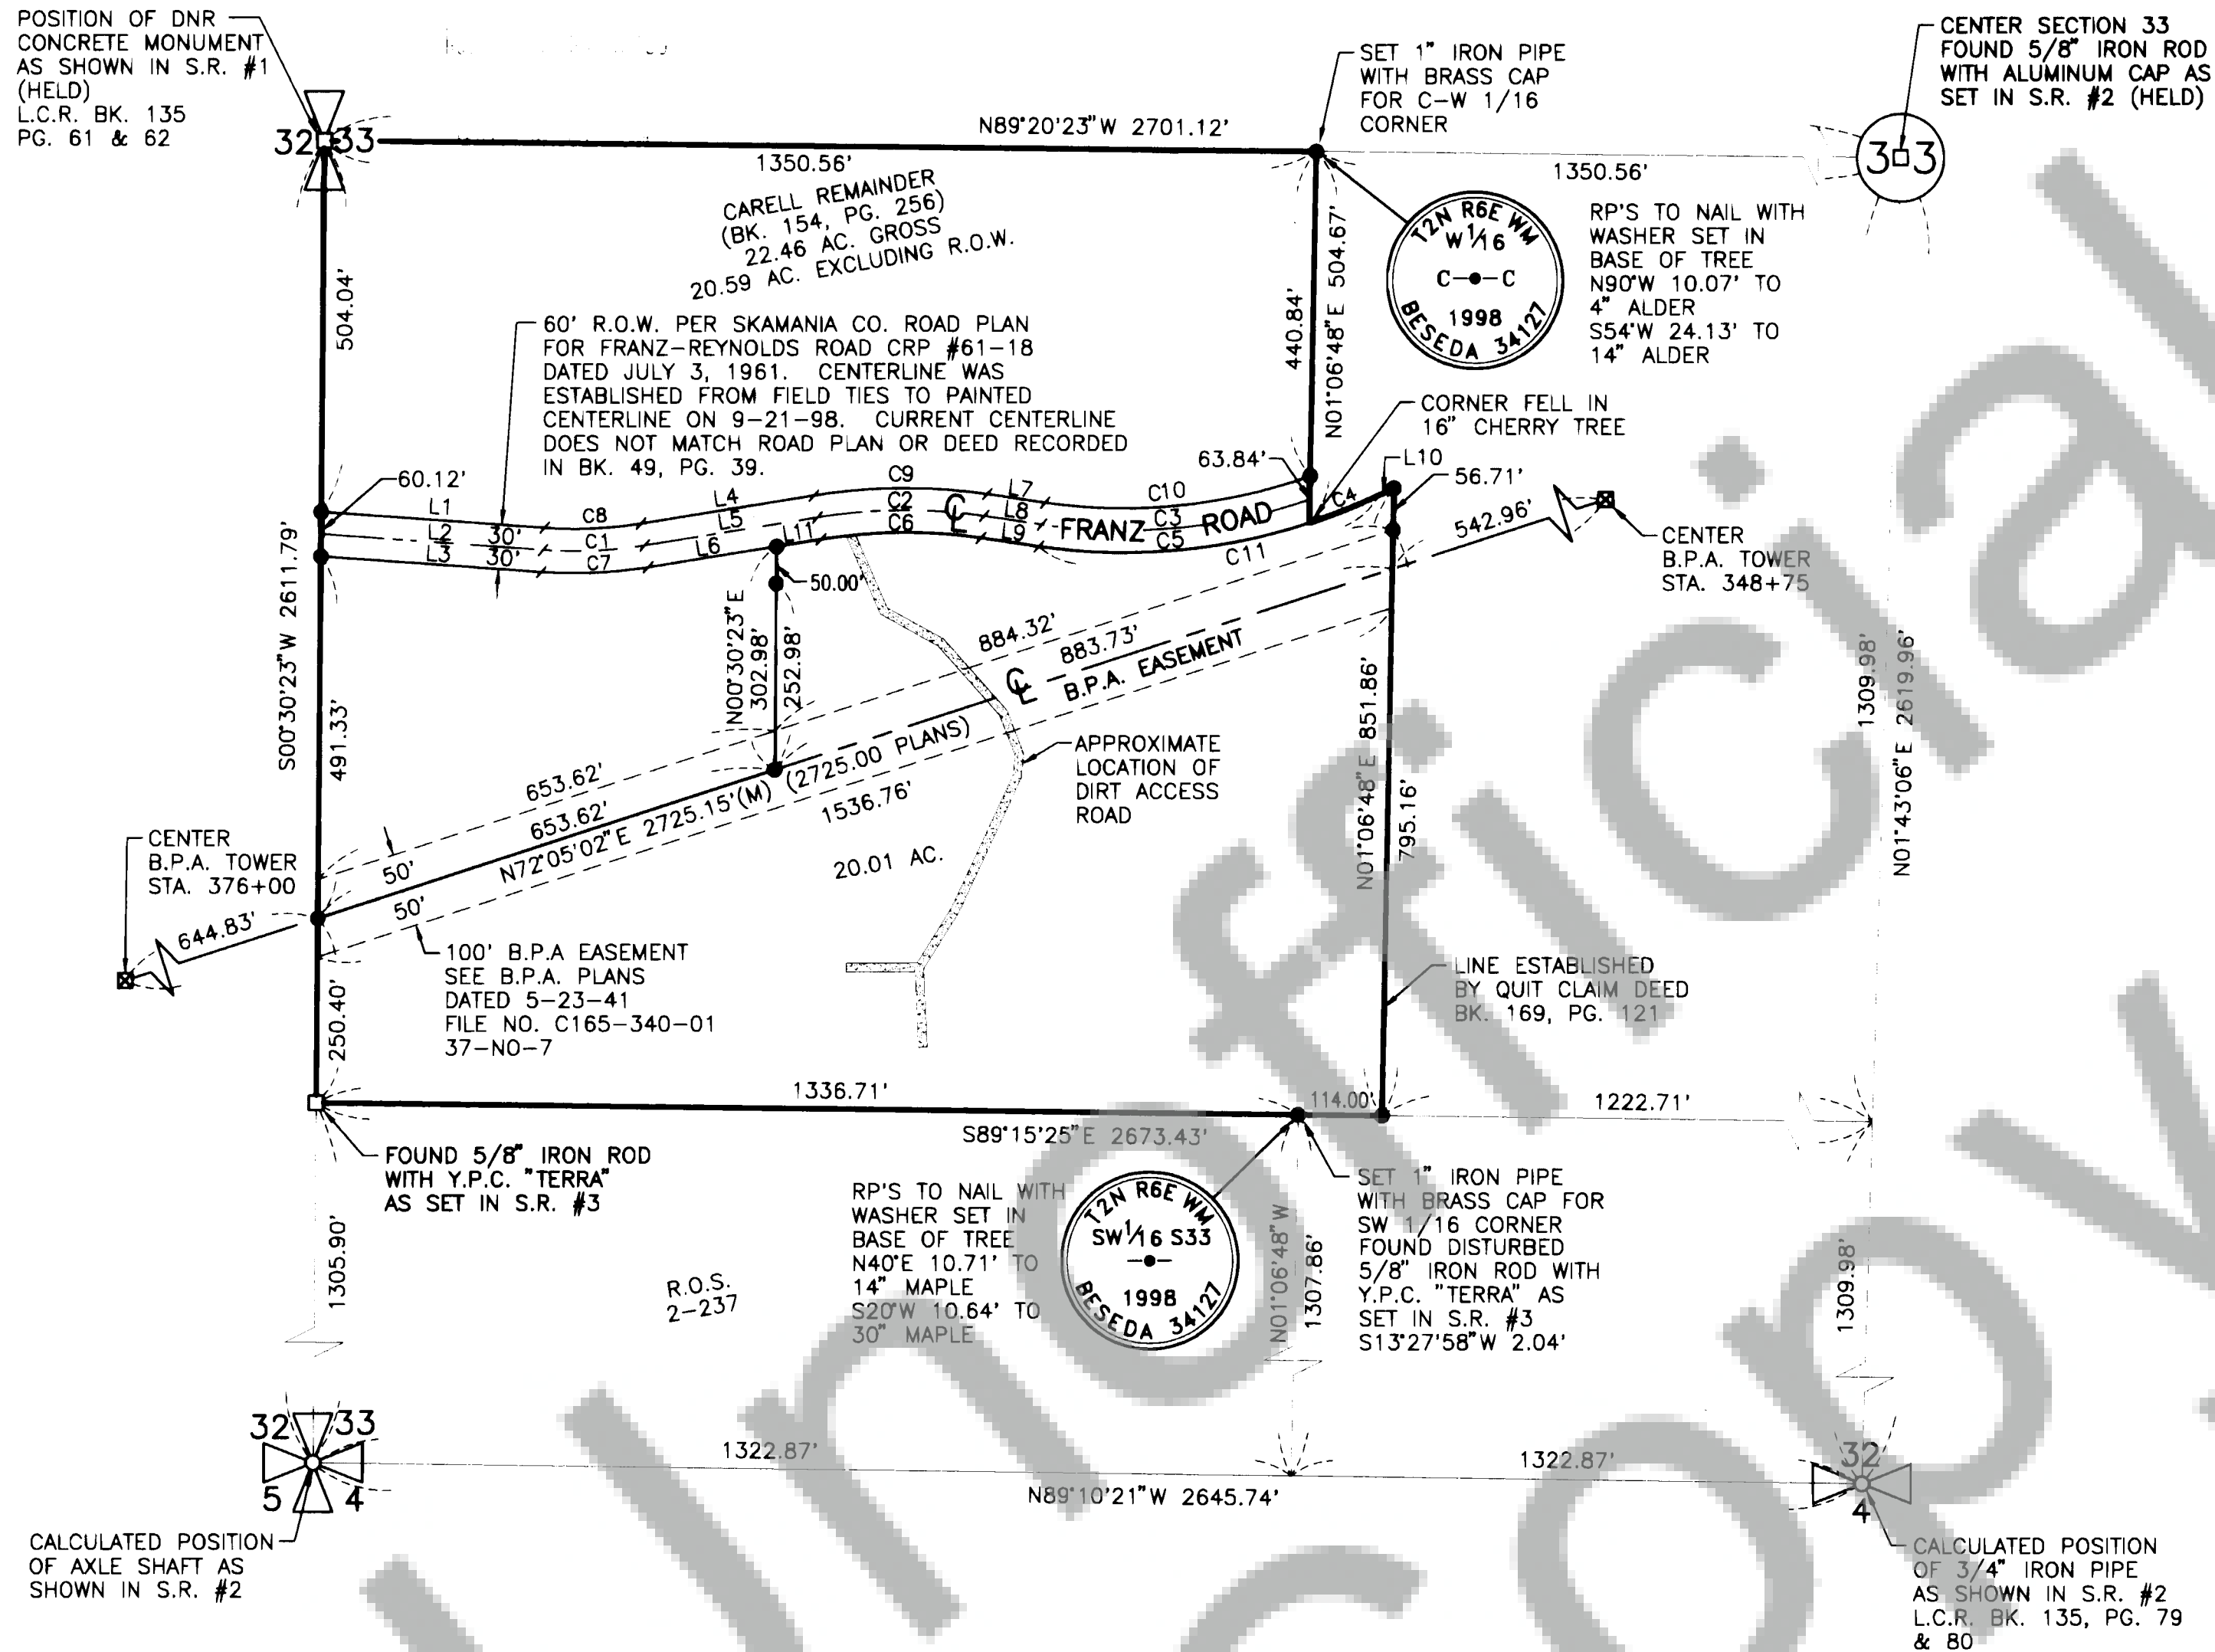

BEARINGS BASED ON UNCOVERED
CONTROL POINTS DEVELOPED IN
S.R. #1 (LAWSON)

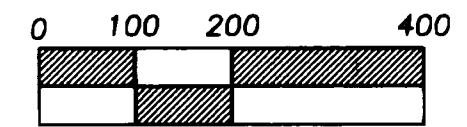

SCALE: 1" = 200'

SURVEY REFERENCE:

1. LAWSON BK. 2, PG. 144
2. MINISTER-GLAESER BK. 3, PG. 143-4
3. TERRA SURVEYING BK. 2, PG. 237

NARRATIVE:

THE PURPOSE OF THIS SURVEY IS TO CALCULATE AND MONUMENT TWO 20 ACRE TRACTS FROM THE CARELL PARCEL RECORDED UNDER BK. 154, PG. 256 AS SHOWN.

DEED REFERENCE:

BK. 154, PG. 256
BK. 169, PG. 121

LEGEND

- SET 1/2" x 24" IRON ROD WITH YELLOW PLASTIC CAP STAMPED "BESEDA 34127"
- FOUND EXISTING MONUMENT (AS NOTED)
- A.F. AUDITORS FILE
- S.R. SURVEY REFERENCE
- R.O.S. RECORD OF SURVEY
- R.O.W. RIGHT OF WAY
- Y.P.C. YELLOW PLASTIC CAP
- DNR DEVELOPMENT NATURAL RESOURCES


CURVE	CHORD BEARING	CHORD	RADIUS	DELTA	ARC
C1	N87°29'30"E	138.79'	600.00'	13°16'59"	139.10'
C2	N89°33'38"E	227.16'	750.00'	17°25'14"	228.04'
C3	N84°43'10"E	365.53'	780.00'	27°06'09"	368.96'
C4	N68°19'51"E	101.88'	810.00'	07°12'41"	101.95'
C5	S85°06'13"W	369.03'	810.00'	26°20'04"	372.29'
C6	S89°33'38"W	218.07'	720.00'	17°25'14"	218.91'
C7	S87°29'30"W	145.73'	630.00'	13°16'59"	146.05'
C8	N87°29'30"E	131.85'	570.00'	13°16'59"	132.14'
C9	N89°33'38"E	236.24'	780.00'	17°25'14"	237.16'
C10	N84°18'09"E	362.08'	750.00'	27°56'11"	365.69'
C11	N81°29'53"E	467.50'	810.00'	33°32'45"	474.24'

LINE	BEARING	DISTANCE
L1	N85°52'01"W	305.06'
L2	N85°52'01"W	303.16'
L3	N85°52'01"W	301.26'
L4	S80°51'01"W	237.31'
L5	S80°51'01"W	237.31'
L6	N80°51'05"E	176.43'
L7	N81°43'45"W	80.39'
L8	N81°43'45"W	80.39'
L9	N81°43'45"W	80.39'
L10	S64°43'30"W	22.40'
L11	N80°51'01"E	60.86'

FIELD TRAVERSE WAS PERFORMED USING A "WILD TOTAL STATION" INSTRUMENT. ADJUSTED BY COMPASS RULE PROCEDURE MEET THE MINIMUM STANDARD AS DESIGNATED IN WAC 332-130-090.

ALL CORNERS FOUND AS NOTED WERE TIED ON 9-21-98 UNLESS OTHERWISE NOTED.

INDEX GRAPH
S33-T2N-R6E

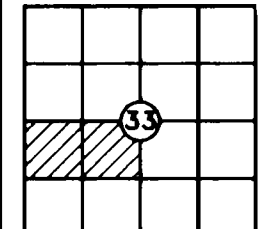

AUDITOR'S CERTIFICATE

Filed for record this 6th day of November 1998, at 11:38 A.M. in Book 3 of Surveys, at Page 288, at the request of Lawson Surveying and Engineering, Inc.


Peggy Laury
DEPUTY COUNTY AUDITOR

Date

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the survey recording act, at the request of PAUL WILLIS in OCTOBER 1998.

Carl A. Beseda 10-28-98
Carl A. Beseda, PLS Date
Washington Surveyor's License #34127

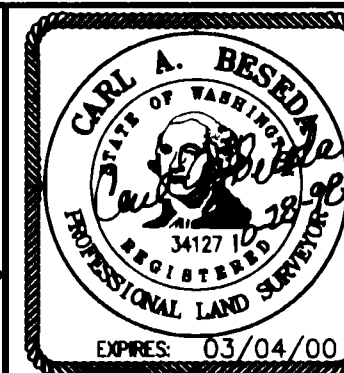

LAWSON SURVEYING & ENGINEERING, INC.
11815 NE 99th STREET, BLDG. 12, SUITE 1294
VANCOUVER, WA 98682 (360) 256-8008

CALCULATED BY:	ACB	DATE:	10/28/98	JOB NO.:	98-073
CHECKED BY:	ACB	DRAWING NAME:	98073S1		
DRAWN BY:	MDH	SHEET 1 OF 1	FILE NO.:	S330206	