

(S 89°18'54" E 5108.94' ROS 3-372, S 89°12'34" E 5150.38' ROS 3-58)
S 89°18'54" E 5108.96'

FOUND AND HELD DNR CONCRETE MONUMENT DATED 1982. SEE DNR SECTION CORNER RECORD DATED 1983 FOR SECTION 4, T2N, R6E, W.M. FOR REFERENCES.

FOUND 2" IRON PIPE WITH 3" BRASS CAP AS DEPICTED ON ROS BOOK 3, PAGE 372 S 1130.58' E 1.75' FROM CALCULATED SINGLE PROPORTION POSITION. THIS SURVEY AGREES WITH THE POSITION OF THE NE AND NW CORNERS OF SECTION 4 AND SINCE THE MONUMENT IS TOO FAR OUT OF POSITION THIS SURVEY HELD THE CALCULATED SINGLE PROPORTION POSITION.

FOUND AND HELD 3/4" IRON PIPE PER ROS BOOK 3, PAGE 58 AND BOOK 3, PAGE 372. SEE LOR BOOK 2, 6 PAGE 3, AFN 82573.

LONGVIEW
TIMBERLANDS, LLC
AFN 2007166332

LONGVIEW
TIMBERLANDS, LLC
AFN 2007166332

FOUND AND HELD 5/8" IRON REBAR WITH YPC "HAGEDORN 9579". THIS REBAR REPLACED AN AXLE WITH OBSCURE STAMPING. NO RECORD OF SAID REBAR CAN BE FOUND BUT THIS WITH POSITION CALCULATED PER ROS BOOK 3, PAGE 58, ROS BOOK 3, PAGE 8 CALCULATED ITS POSITION FROM BPA RIGHT-OF-WAY MAPS. BPA MAPS CALL FOR A DNR CONCRETE MONUMENT BUT NO SUCH MONUMENT COULD BE FOUND. THIS MAY BE THE REASON THE MONUMENT WAS FOUND AND USED BY THE BPA.

SET TYPICAL MONUMENT PER LEGEND STAMPED AS SHOWN WITH THE FOLLOWING REFERENCES:
13" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'
11" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'
11" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'
11" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'
11" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'
11" IRON PIPE Scribed C 1/4 S 81°19' E 1.70'

FOUND 2" IRON PIPE WITH 3" BRASS CAP AS DEPICTED ON ROS BOOK 3, PAGE 372 S 87°49'13" W 13.24' FROM CALCULATED SINGLE PROPORTION POSITION. THIS SURVEY AGREES WITH THE POSITION OF THE NW AND SW CORNERS OF SECTION 4 AND SINCE THE MONUMENT IS TOO FAR OUT OF POSITION THIS SURVEY HELD THE CALCULATED SINGLE PROPORTION POSITION.

WASHINGTON
DNR

FOUND AND HELD DNR CONCRETE MONUMENT. SEE ROS BOOK 3 PAGE 2 FOR REFERENCES.

FOUND 3/4" IRON PIPE WITH YPC STAMPED "S 11733" IN MOUND OF STONE PER ROS BOOK 3, PAGE 58. REFERENCES ARE AS NOTED ON SAID SURVEY.

NARRATIVE:

THE PURPOSE OF THIS SURVEY WAS TO MARK THE EAST AND NORTH LINES OF THE SW QUARTER OF SECTION 4, TOWNSHIP 2 NORTH, RANGE 6 EAST, WILLAMETTE MERIDIAN FOR LONGVIEW TIMBERLANDS, LLC FOR FUTURE TIMBER HARVEST.

FOR THIS SURVEY A TRAVERSE WAS RUN FROM THE NE CORNER OF SECTION 4 TO THE NW CORNER OF SECTION 4 AND WAS HELD FOR THE BASIS OF BEARINGS. I THEN RAN A SERIES OF CLOSED LOOP TRAVERSES TO THE EAST QUARTER OF SECTION 4, SOUTH QUARTER OF SECTION 4, SW CORNER OF SECTION 4 AND THE WEST QUARTER OF SECTION 4 ALONG LOGGING ROADS AND BPA ACCESS ROADS.

THIS SURVEY DISCOVERED A DISCREPANCY IN DISTANCE ALONG THE NORTH LINE OF SECTION 4 BETWEEN A SURVEY BY TUTTLE RECORDED IN BOOK 3 OF SURVEYS AT PAGE 58 AND A SURVEY BY FORD RECORDED IN BOOK 3 OF SURVEYS AT PAGE 372. THIS SURVEY AGREES WITH THE FORD SURVEY AND THEREFOR WAS HELD FOR THE BASIS OF BEARINGS.


THE EAST QUARTER OF SECTION 4 HAS BEEN CITED AS A DNR CONCRETE MONUMENT WITH A BRASS CAP. A THOROUGH SEARCH OF THE AREA WAS MADE AND WHAT WAS FOUND WAS A 5/8" IRON REBAR WITH A YELLOW PLASTIC CAP STAMPED "HAGEDORN 9579" WITH AN OLD AXLE LAYING ALONG SIDE WITH OBSCURE STAMPING ON IT. I WAS UNABLE TO FIND A DOCUMENT SHOWING HOW OR WHEN IT WAS ESTABLISHED BUT DOES FIT WELL WITH THE TUTTLE SURVEY IN BOOK 3 AT PAGE 58 AND THEREFOR WAS HELD.

THE WEST QUARTER CORNER OF SECTION 4 WAS ESTABLISHED BY FORD IN SURVEY BOOK 3 AT PAGE 372 AT A SINGLE PROPORTION POSITION. THIS SURVEY FOUND SAID MONUMENT TO BE S 87°49'13" W 13.24' FROM ITS CALCULATED POSITION. SINCE IT WAS TOO FAR OUT OF POSITION TO BE HELD I CALCULATED AND HELD A SINGLE PROPORTION POSITION AND CALL THE EXISTING MONUMENT OFF. NO NEW MONUMENT WAS SET FOR THE QUARTER CORNER DURING THIS SURVEY.

RECORD OF SURVEY

IN A PORTION OF THE
SE 1/4, NE 1/4 AND NW 1/4
OF THE SW 1/4 OF SECTION 4,
T2N, R6E, W. M.,
SKAMANIA COUNTY,
WASHINGTON

DATE: NOVEMBER 30, 2011

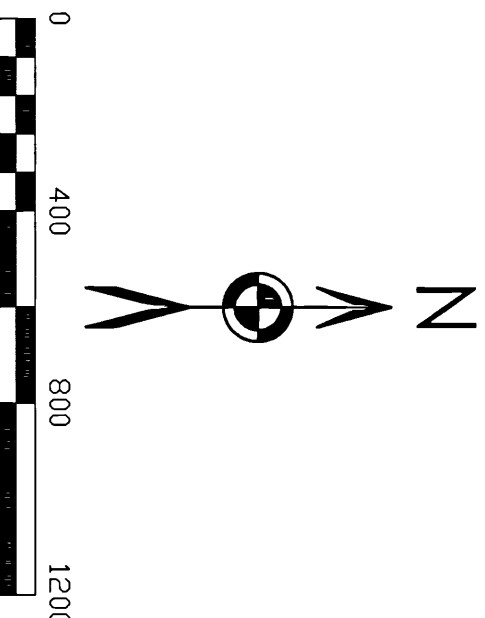


BASIS OF BEARING: S 89°18'54" E ALONG THE NORTH LINE OF SECTION 4 BETWEEN THE NE AND NW CORNERS PER ROS BOOK 3, PAGE 372.

LEGEND:

- INDICATES MONUMENT FOUND AS NOTED
- INDICATES SET 1" X 3/8" IRON PIPE WITH 2" BRASS CAP STAMPED AS SHOWN
- () INDICATES RECORD INFORMATION PER SURVEY REFERENCE NUMBER
- INDICATES LINE MARKED WITH 1/2" x 72" FIBER GLASS RODS WITH RED AND WHITE RIBBON, TREES ALONG LINE BLAZED AND PAINTED WITH BLUE PAINT.

DEED REFERENCE:
GRANTOR: LONGVIEW FIBRE COMPANY
GRANTEE: LONGVIEW TIMBERLANDS, LLC
AF NO. 2007166332

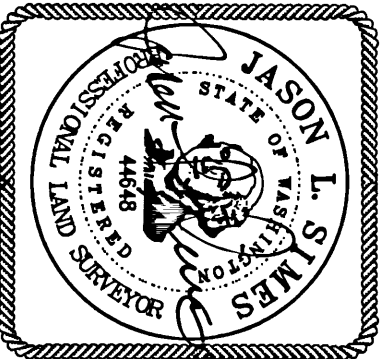

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW TIMBERLANDS, LLC IN SEPTEMBER 2011.

Jason L. Simes
JASON L. SIMES, PROFESSIONAL LAND SURVEYOR, LS# 44648

SCALE: 1"=400'
JOB NO. 2N6E4
DATE: 11-30-11
CALC BY: JLS
DRAWN BY: JLS
CHECKED BY: —
SHEET 1 OF 1

LONGVIEW TIMBER
CORPORATION
10 INTERNATIONAL WAY
LONGVIEW, WA 98632

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS 12th DAY OF December 2011 AT
1:20:02 P.M. IN BOOK 1 OF SURVEYS AT PAGE 1
AT THE REQUEST OF LONGVIEW TIMBER CORPORATION.
AF 201179644

Melina Anderson
DEPUTY COUNTY AUDITOR

LONGVIEW TIMBER CORPORATION MAKES NO WARRANTIES AS TO MATTERS OF UNWRITTEN TITLE SUCH AS ADVERSE POSSESSION, ACQUESCENCE, ESTOPPLE, ETC. A FIELD TRAVERSE WAS PERFORMED USING A NIKON NIVO 3C THREE TOTAL STATION WITH IDS ON-BOARD DATA COLLECTION SYSTEM. THE FIELD TRAVERSE MET THE MINIMUM STANDARDS FOR SURVEYS AS DESIGNATED IN WAC 332-130-090. ALL CORNERS NOTED AS FOUND WERE VISITED IN SEPTEMBER-OCTOBER 2011.