
THE PURPOSE OF THIS SURVEY WAS TO MARK THE BOUNDARY LINES SHOWN HEREON FOR LONGVIEW TIMBERLANDS LLC FOR FUTURE LOGGING PURPOSES. FOR THIS SURVEY I SET RTK GPS PAIRS NEAR THE NE CORNER OF SECTION 19 AND THE N 1/4 CORNER OF SECTION 19. I THEN RAN A TRAVERSE ALONG THE SOUTH LINE OF THE SE 1/4 OF SECTION 19. SAID TRAVERSE WAS THEN ROTATED TO MATCH RECORD BEARINGS AS SHOWN IN SR 1. THENCE NORTH ALONG THE EAST LINE OF SECTION 19 CLOSING ON SAID PAIR NEAR THE SECTION 19.

1328.34° (92.8251)



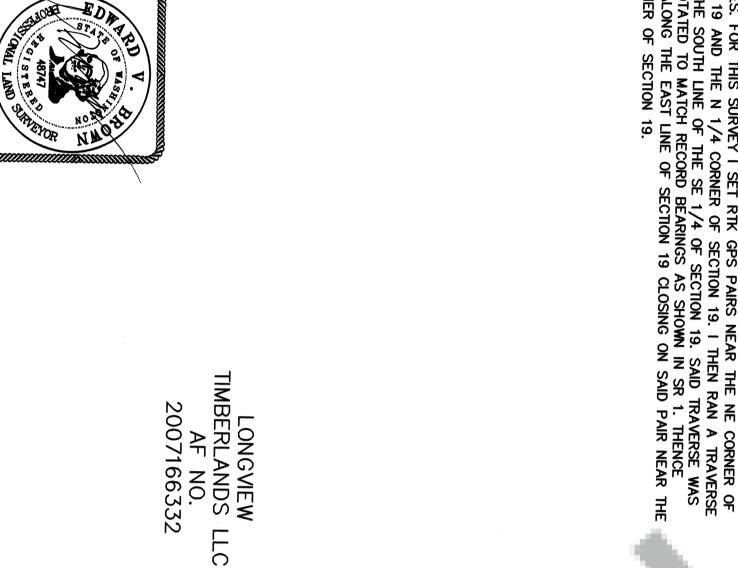

30

(2635.04') SR 1 87'41'50" W 2635.90'

9-11-13

2568.43

1 A2 ('ES.7EBS)

2 00.05,05, E

1/4 CORNER:
FOUND AND HELD DNR CONCRETE
MON AS SHOWN IN SR 1
EXISTING REFERENCES:
ROTTEN STUMP N28'E AT 26.1'
ROTTEN STUMP S37'W AT 17.8'
NEW REFERENCES:
14" FIR SCRIBED [1/4S19BT]
N70'E AT 15.40'
13" HEMLOCK SCRIBED [1/4S30BT]
SOUTH AT 16.85'

E 1/16 CORNER:
FOUND AND HELD DNR CONCRETE
MON PER J.C. OLSON 1969 CORNER
SETTING NOTE FOUND ON DNR WEBSITE
EXISTING REFERENCES:
24" STUMP N40"W AT 6.46']
NEW REFERENCES:
15" FIR SCRIBED [E1/16S19BT]
N28"W AT 6.40'
8" FIR SCRIBED [E1/16S19BT]
N64"W AT 14.05'

SE SECTION CORNER:
FOUND AND HELD DNR CONCRETE
MON AS SHOWN IN SR 1
EXISTING REFERENCES:
BASALT LEDGE N18° 3/4E AT
15 LINKS (9.9°) CHISELED X BO 20
BASALT LEDGE S47W AT
50 LINKS (33.0°) CHISELED X BO 30
BASALT LEDGE N63° 1/2W AT
24 LINKS (15.84°) CHISELED X BO 19
20° STUMP S46°E AT
42 LINKS (27.72°)

NE SECTION CORNER: FOUND AND HELD 1 1/2" PIPE WITH ALUMINUM CAP AS SHOWN IN SR 2 EXISTING REFERENCES: 23" HEMLOCK S85"W AT 1.43' 40" FIR STUMP S18"E AT 8.9' 12" HEMLOCK S81"E AT 17.6' 42" STUMP N41"W AT 33.03' 52" CEDAR STUMP N74"E 42.24' 48" STUMP S53"W 48.61' 46" FIR SNAG S10"E 8.90' SFP N50"E AT 4.8' N 1/16 CORNER: FOUND AND HELD 5/8" REBAR W/YPC AS SHOWN IN SR 1 EXISTING REFERENCES: 13" FIR STUMP S70'W AT 12.93' 33" FIR N30'E AT 26.17' NEW REFERENCE: 16" HEMLOCK S02'E AT 15.59'

05.05,01, E 5020.21,

1328,17' (1328,30') SR 1

19

∦20

1/4 CORNER:
FOUND AND HELD 1 1/2" PIPE AS SHOWN IN SR 1
EXISTING REFERENCES:
40" FIR STUMP N44W AT 25.0'
15" ALDER S20"W AT 13.41'
10" ALDER S64"E AT 6.98'
9" FIR N54"W AT 4.60'

LEGEND:

- INDICATES RECORD INFORMATION PER SURVEY REFERENCE NUMBER

INDICATES STEEL FENCE POST

DEED REFERENCE:
GRANTOR: LONGVIEW FIBRE CO.
GRANTEE: LONGVIEW TIMBERLANDS LLC.
AF NO. 2007166332

SURVEY REFERENCE:
1)BJ SHINCKE BOOK 2 PAGE 272
2)GEORGE FORD BOOK 3 PAGE 469

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW TIMBER IN JULY 2013.


El Hum 9-11-13 EDWARD V. BROWN, PROFESSIONAL LAND SURVEYOR, LS# 48747 9/03/13 1"=500' 2N6E19


LONGVIEW TIMBER
CORPORATION
10 INTERNATIONAL WAY
LONGVIEW, WA 98632

RECORD 유 SURVEY

SKAMANIA Ī SEPTEMBER 03, N., R. 6 E A COUNTY, 4 **PORTION** SECTION AND Ħ 19 유 WASHINGTON NE. .≪ 邢 _ **≤** 4

2013

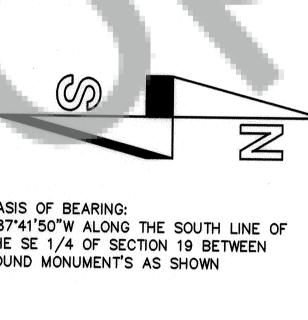

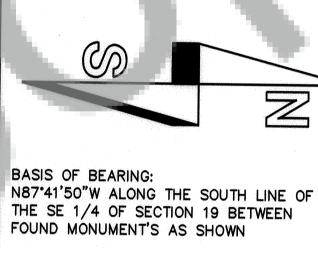

SCALE 1 INCH =

500 FEET

1000

250

INDICATES MONUMENT FOUND AS NOTED

INDICATES LINE MARKED WITH 1/2" × 72" FIBER GLASS RODS WITH RED AND WHITE RIBBON.
TREES ALONG LINE PAINTED AND BLAZED WITH BLUE PAINT.

SURVEYOR'S CERTIFICATE

DATE: 9/ CALC BY: JOB NO. SCALE: DRAWN BY: EVB RLJ

AT THE REQUEST OF LONGVIEW TIMBER CORPORATION. AF 2013002055

Melling Anderson DEPUTY COUNTY AUDITOR

CHECKED BY: EVB

FILED FOR RECORD THIS

AUDITOR'S

CERTIFIC

ATE

DAY OF September

/3 AT

A FIELD TRAVERSE WAS PERFORMED USING A NIKON NIVO 3.0C THREE SECOND TOTAL STATION WITH TDS DATA COLLECTION SYSTEM. THE FIELD TRAVERSE MET THE MINIMUM STANDARDS FOR SURVEYS AS DESIGNATED IN WAC 332-130-090. ALL CORNERS NOTED AS FOUND WERE VISITED ON 07-30-2013.

LONGVIEW TIMBER CORPORATION MAKES NO WARRANTIES AS TO MATTERS OF UNWRITTEN TITLE SUCH AS ADVERSE POSSESSION, ACQUIESCENCE, ESTOPPLE, ETC.

NOTE: ALL NEW REFERENCES HAVE WERE MEASURED TO A NAIL AT SIDE CENTER WITH A LOGGERS TAPE. ALL BEARINGS WERE TAKEN WITH A HAND COMPASS WITH THE DECLINATION SET AT 21°E.