A DEPENDENT SURVEY of a portion of land owned by Weyerhaeuser Columbia Timberlands (aka. Longview Timberlands, LLC) being located within the N.I/2 of SECTION 25, T2N R5E, W.M. as situated within SKAMANIA COUNTY, WASHINGTON

## BASIS OF BEARING The West line of the NW.1/4 of Section 25, T2N R5E as previously recorded (See SR-I)

SECTION COR. Fd. DNR aluminum mon. w/3-1/4" stamped aluminum cap as previously E.I/16 COR. recorded (see SR's 1,4,5). Also found Fd. 3/4" IP w/stamped I-I/2" IP w/DOF stamped brass cap, plumber's cap as previously N37°04'16"E--16.88' (not accepted) and 1/4 COR. recorded (see SR 3). Tied a 3/4" IP, N7°15'08"W--5.49' (not Fd. 3/4" IP w/stamped 10/23/2015. accepted). Tied II/02/2015 plumber's cap (accepted for corner - history unknown). Tied 10/23/2015. (\$89°31'24"E-2683.64" BK.3 PG.202) (\$89°31'24"E-2683.64' BK.3 PG.202) S.23 \$.24 (\$89°31'52"E-2683.64" AF 2013001459) 5.24 S 89°33'25" E - 2684.08' S89°33'44"E-1342.08" S89°34'36"E-1341.17 S.26 S.25 S.30 (1341.82' AF 2013001459) (1341.82' AF 2013001459) (1341.31' SP V.3 PG.22) LONGVIEW TIMBERLANDS LLC NW.I/I6 COR. Fd. 3/4" IP w/stamped plumber's cap (accepted for corner - history unknown). (\$89°28'42"E-1318.91" AF 2013001459) Tied 11/17/2015. S 89°28'II" E - 1331.51' S 89°30'28" E - 1318.83' NE.I/16 COR. C-N.I/16 COR. Fd. 3/4" IP w/stampe Fd. 3/4" IP w/stamped plumber's cap as plumber's cap (accepted for previously recorded corner - history unknown). (see SR 3). Tied 10/23/2015. Tied 10/21/2015. I) A 2001 survey by Jason Simes, LS-44648, recorded under afn-2011/78318 2) A 1981 short plat by Truman Price, PE-4408, recorded in bk. 3-pg. 22 S 89°25'03" E 3) A 2013 survey by Jason Simes, LS-44648, recorded under afn-2013001459 4) A 1995 survey by David Simes, LS-341454, recorded in bk. 3-pg. 202


SECTION COR. Fd. 4"x4" concrete mon. w/3" stamped DNR brass cap as previously recorded (see SR's 3,4,5). Tied 10/22/2015.


## SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act of 1973, at the request of Rob Johnson , in August , 2015 .

Phillip R. Gustin PLS Certificate no. 37,529

Date signed: /-/2-20/6

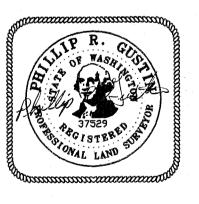



1/4 COR.

11/17/2015.

Fd. 1/2" rebar w/3-1/4"

Jan 20, 2016 - 5:00pm Ci\Carlson Projects\600 JOBS\15-636\15-636.dwg

stamped DNR aluminum

cap as previously recorded (see LCR filed under AFN-2014002325 and SR's 1,4). Tied

1320.91

**LEGEND** = A corner FOUND or established during a previous survey, as described

= A corner calculated only--not set this survey

= A Bearing and/or Distance of record = An Iron Pipe

C-W.I/16 COR.

plumber's cap

11/20/2015.

Fd. 3/4" IP w/stamped

(accepted for corner -

history unknown). Tied

SR = A reference to a survey recorded in Skamania County, WA

DOF = Washington State Dept. of Fisheries

DNR = Washington State Dept. of Natural Resources = A line marked during this survey with 12" x 72" white fiberglass rods, painted blazes and flagging

## AUDITOR'S CERTIFICATE AF # 2016000222

Filed for record this 2nd day of February , 2010 at 8:50 A.M., in BOOK of SURVEYS, at

PAGE \_\_\_\_\_\_, at the request of HAMPSTUR CORPORATION.

Robert Waymire COUNTY AUDITOR


5) A 1985 survey by the DNR, recorded in bk. 2-pg. 232

read 03"). The relative accuracy of this control exceeds 1:10,000.

6) This survey was conducted by means of a closed traverse between existing corners and/or prior control, using a "LEICA TCI203" TOTAL STATION (least

DEPUTY AUDITOR

## HAMPSTUR CORPORATION

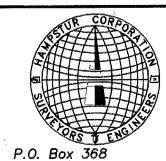

Kelso, Washington 98626 Phone: (360) 423-8166

Calculated by : CJH/PRG Checked by : PRG/CJH Drawn by : TLG Completion date: 1/12/2016 Field Book no.: PS-15-636 Drawing No. : 15-636.DWG HAMPSTUR JOB no. :

Sheet no. \_\_\_\_ of \_\_\_\_