



UNITED STATES OF AMERICA PARCEL 03092700030000


SURVEY


DRANO CADASTRAL SURVEY TASK ORDER
COLUMBIA RIVER GORGE NATIONAL SCENIC AREA
GIFFORD PINCHOT NATIONAL FOREST
SE & SW 1/4 OF SECTIONS 27 & NE & NW 1/4 OF SECTION 34
T. 3 N., R. 9 E., W.M.
SKAMANIA COUNTY, WASHINGTON

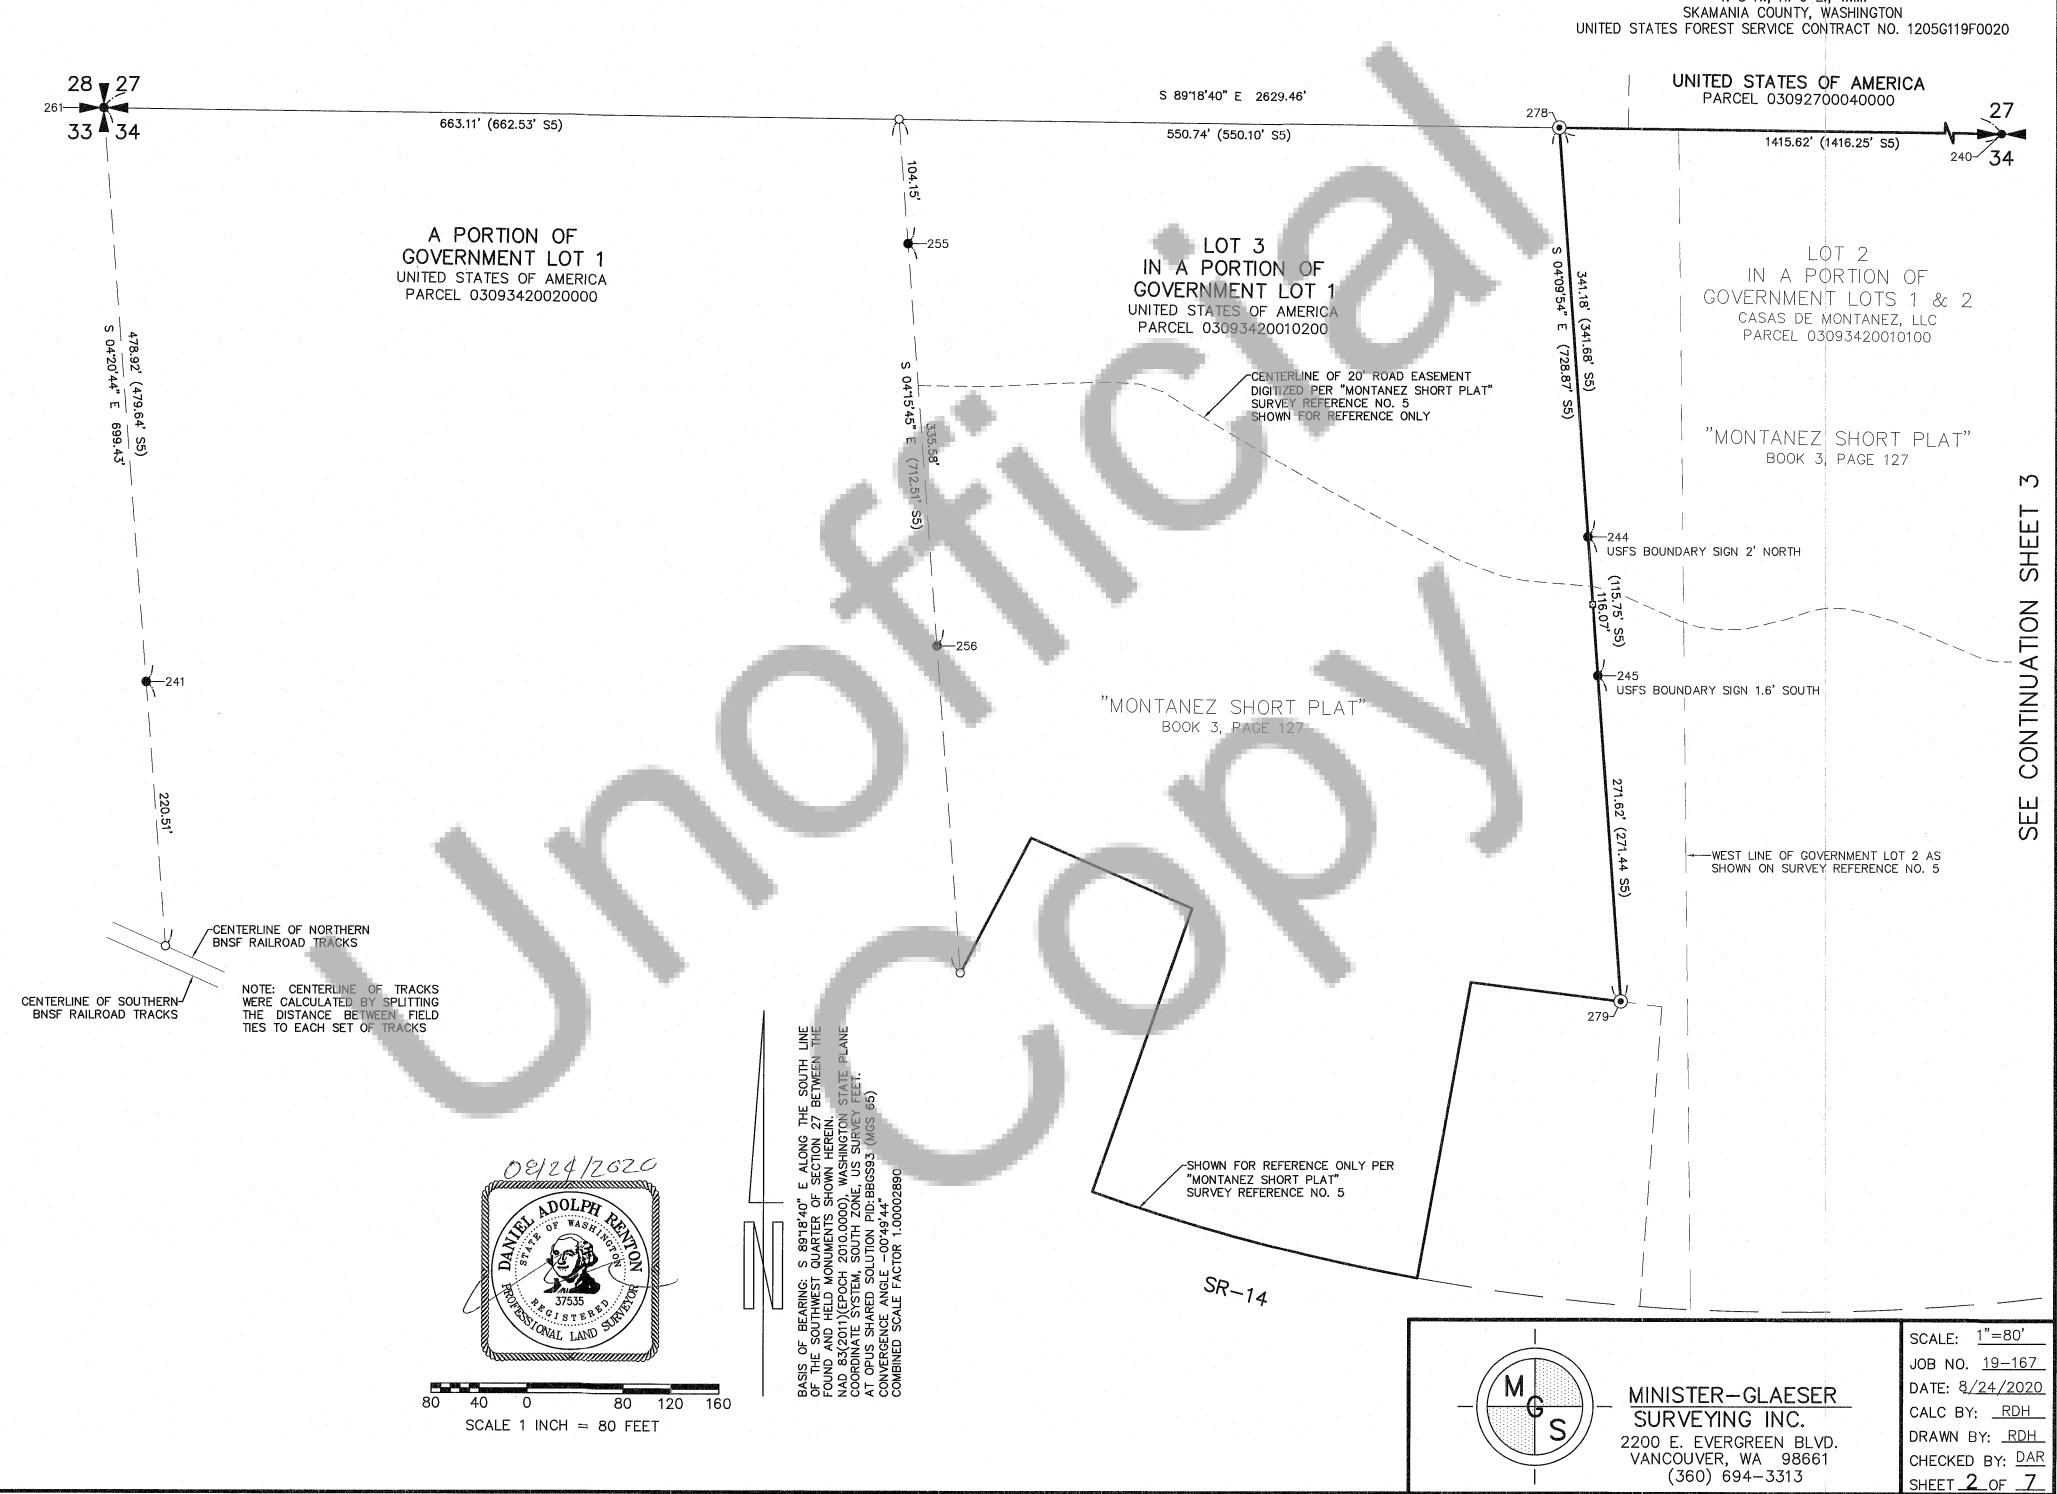

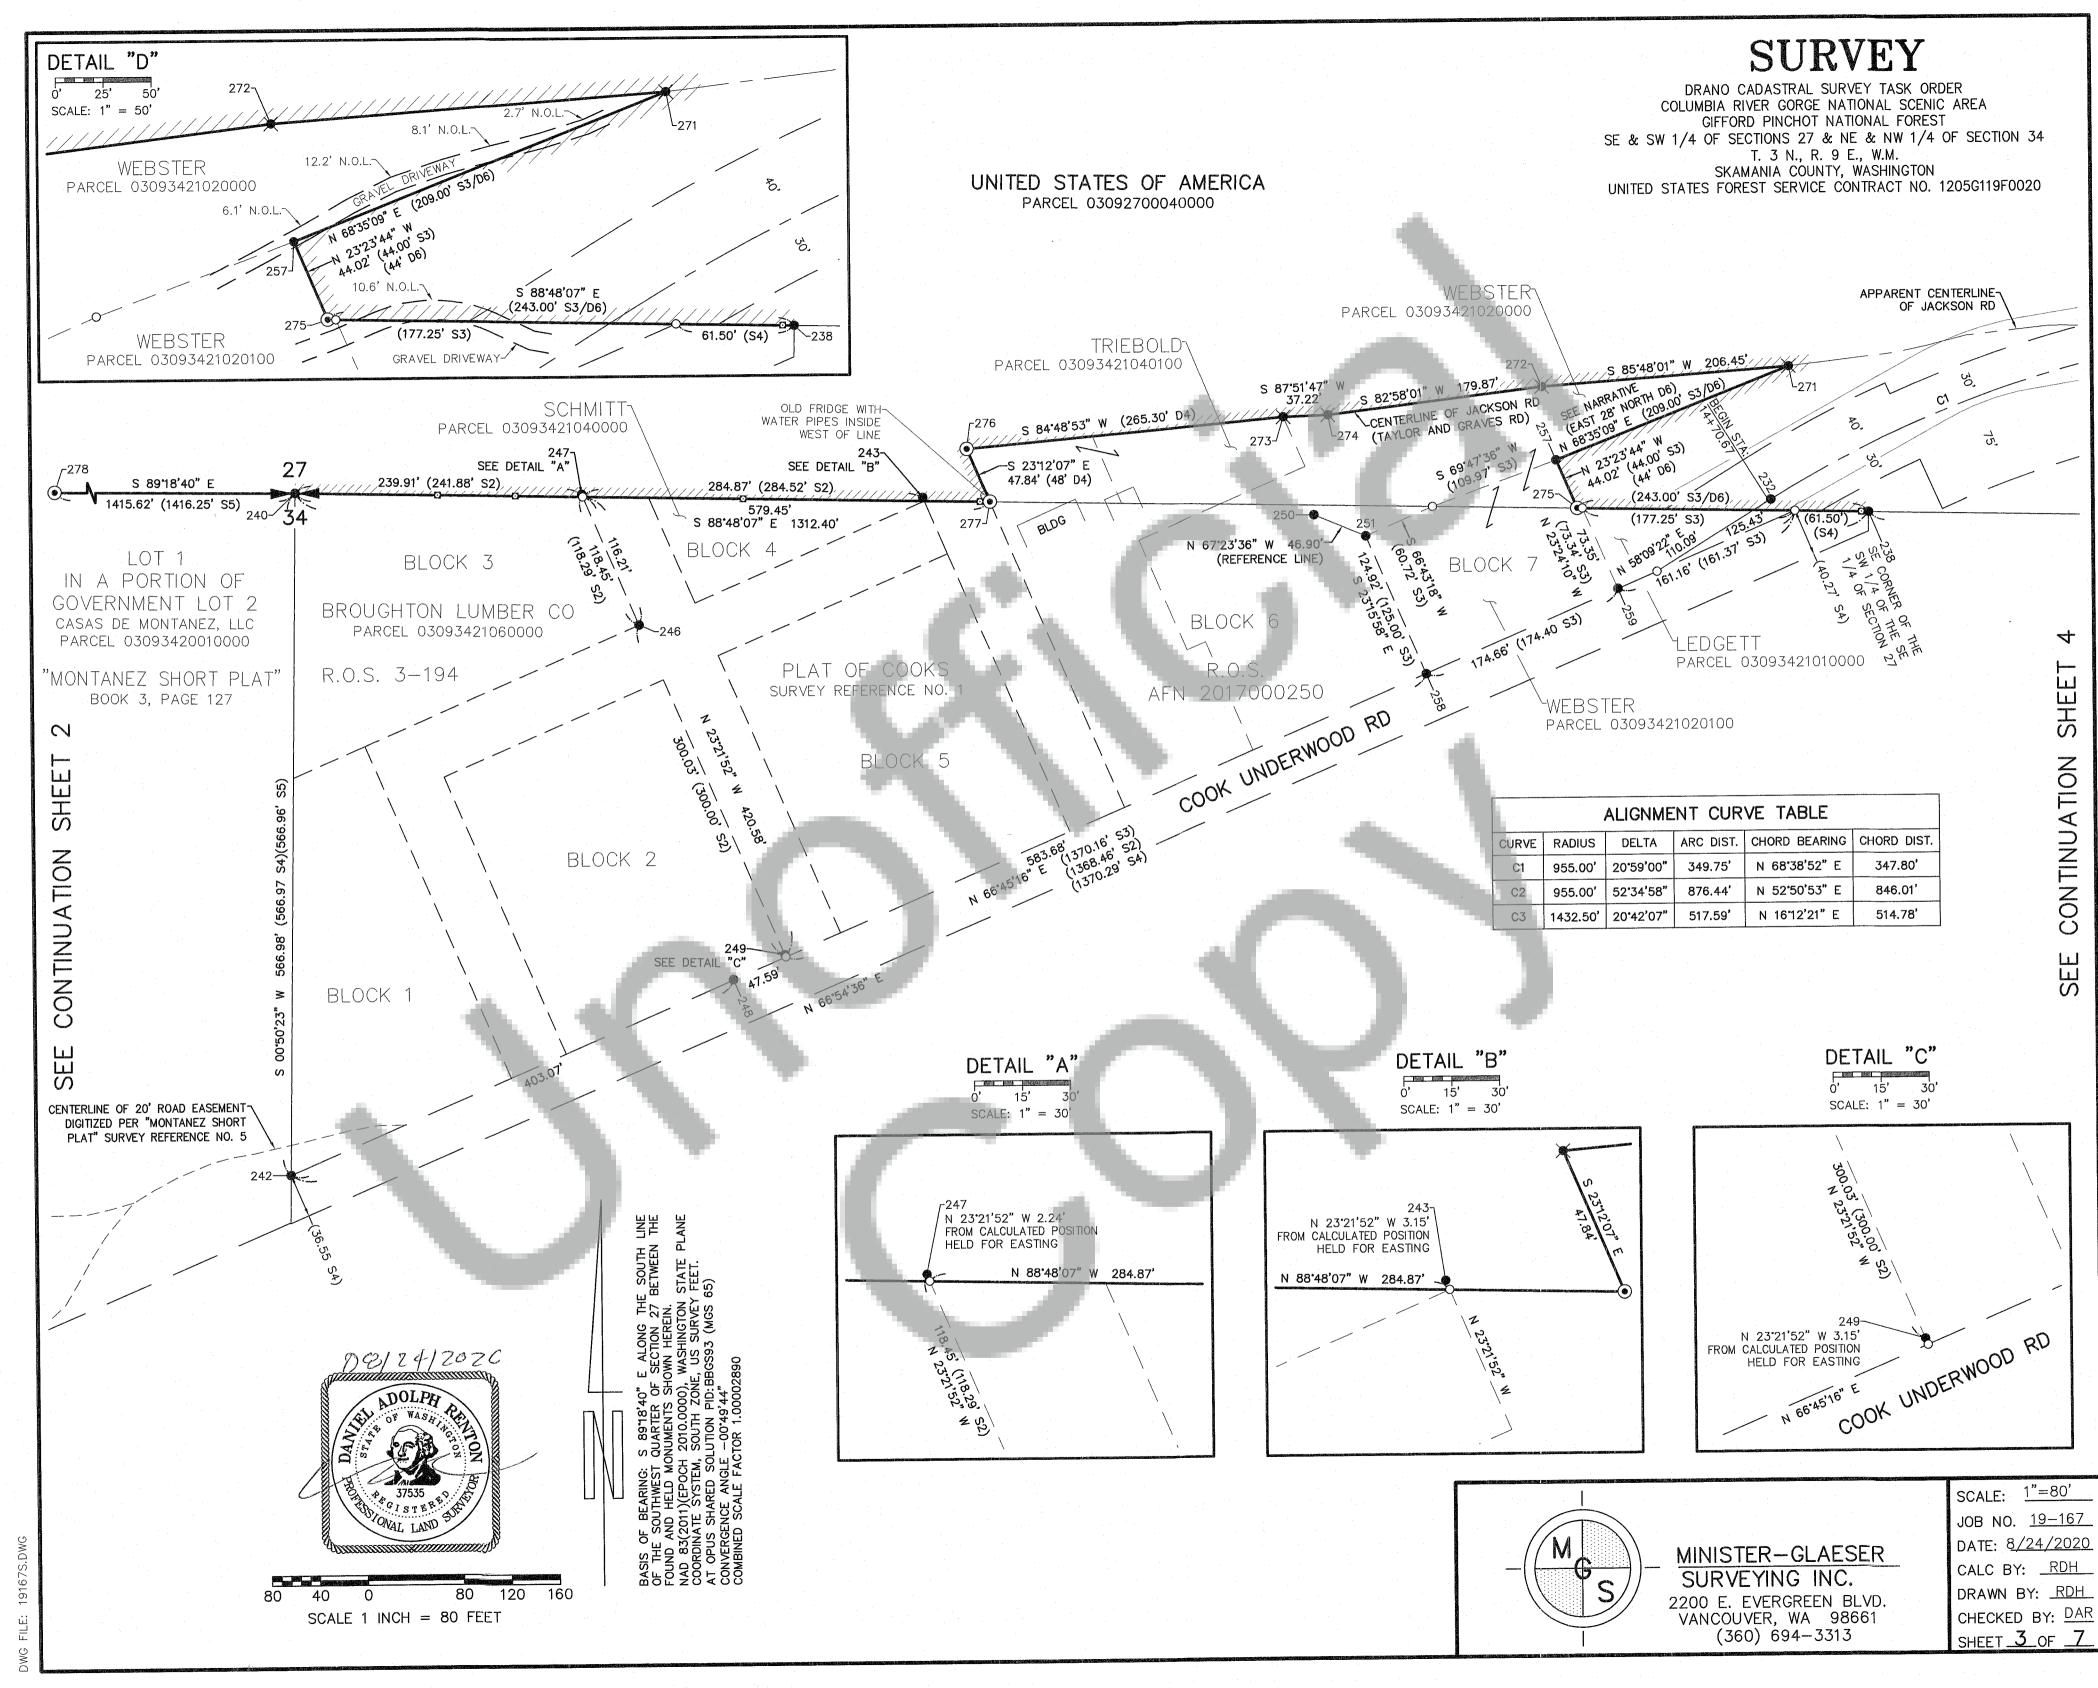

The state of the s

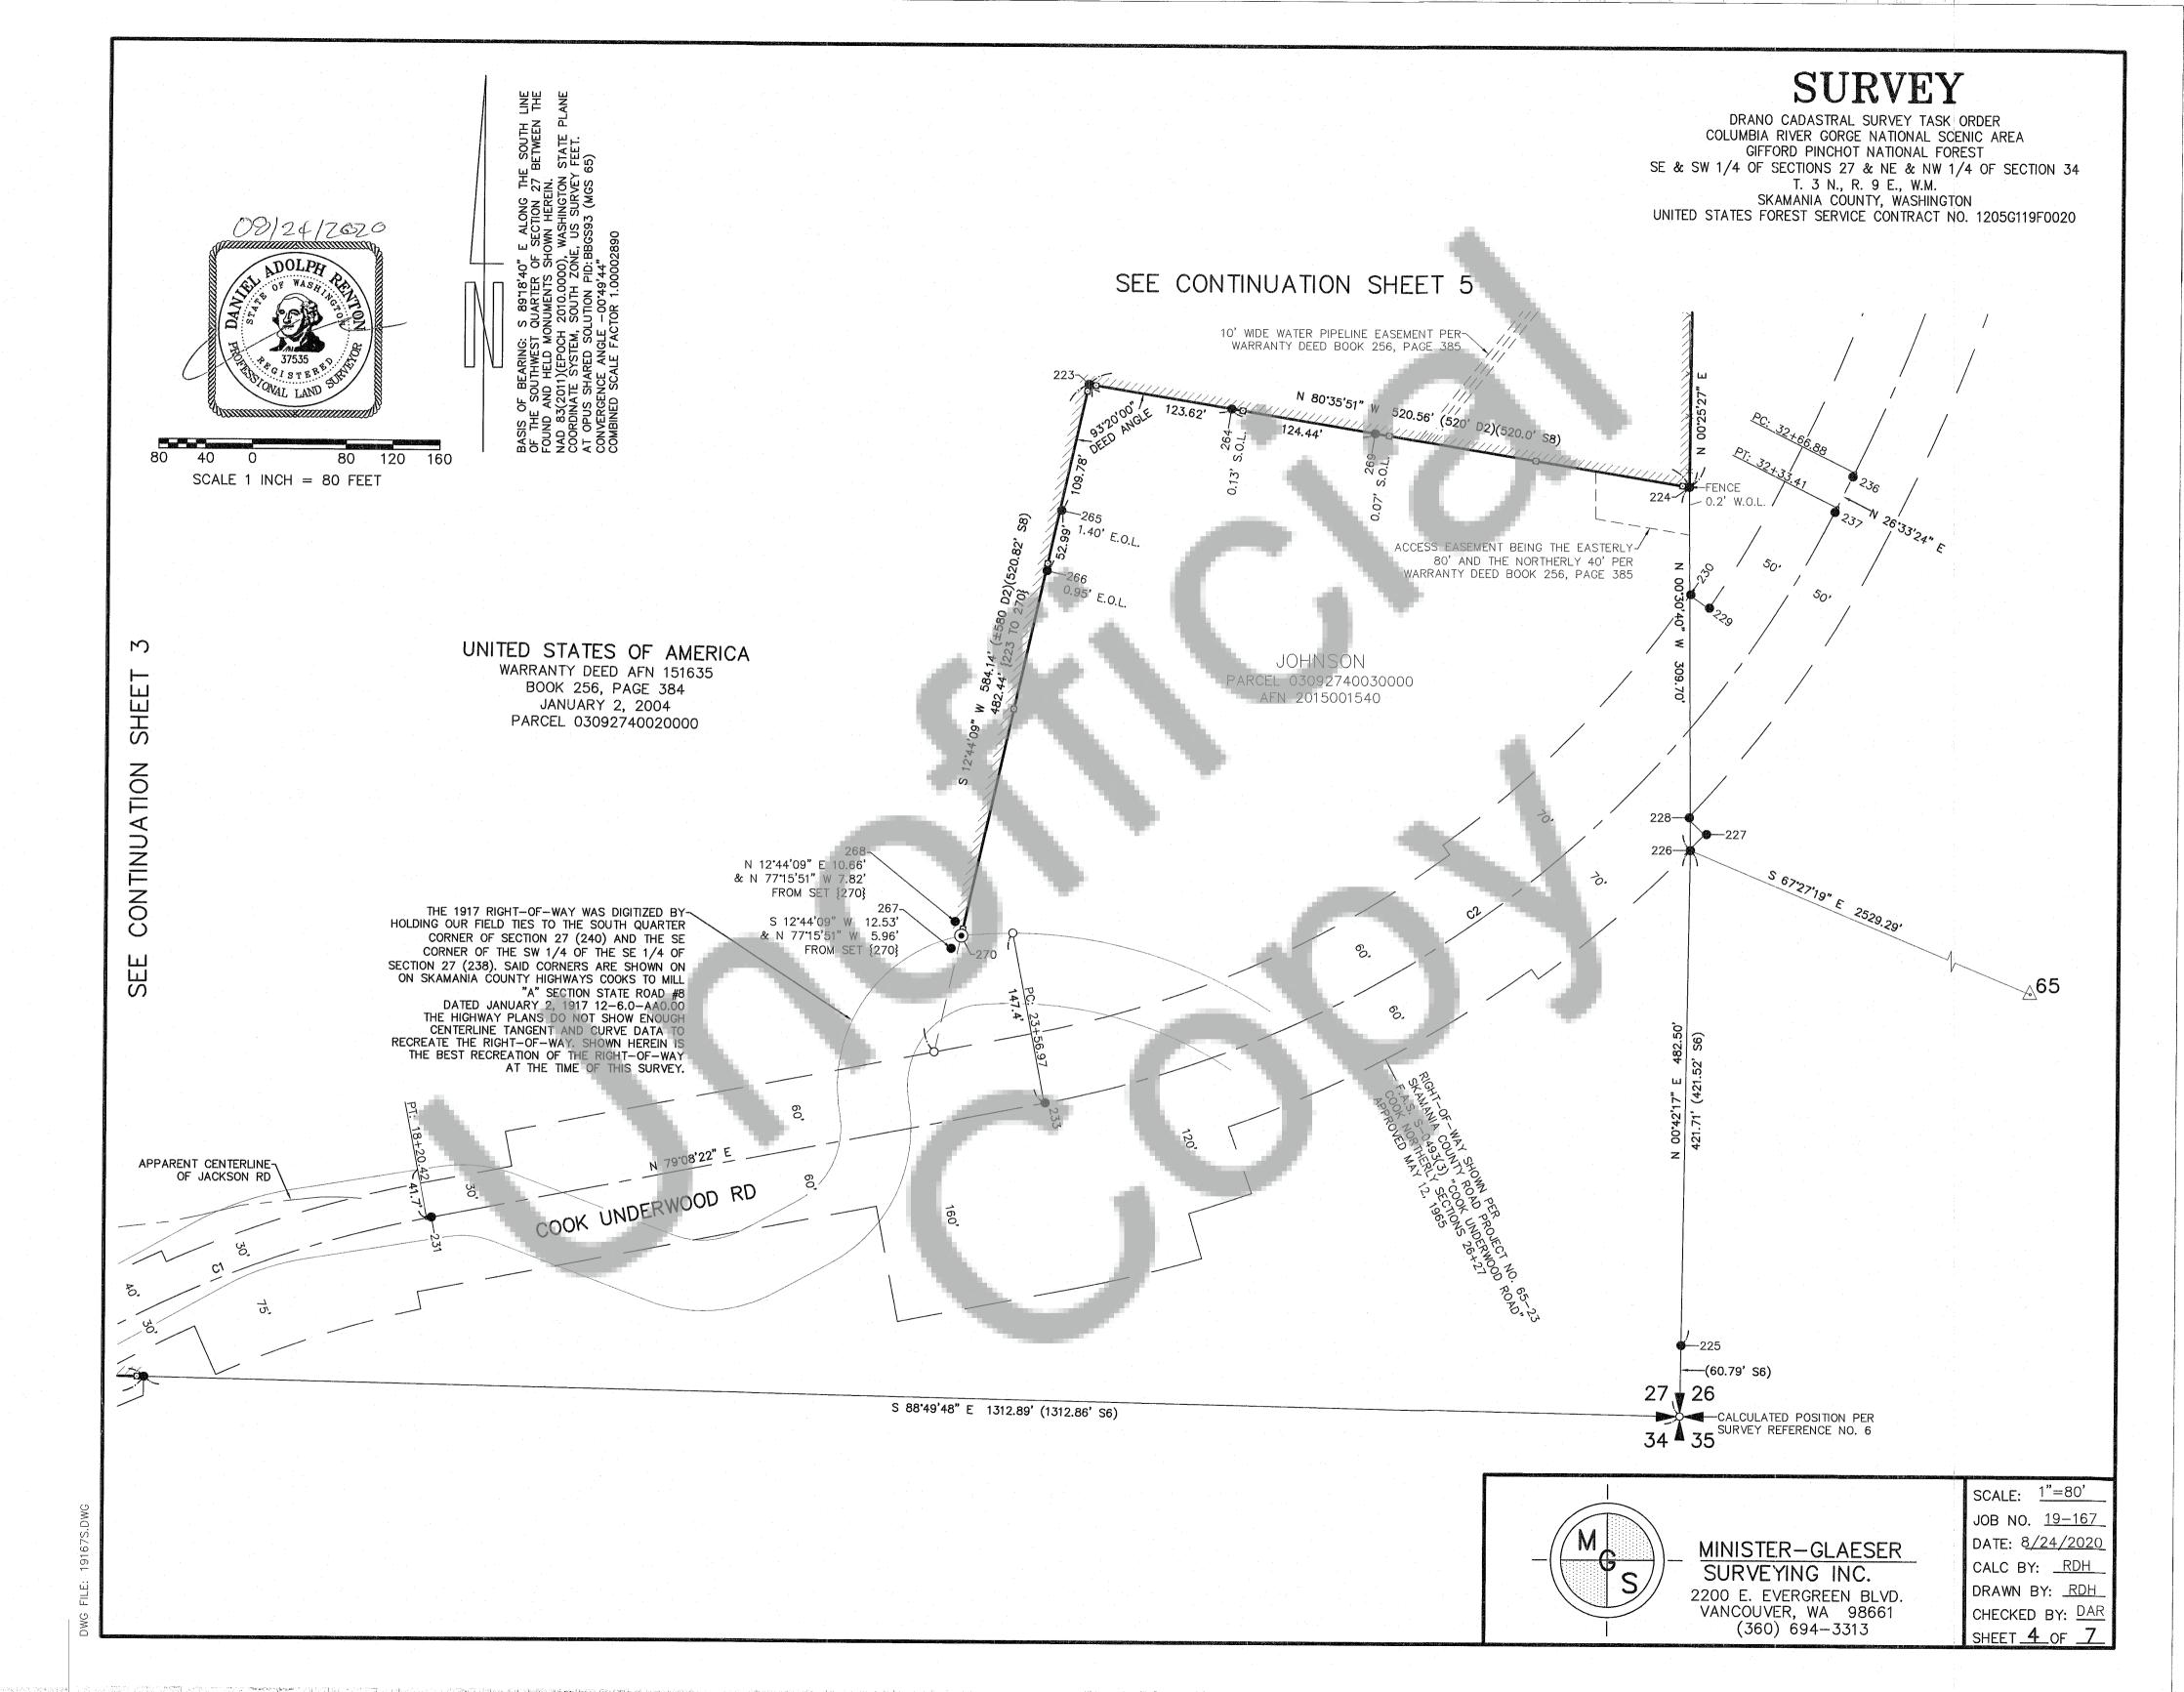

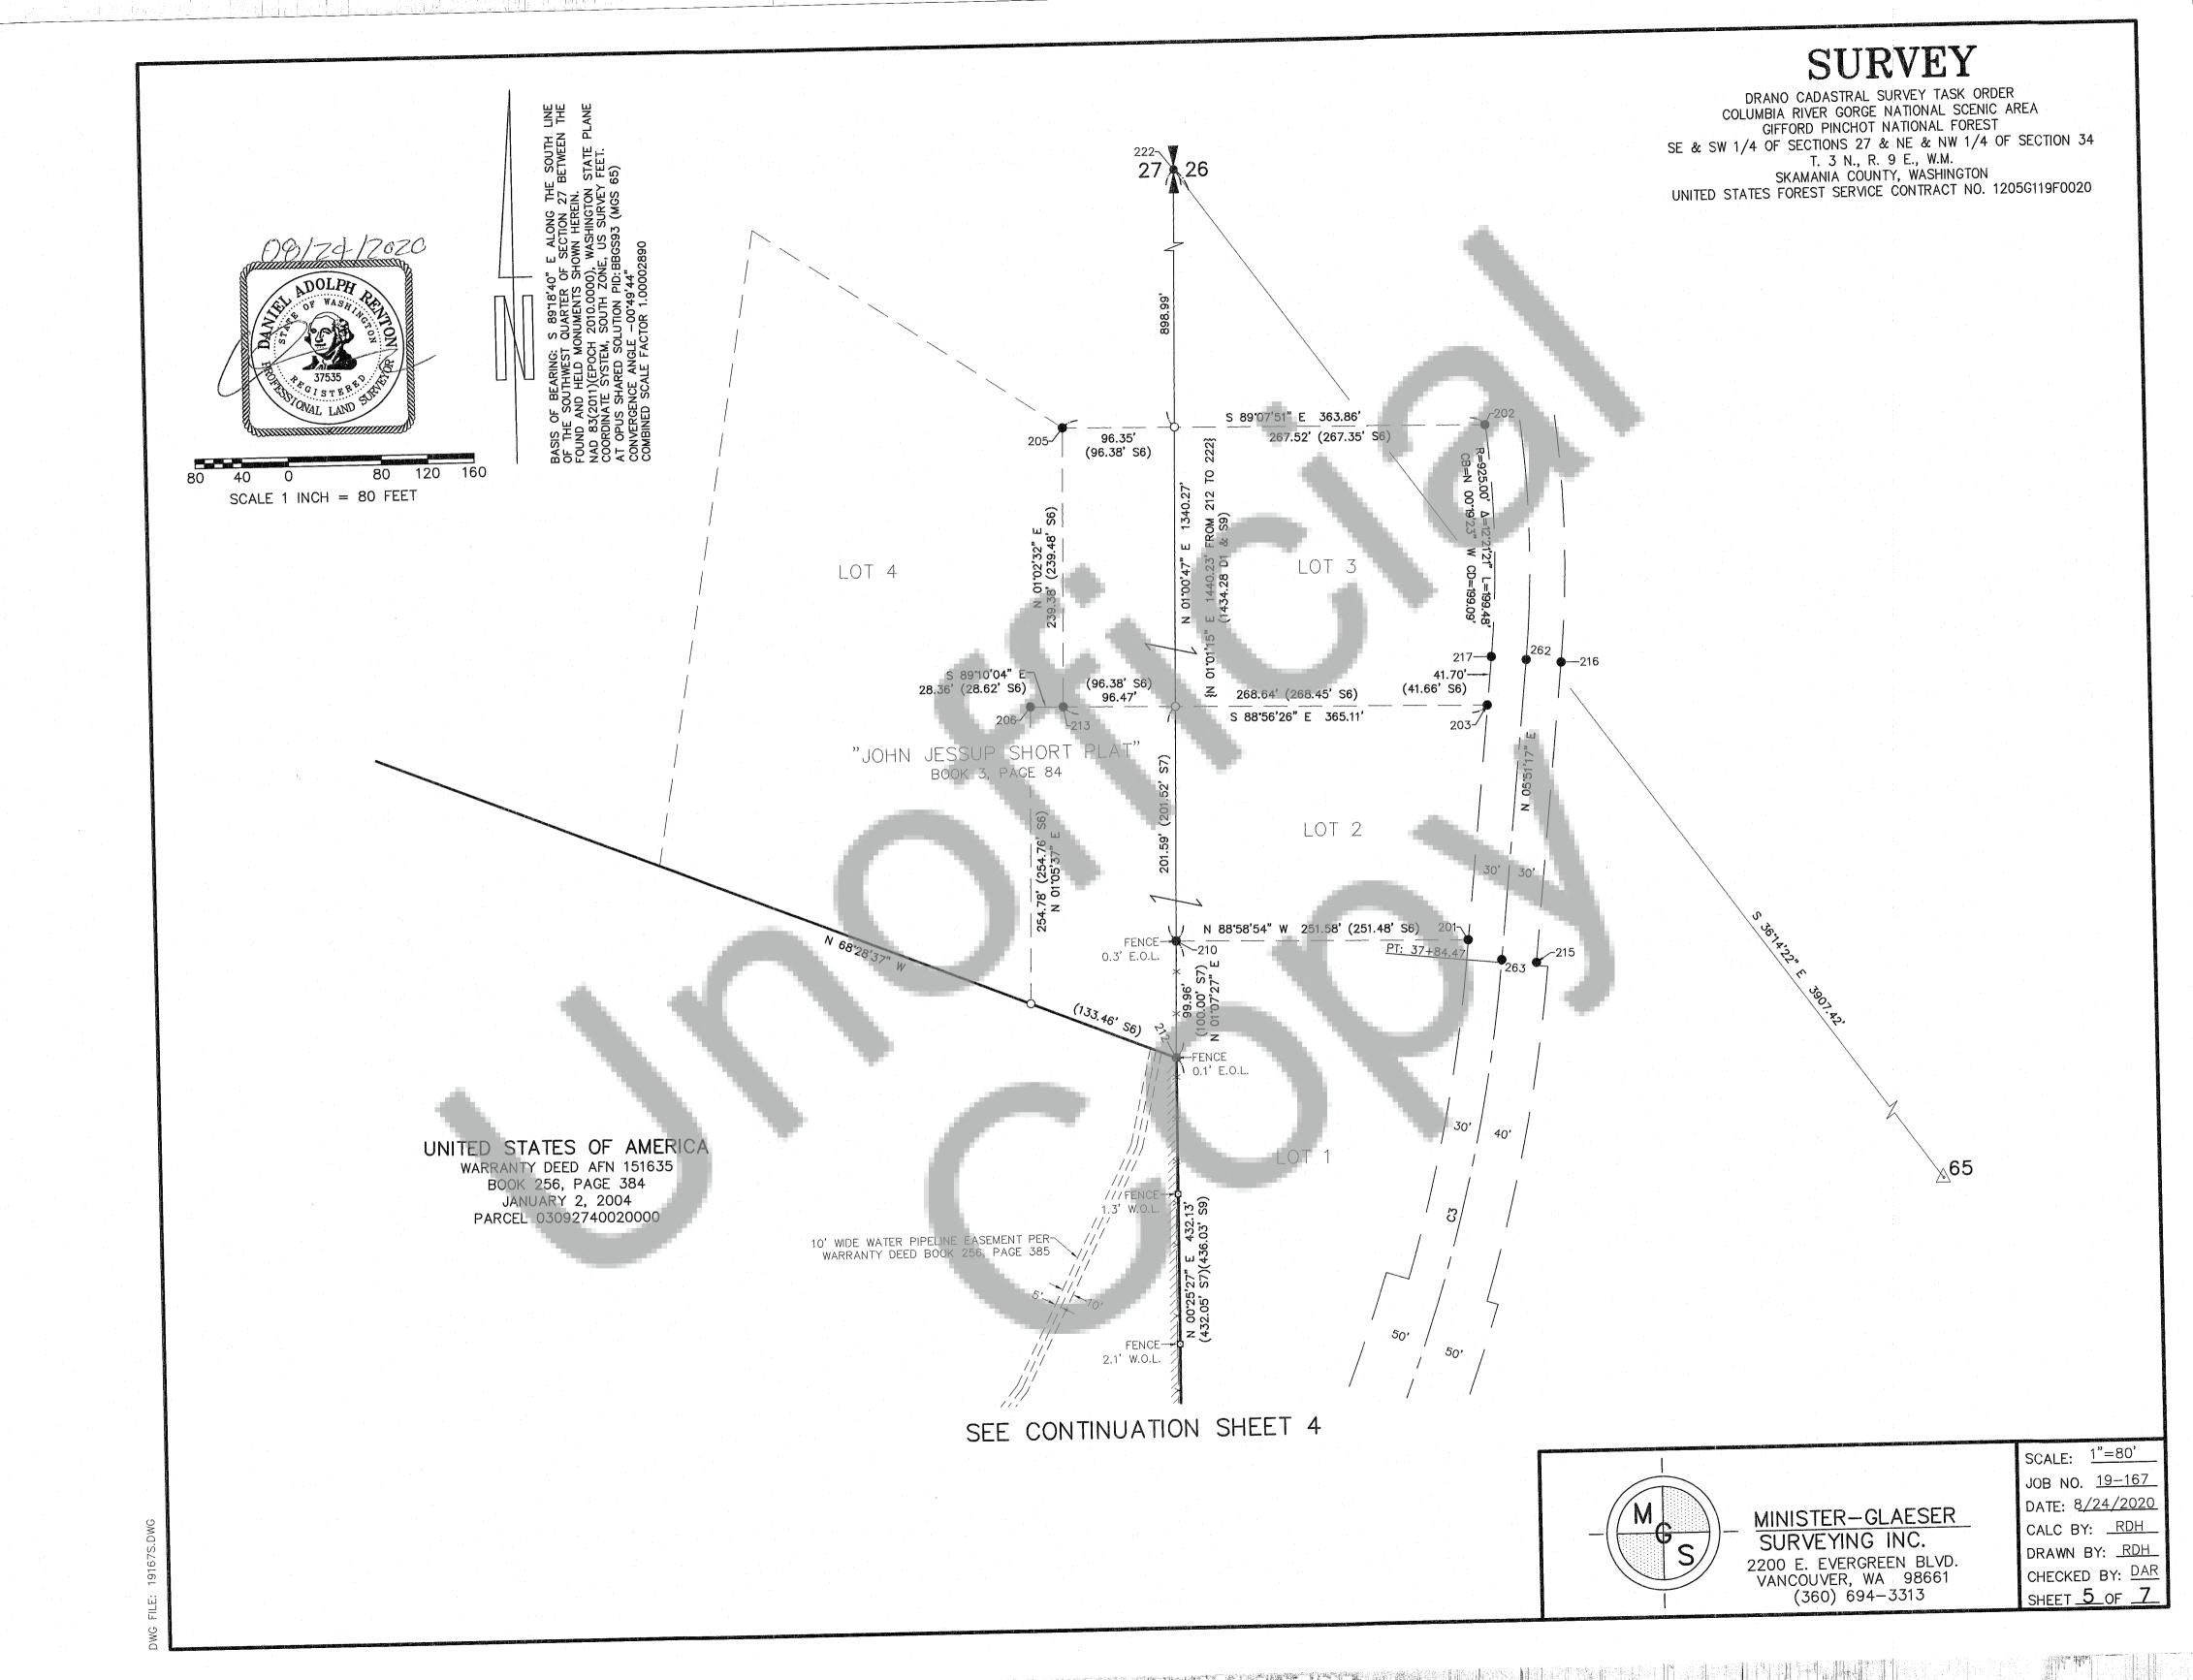

202=SURVEY REFERENCE NO. 7

FOUND 1/2" IRON ROD WITH YELLOW PLASTIC CAP "GLAESER 15024" IN FAIR CONDITION, FLUSH WITH GROUND. N 89'07'51" W 0.34' FROM CALCULATED POSITION, HELD FOR NORTHING. STA= N/A LT=30.34' FROM CALCULATED CENTERLINE

203=SURVEY REFERENCE NO. 7

FOUND 1/2" IRON ROD WITH NO CAP IN GOOD CONDITION, FLUSH IN GROUND. N 88'56'26" W 0.28' FROM CALCULATED POSITION, HELD FOR NORTHING. STA=40+03.73 LT=30.28'

205=SURVEY REFERENCE NO. 7

FOUND 1/2" IRON ROD IN GOOD CONDITION WITH NO CAP, 0.1' ABOVE GROUND, HELD.

206=SURVEY REFERENCE NO. 7

FOUND 1/2" IRON ROD IN GOOD CONDITION WITH YELLOW PLASTIC CAP "GLAESER 15024", 0.1' ABOVE GROUND, HELD.

210= SURVEY REFERENCE NO. 7

FOUND MAG NAIL DRILLED DIAGONALLY IN ROCK IN GOOD CONDITION, 0.25' NORTHWEST OF FENCE CORNER, HELD.

212= SURVEY REFERENCE NO. 7

FOUND 5/8" IRON ROD SET IN 0.5' DIAMETER CONCRETE BLOCK WITH T-POST, TOP OF PIPE 0.9 FT ABOVÉ CONCRETE, HELD.

ESTABLISHED THE FOLLOWING:

SET 12" CHESTNUT WHICH BEARS S53'W, 42.9 FT MRKD "LOT 2 JJSP BT" ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS.

213= SURVEY REFERENCE NO. 7

FOUND 1/2" IRON ROD IN GOOD CONDITION WITH YELLOW PLASTIC CAP "GLAESER 15024" FLUSH WITH GROUND, HELD

215=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST IN GOOD CONDITION, 1.5' ABOVE GROUND AND STANDING STRAIGHT, TIED AT TOP CENTER. (BEARS S 8419'48" E 30.00' FROM FOUND NO. 263) STA=37+87.07 RT=30.00'

216=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST IN POOR CONDITION, 1.2' ABOVE GROUND WITH TOP BROKEN OFF TIED AT APPROXIMATE CENTER. (BEARS S 84'37'46" E 30.00' FROM FOUND NO. 262) STA=40+45.70 RT=30.00'

217=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST IN FAIR CONDITION, 2.1' ABOVE GROUND, LEANING SOUTH. (BEARS N 83'56'17" W 30.18' FROM FOUND NO. 262) STA=40+45.56 LT=30.18'

222=SURVEY REFERENCE NO. 6 AND NO. 7 (NO RECORD L.C.R. FOUND)

1875- GLO MARKED AN 8" FIR FOR THE 1/4 SECTION CORNER FROM WHICH BEARS: AN 8" FIR BEARS S55 W, 19 LKS

A 6" MAPLE BEARS N70°E, 18 LKS 1966- USDA FOREST SERVICE CORNER CARD T-17 SECTION 27, T. 3 N., R. 9 E., W.M. AALVIK & GARWOOD FOUND BRASS U.S.E. MONUMENT MARKING SAID EAST 1/4 CORNER SET IRON FENCE POST WITH TAG 2.3 FT NORTH OF MONUMENT

1987- USFWS FOUND BRASS CAP ON IRON POST FROM WHICH: A 22" MAPLE BEARS N70°E, 12.5 FT WITH HEALED FACE

A 24" DOUG FIR BEARS S22'W, 22.9 FT, MRKD "1/4 S27 BT" 2020- FOUND AND HELD 3-1/2" BRASS CAP FIXED TO PIPE IN GOOD CONDITION, TOP 0.2 FT ABOVE MOUND OF STONE FROM WHICH BEARS:

A 2.4 FT X 2 FT X 2.2 FT BOULDER BEARS NORTHEAST 1.3 FT A T-POST BEARS N22E, 1.4 FT

A USFWS SURVEY MARKER BEARS \$25°E, 1.6 FT

A USFWS SURVEY MARKER BEARS N10 W, 9.2 FT A 31" FIR WHICH BEARS S21"W, 22.8 FT, MRKD "1/4 S27 BT", ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

ESTABLISHED THE FOLLOWING:

SET 29" FIR WHICH BEARS N34"W, 35.3 FT, MRKD "1/4 S27 BT", ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

223=SURVEY REFERENCE NO. 8

FOUND AND HELD 1" IRON PIPE IN GOOD CONDITION SET IN 0.5 FT DIAMETER CONCRETE BLOCK WITH A T-POST THAT BEARS EAST 0.15 FT, TOP OF PIPE 0.6 FT ABOVE CONCRETE

ESTABLISHED THE FOLLOWING:

SET 35" FIR WHICH BEARS N19'W, 15.1 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

SET 27" FIR WHICH BEARS S24"W, 25.4 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

224=SURVEY REFERENCE NO. 6, NO. 7 AND NO. 8

FOUND AND HELD 1/2" IRON PIPE IN GOOD CONDITION SET IN 0.5 FT DIAMETER CONCRETE BLOCK WITH A T-POST THAT BEARS NORTH 0.6 FT, TOP OF PIPE 0.5 FT ABOVE CONCRETE. A 6 FT HIGH HOG WIRE FENCE RUNNING NORTH/SOUTH BEARS EAST 0.15 FT FROM IRON PIPE.

ESTABLISHED THE FOLLOWING:

SET 30" OAK WHICH BEARS N59'W, 31.0 FT MRKD "LOT 1 JJSP BT" ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

225=SURVEY REFERENCE NO. 6

FOUND AND HELD 3/4" IRON PIPE 0.2 FT ABOVE GROUND WITH A USFWS POST THAT BEARS NORTH 0.4 FT AND A T-POST BEARS NORTH 0.7 FT WITH NO EXISTING BEARING TREES.

SET 8" OAK WHICH BEARS N57E, 17.1 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

SET 12" OAK WHICH BEARS N55W, 19.5 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

226=SURVEY REFERENCE NO. 6

FOUND 3" ALUMINUM CAP FIXED TO A 5/8" IRON ROD IN GOOD CONDITION, 0.4 FT ABOVE 2.7 FT X 3.2 FT X 1 FT MOUND OF STONE WITH A USFWS SURVEY MARKER BEARS SOUTHEAST 2.5 FT.

227=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST, 1.5 FT ABOVE GROUND, TIED AT TOP CENTER. STA=29+51.31 RT=71.18'

228=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST, 1.3 FT ABOVE GROUND, TIED AT TOP CENTER. STA=29+51.43 RT=50.68'

229=SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST, 1.6 FT ABOVE GROUND, TIED AT TOP CENTER. STA = 31 + 00.81LT=50.00'

230= SURVEY REFERENCE NO. 6

FOUND 3" X 3" CONCRETE POST, 1.9 FT ABOVE GROUND, TIED AT TOP CENTER. STA=31+01.12 LT=69.47

231=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.5 FT BELOW RIM OF MONUMENT BOX. STA=18+24.52 T=0.00' HELD FOR LINE

232=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.7 FT BELOW RIM OF MONUMENT BOX. STA=14+72.74 T=0.00' HELD FOR LINE

233=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.6 FT BELOW RIM OF MONUMENT BOX. STA=23+57.93 RT=0.00' HELD FOR LINE

236=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.5 FT BELOW RIM OF MONUMENT BOX. STA=32+63.26 T=0.00' HELD FOR LINE

237=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.5 FT BELOW RIM OF MONUMENT BOX. STA=32+29.32 T=0.00' HELD FOR LINE

238=SURVEY REFERENCE NO. 3, NO. 4 AND NO. 6

FOUND 5/8" IRON ROD WITH NO CAP IN FAIR CONDITION, FLUSH WITH GROUND, MARKING THE SOUTHEAST CORNER OF THE SW 1/4 OF THE SE 1/4 OF SECTION 27, HELD. STA=15+39.82 RT=49.91

ESTABLISHED THE FOLLOWING:

SET 14" MAPLE WHICH BEARS S19'W, 15.9 FT (SLOPE DISTANCE) MRKD "E 1/16 S34 BT" ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE, INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND,

SET 11" MAPLE WHICH BEARS S89 E, 8.2 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER AND INSTALLED BT AND LSM SIGNS.

240=SURVEY REFERENCE NO. 2, NO. 3, NO. 4 AND NO. 6

FOR COMPLETE CORNER HISTORY SEE L.C.R. BOOK 149, PAGE 550 (122177)

FOUND AND HELD 3-1/2" BRASS DISK IN GOOD CONDITION, SET IN 10" X 10" CONCRETE BLOCK AN 11" MAPLE WHICH BEARS N19'E 8.1 FT, WITH VISIBLE HEALED OVER BLAZE AND SCRIBE,

FOUND ALUMINUM CHAINING NAIL AT SIDE CENTER, INSTALLED LSM AND BT SIGNS WITH 6" RED PAINTED BAND.

A 22" FIR WHICH BEARS S10"W, 21.8 FT WITH VISIBLE HEALED OVER BLAZE AND SCRIBE, FOUND BT SICN AND ALUMINUM CHAINING NAIL AT SIDE CENTER, INSTALLED LSM SIGN WITH 6" RED PAINTED BAND.

A 25" FIR WHICH BEARS S88"W, 25.4 FT, WITH VISIBLE HEALED OVER BLAZE AND SCRIBE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER, BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

ESTABLISHED THE FOLLOWING: SET STEEL POSTS WITH LSM AND USFS BOUNDARY SIGNS THAT BEAR 6 FT EAST AND 6 FT

241 = SURVEY REFERENCE NO. 5

FOUND 1" IRON PIPE IN POOR CONDITION, TOP LEANING SOUTH, TIED AT BASE. TOP OF PIPE 0.6 FT ABOVE GROUND, HELD FOR LINE.

242=SURVEY REFERENCE NO. 2, NO. 3, NO. 4 AND NO. 5

FOUND 1/2" IRON ROD WITH NO CAP IN GOOD CONDITION SET FLUSH IN GROUND, HELD.

243=SURVEY REFERENCE NO. 2 (SEE DETAIL "B")

FOUND 5/8" IRON ROD WITH NO CAP IN POOR CONDITION SET FLUSH IN GROUND AT EDGE OF GRAVEL ROAD, BENT TIED AT SPIN HOLE, NOT HELD.

244=SURVEY REFERENCE NO. 5

FOUND 5/8" IRON ROD IN FAIR CONDITION WITH ILLEGIBLE YELLOW PLASTIC CAP, 0.9 FT ABOVE GROUND AT BASE OF TREE, HELD FOR LINE.

245= SURVEY REFERENCE NO. 5

FOUND 5/8" IRON ROD IN FAIR CONDITION WITH NO CAP, 0.7 FT ABOVE GROUND, LEANING, TIED AT GROUND, HELD FOR LINE.

246 = SURVEY REFERENCE NO. 2


FOUND 5/8" IRON ROD IN GOOD CONDITION WITH ORANGE PLASTIC CAP "TRANTOW LS 15075 WA", 0.7 FT ABOVE GROUND.

247=SURVEY REFERENCE NO. 2 (SEE DETAIL "A")

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH ORANGE PLASTIC CAP "TRANTOW LS 15075 WA", 1.2 FT ABOVE GROUND, NOT HELD.

248=SURVEY REFERENCE NO. 2

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH NO CAP, 0.6 FT BELOW GROUND, 0.27' NORTH OF LINE, NOT HELD.

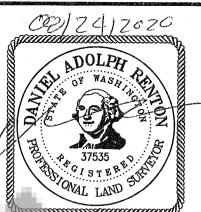

SURVEY

DRANO CADASTRAL SURVEY TASK ORDER COLUMBIA RIVER GORGE NATIONAL SCENIC AREA GIFFORD PINCHOT NATIONAL FOREST

SE & SW 1/4 OF SECTIONS 27 & NE & NW 1/4 OF SECTION 34 T. 3 N., R. 9 E., W.M.

SKAMANIA COUNTY, WASHINGTON UNITED STATES FOREST SERVICE CONTRACT NO. 1205G119F0020

249=SURVEY REFERENCE NO. 2 (SEE DETAIL "C")

FOUND 1/2" IRON ROD IN GOOD CONDITION WITH NO CAP, 0.5 FT BELOW GROUND.

250=NO RECORD

FOUND 1" IRON PIPE IN GOOD CONDITION, 0.7 FT ABOVE GROUND, NOT HELD.

251 = SURVEY REFERENCE NO. 3

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH RED PLASTIC CAP "BDC WA 41954 OR 77685 LS", FLUSH WITH GROUND, HELD

255= SURVEY REFERENCE NO. 5

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH ILLEGIBLE PLASTIC CAP, 1 FT ABOVE GROUND.

256 SURVEY REFERENCE NO. 5

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH YELLOW PLASTIC CAP "WA 15673 PLS OR 1799 PLS" 0.6 FT ABOVE GROUND, HELD.

257=SURVEY REFERENCE NO. 3

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH RED PLASTIC CAP "BDC WA 41954 OR 77685 LS" FLUSH WITH GROUND, HELD.

258= SURVEY REFERENCE NO. 3

FOUND 5/8" IRON ROD IN GOOD CONDITION WITH ILLEGIBLE RED PLASTIC CAP SET FLUSH IN ASPHALT, 0.21' SOUTH OF LINE, HELD FOR EASTING.

259=SURVEY REFERENCE NO. 3

FOUND 1-1/2" ILLEGIBLE ALUMINUM MONUMENT IN POOR CONDITION, 0.4' BELOW ASPHALT WITH NO MONUMENT BOX, 0.17' NORTH OF LINE, HELD FOR FASTING.

261 = SURVEY REFERENCE NO. 5

FOR COMPLETE CORNER HISTORY SEE L.C.R. BOOK 3/9, PAGE 29 (102227)

FOUND AND HELD 1-1/4" IRON PIPE IN FAIR CONDITION, ±3 FT BELOW BOTTOM OF ROCKSLIDE FROM WHICH BEARS:

A 23" MAPLE WHICH BEARS N41"W, 22.0 FT WITH VISIBLE HEALED OVER BLAZE AND SCRIBE. INSTALLED MAGNETIC CHAINING NAIL AT SIDE CENTER, BT AND LSM SIGNS WITH 6" RED PAINTED

28" MAPLE WHICH BEARS SOTE, 28.2 FT WITH VISIBLE HEALED OVER BLAZE AND SCRIBE. INSTALLED MAGNETIC CHAINING NAIL AT SIDE CENTER, BT AND LSM SIGNS WITH 6" RED PAINTED

ESTABLISHED THE FOLLOWING:

SET 22" MAPLE WHICH BEARS N85'E, 24.4 FT MRKD "T3N R9E S27 BT", WITH MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

SET 17" ALDER FROM WHICH BEARS S69'W, 23.3 FT MRKD "T3N R9E S33 BT" WITH MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

262=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.5 FT BELOW RIM OF MONUMENT BOX. STA=40+45.45 T=0.00' HELD FOR LINE

263=SURVEY REFERENCE NO. 9

FOUND 1-3/4" IRON PIPE WITH PIN IN GOOD CONDITION, 0.5 FT BELOW RIM OF MONUMENT BOX. STA=37+86.97 RT=0.00' HELD FOR LINE

264=NO RECORD

FOUND 1/2" IRON PIPE IN FAIR CONDITION, SET IN 0.5 FT DIAMETER CONCRETE BLOCK, TOP OF PIPE 1.9 FT ABOVE CONCRETE, NOT HELD.

265=NO RECORD

FOUND 1/2" IRON PIPE IN FAIR CONDITION, SET IN 0.5 FT DIAMETER CONCRETE BLOCK, TOP OF PIPE 0.2 FT ABOVE CONCRETE, NOT HELD. 266=NO RECORD

FOUND 1/2" IRON PIPE IN FAIR CONDITION, SET IN 0.5 FT DIAMETER CONCRETE BLOCK, TOP OF


PIPE 0.7 FT ABOVE CONCRETE, NOT HELD.

FOUND 1/2" IRON PIPE IN POOR CONDITION, SET IN PARTIALLY BROKEN CONCRETE BLOCK, TOP OF PIPE BENT, TIED AT BASE, TOP OF PIPE 1 FT ABOVE CONCRETE, NOT HELD. 268=NO RECORD

FOUND 1/2" IRON PIPE IN POOR CONDITION SET LOOSELY IN GROUND, 1.4 FT ABOVE GROUND, NOT HELD.

269=NO RECORD FOUND 1/2" IRON PIPE IN FAIR CONDITION, SET IN 0.5 FT DIAMETER CONCRETE BLOCK, TOP OF

PIPE BENT, TIED AT BASE, TOP OF PIPE 0.4 FT ABOVE CONCRETE, NOT HELD.

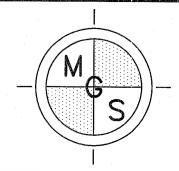

MINISTER-GLAESER SURVEYING INC. 2200 E. EVERGREEN BLVD. VANCOUVER, WA 98661 (360) 694-3313

SCALE: N/A JOB NO. <u>19-167</u> DATE: 8/24/2020 CALC BY: RDH DRAWN BY: RDH CHECKED BY: DAR SHEET 6 OF 7

270=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP FLUSH IN GROUND WITH 1.1 FT X 1 FT X 0.2 FT MOUND OF STONE PAINTED RED. SET AT NORTHERN RIGHT-OF-WAY LINE OF 1917 PROPOSED HIGHWAY AS SHOWN ON SURVEY REFERENCE NO. 8 AND CALLED OUT IN DEED REFERENCE NO. 2. STA=23+13.28 LT=153.19'

ESTABLISHED THE FOLLOWING:

SET 25" OAK BEARS S85"W, 17.3 FT, MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS.

SET 14" OAK BEARS N28"W, 15.0 FT, MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS.

271 =

SET 1/2" IRON ROD WITH YELLOW PLASTIC CAP "RENTON 37535" FLUSH IN ASPHALT ROADWAY

272=

SET 1/2" IRON ROD WITH YELLOW PLASTIC CAP "RENTON 37535" FLUSH IN ASPHALT ROADWAY

273=

SET 1/2" IRON ROD WITH YELLOW PLASTIC CAP "RENTON 37535" FLUSH IN ASPHALT ROADWAY

274=

SET 1/2" IRON ROD WITH YELLOW PLASTIC CAP "RENTON 37535" FLUSH IN ASPHALT ROADWAY

275=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP FLUSH IN GROUND. A STEEL GUARD POST WITH LSM SIGN BEARS NORTHEAST 1 FT. A STEEL POST WITH USFS BOUNDARY SIGN BEARS EAST 4 FT.

ESTABLISHED THE FOLLOWING:
SET 11" MAPLE BEARS N72"E, 75.6 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS.

276=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP SET FLUSH IN GROUND. A STEEL GUARD POST WITH LSM SIGN BEARS NORTHWEST 1FT.

ECTABLISHED THE FOLLOWING

ESTABLISHED THE FOLLOWING: SET 12" FIR WHICH BEARS NO9'E, 21.3 FT MRKD "X BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS.

277=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP SET FLUSH IN GROUND. A STEEL POST WITH LSM AND USFS BOUNDARY SIGNS BEARS WEST 8 FT. NO BEARING TREES WERE SET.

278=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP SET FLUSH IN GROUND WITH 12" X 8" X 4"
MOUND OF STONE

ESTABLISHED THE FOLLOWING:

SET STEEL POSTS WITH LSM AND USFS BOUNDARY SIGNS THAT BEAR 6 FT EAST AND 6 FT SOUTH.

SET 11" OAK WHICH BEARS N78"E, 25.15 FT MRKD "LOT 3 MSP BT" WITH MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

SET 13" FIR WHICH BEARS N74"W, 27.7 FT MRKD "LOT 3 MSP BT" WITH MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE, INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

279=(SEE MONUMENT DETAIL)

SET 5/8" IRON ROD WITH 3-1/4" ALUMINUM CAP SET FLUSH IN TOP OF ROCKSLIDE ON SIDE


ESTABLISHED THE FOLLOWING:


SET STEEL POSTS WITH LSM AND USFS BOUNDARY SIGNS THAT BEAR 6 FT WEST AND 6 FT

SET 11" PINE WHICH BEARS S84"E, 15.4 FT MRKD "LOT 3 MSP BT" WITH MAGNETIC CHAINING NAIL AT SIDE CENTER AND NAIL WITH BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF BLAZE. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

SET 6" OAK WHICH BEARS N89"W, 46.9 FT MRKD "X" AT BREAST HEIGHT AND "BT" WITH NAIL AND BRASS WASHER "PLS 37535" AT BOTTOM CENTER OF LOWER BLAZE, ADDED MAGNETIC CHAINING NAIL AT SIDE CENTER. INSTALLED BT AND LSM SIGNS WITH 6" RED PAINTED BAND.

FOL	UND MON	IUMENT T	ABLE		FOL	JND MON	IUMENT T	ABLE
POINT NO.	NORTHING	EASTING	DESCRIPTION		POINT NO.	NORTHING	EASTING	DESCRIPTION
201	141415.80	1346821.34	FND		229	140785.60	1346582.54	FND
202	141857.43	1346845.00	FND	·	230	140796.87	1346566.67	FND
203	141616.86	1346841.94	FND		231	140260.14	1345493.85	FND
205	141862.94	1346481.52	FND		232	140133.82	1345167.65	FND
206	141624.02	1346448.81	FND		233	140360.65	1346017.71	FND
210	141420.26	1346570.06	FND		236	140898.09	1346704.40	FND
212	141320.32	1346568.10	FND		237	140867.74	1346689.22	FND
213	141623.61	1346477.17	FND	• .	238	140122.87	1345249.11	FND
215	141395.18	1346879.80	FND		240	140150.31	1343937.00	FND
216	141652.47	1346906.18	FND		241	139704.39	1341344.01	FND
217	141658.46	1346846.30	FND		242	139583.39	1343928.69	FND
222	142760.33	1346593.76	FND		243	140142.23	1344460.42	FND
223	140973.25	1346051.34	FND		244	139827.05	1342546.26	FND
224	140888.21	1346564.90	FND		245	139711.29	1342554.69	FND
225	140156.84	1346562.47	FND		246	140038.61	1344222.94	FND
226	140578.52	1346567.66	FND]	247	140147.42	1344176.01	FND
227	140592.22	1346581.41	FND		248	139742.72	1344298.93	FND
228	140606.42	1346566.62	FND		249	139763.19	1344341.93	FND
								

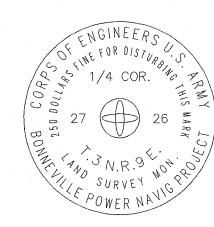

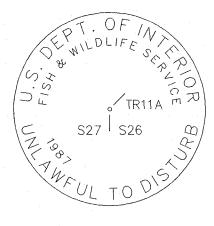





SURVEY

DRANO CADASTRAL SURVEY TASK ORDER
COLUMBIA RIVER GORGE NATIONAL SCENIC AREA
GIFFORD PINCHOT NATIONAL FOREST
SE & SW 1/4 OF SECTIONS 27 & NE & NW 1/4 OF SECTION 34
T. 3 N., R. 9 E., W.M.
SKAMANIA COUNTY, WASHINGTON
UNITED STATES FOREST SERVICE CONTRACT NO. 1205G119F0020

CORNER CODE: T-17 POINT NUMBER: 226 POINT NUMBER: 270 POINT NUMBER: 222



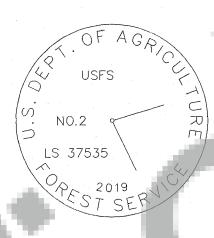

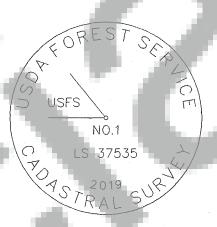





POINT NUMBER: 275 POINT NUMBER: 276 POINT NUMBER: 277 POINT NUMBER: 278 POINT NUMBER: 279

NARRATIVE:

THE PURPOSE OF THIS SURVEY WAS TO MARK AND POST BOUNDARY LINES, MAINTAIN EXISTING CORNERS AND SET NEW BOUNDARY CORNERS FOR THE UNITED STATES FOREST SERVICE UNDER CONTRACT NO. 1205G119F0020 ISSUED IN MAY 2019. THE PROJECT IS LOCATED WITHIN A PORTION OF THE COLUMBIA RIVER GORGE NATIONAL SCENIC AREA AND LOCATED IN THE SE 1/4 AND THE SW 1/4 OF SECTION 27 AND THE NE 1/4 AND NW 1/4 OF SECTION 34, TOWNSHIP 3 NORTH, RANGE 9 EAST, WILLAMETTE MERIDIAN, SKAMANIA COUNTY, WASHINGTON.

TASK 1

THIS AREA CONSISTED OF MARKING AND POSTING LINE, MAINTAINING CORNERS AND SETTING A NEW RIGHT-OF-WAY MONUMENT. BEGINNING AT THE EAST 1/4 CORNER OF SAID SECTION 27 WE FOUND AND HELD A 3-1/2" BRASS CAP (SEE CORNER NO. 222). THENCE IN A SOUTHERLY DIRECTION ALONG THE EAST LINE OF THE SOUTHEAST 1/4 THEREOF, WE FOUND AND HELD A MAG NAIL DRILLED DIAGONALLY IN ROCK (SEE CORNER NO. 210) MARKING THE NORTHWEST CORNER OF LOT 1 OF SURVEY REFERENCE NO. 7. THENCE CONTINUING ALONG THE EAST LINE OF SAID SOUTHEAST 1/4 TO A 5/8" IRON ROD (IRON BAR PER DEED REFERENCE NO. 1)(SEE CORNER NO. 212) THAT WAS HELD PER SURVEY REFERENCE NO. 7, SAID POINT BEING THE MOST NORTHERLY NORTHEAST CORNER OF THE UNITED STATES OF AMERICA PARCEL NO. 03092740020000. THENCE CONTINUING TO A FOUND 1/2" IRON PIPE (SEE CORNER NO. 224) AND HELD FOR THE NORTHEAST CORNER OF THE "JOHNSON" PARCEL AS DESCRIBED PER DEED REFERENCE NO. 1 (PARCEL NO. 03092740030000). THENCE ALONG THE NORTH LINE OF SAID "JOHNSON" PARCEL IN A NORTHWESTERLY DIRECTION TO A 1/2" IRON PIPE (SEE CORNER NO. 223) THAT WAS FOUND AND HELD FOR THE NORTHWEST CORNER THEREOF. THENCE IN A SOUTHWESTERLY DIRECTION ALONG THE WESTERLY LINE OF SAID "JOHNSON" PARCEL BY HOLDING THE DEED ANGLE 93'20'00" (DEED REFERENCE NO. 1 AND NO. 2) TO THE NORTHERLY RIGHT-OF-WAY LINE OF COOK-UNDERWOOD ROAD AS EXISTED ON AND PRIOR TO JANUARY 25, 1946 PER DEED REFERENCE NO. 1 AND NO. 2 AND SHOWN PER SURVEY REFERENCE NO. 8 DATED JANUARY 2, 1917 AND SET A 3-1/2" ALUMINUM FOREST SERVICE CAP (SEE CORNER NO. 270) AT THE CALCULATED POSITION. WE MARKED AND POSTED LINE ALONG THE EAST LINE OF SAID "JOHNSON" PARCEL BETWEEN FOUND AND HELD CORNERS NO. 224 AND NO. 224 AND NO. 223 AND THE WESTERLY LINE OF SAID "JOHNSON" PARCEL BETWEEN FOUND CORNER NO. 223 AND SET RIGHT-OF-WAY MONUMENT NO. 270.

TASK 2

THIS AREA CONSISTED OF MARKING AND POSTING LINE, MAINTAINING CORNERS AND SETTING NEW BOUNDARY CORNERS. BEGINNING AT THE SOUTHEAST CORNER OF THE SOUTHWEST 1/4 OF THE SOUTHEAST 1/4 OF SAID SECTION 27 (SEE CORNER NO. 238). THENCE IN A WESTERLY DIRECTION ALONG SAID SECTION LINE FOR A DISTANCE OF 243.00 FEET PER DEED REFERENCE NO. 6 AND SURVEY REFERENCE NO. 3, SET A 3-1/2" USFS ALUMINUM CAP (SEE CORNER NO. 275). THENCE NORTHWESTERLY FOR A DISTANCE OF 209.00 FEET TO "A CONNECTION WITH TAYLOR AND GRAVES ROAD" PER DEED REFERENCE NO. 6, THE CENTERLINE OF "TAYLOR AND GRAVES ROAD" NOW CALLED JACKSON ROAD WAS CALCULATED BY SPLITTING THE EXISTING EDGES OF THE ROADWAY AT THE TIME OF THIS SURVEY. THE DEED DISTANCE OF 209.00 FEET WAS HELD AND A 1/2" IRON ROD WAS SET (SEE CORNER NO. 271) AT THE INTERSECTION OR "CONNECTION" PER DEED REFERENCE NO. 6. THENCE IN A WESTERLY DIRECTION ALONG THE CENTERLINE OF SAID EXISTING JACKSON ROAD, A 1/2" IRON ROD WAS SET AT EACH ANGLE POINT (SEE CORNER NO. 272, NO. 273 AND NO. 274). THENCE ALONG THE NORTHERLY LINE OF PARCELS DESCRIBED PER DEED REFERENCE NO. 4, TO A 1/2" IRON ROD SET AT THE NORTHWEST CORNER THEREOF (SEE CORNER 276). THENCE SOUTHEAST BY HOLDING THE DEED ANGLE OF 71'59'00" PER REFERENCE NO. 4 TO SAID SECTION LINE AND SET A 3-1/2" USFS ALUMINUM CAP (SEE CORNER NO. 277). THENCE WESTERLY ALONG SAID SECTION LINE TO THE FOUND AND HELD SOUTH 1/4 CORNER OF SECTION 27 (SEE CORNER NO. 240). WE MARKED AND POSTED LINE ALONG THE ENTIRE BOUNDARY DESCRIBED HEREIN TASK 2.


FOL	JND MON	IUMENT T	ABLE
POINT NO.	NORTHING	EASTING	DESCRIPTION
250	140124.41	1344786.42	FND
251	140106.38	1344829.72	FND
255	140070.08	1341978.53	FND
256	139735.43	1342003.47	FND
257	140168.37	1344988.72	FND
258	139991.43	1344879.14	FND
259	140060.71	1345039.47	FND
261	140181.93	1341307.72	FND
262	141655.28	1346876.31	FND
263	141398.14	1346849.95	FND
264	140952.92	1346173.28	FND
265	140865.86	1346028.50	FND
266	140814.28	1346016.38	FND
267	140491.77	1345936.40	FND
268	140514.80	1345939.70	FND
269	140932.66	1346296.05	FND


SI	ET MONU	MENT TA	BLE
POINT NO.	NORTHING	EASTING	DESCRIPTION
270	140502.68	1345944.99	SET-IROD
271	140244.68	1345183.29	SET-IROD
272	140229.56	1344977.39	SET-IROD
273	140206.14	1344761.69	SET-IROD
274	140207.52	1344798.88	SET-IROD
275	140127.95	1345006.16	SET-IROD
276	140182.17	1344497.48	SET-IROD
277	140138.20	1344516.32	SET-IROD
278	140167.29	1342521.49	SET-IROD
279	139440.39	1342574.42	SET-IROD

POINT NO.	NORTHING	EASTING	DESCRIPTION
65	139608.78	1348903.66	CP-OPUS-BBGS9

CONTROL POINT 65:

SET 5/8" IRON ROD WITH PUNCHED 2" ALUMINUM CAP, FLUSH WITH GROUND, 20' EAST OF PARKING LOT ENTRANCE FOR DRANO BOAT LAUNCH, 92 FT SOUTHEAST OF "DRANO LAKE" SIGN, 22.50 FT NORTH OF NORTH EDGE OF PAVEMENT OF SR-14, 12 FT EAST OF LARGE BOULDER IN GRASS 2.8 FT X 2.7 FT X 1.8 FT.

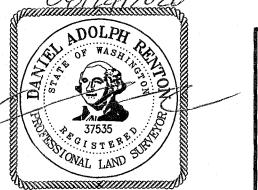

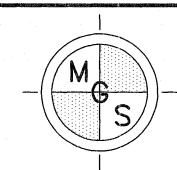

MINISTER-GLAESER
SURVEYING INC.
2200 E. EVERGREEN BLVD.
VANCOUVER, WA 98661

(360) 694-3313

SCALE: N/A

JOB NO. 19-167

DATE: 8/24/2020

CALC BY: RDH

DRAWN BY: RDH

CHECKED BY: DAR

SHEET 7 OF 7

WIG EILE: 101675 DWG