



RETURN TO:  
Erielle Lamb  
987 McClellan Rd  
Vancouver, WA  
98661

LAND CORNER RECORD

THIS FORM IS FOR RECORDING A PLSS CORNER MONUMENT AND ACCESSORY INFORMATION WHEN A RECORD OF SURVEY IS NOT REQUIRED, PER RCW 58.09.040(2). (UPDATED 8/01/2019. DO NOT REVISE THIS FORM)

CERTIFICATE: THIS LAND CORNER RECORD CORRECTLY REPRESENTS WORK PERFORMED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE SURVEY RECORDING ACT.


GRANTOR: Erielle Lamb  
NAME: \_\_\_\_\_

SIGNATURE: Erielle Lamb

CERTIFICATE NO.: 20100531

ADDRESS: 987 McClellan Rd  
Vancouver, WA 98661

GRANTEE: PUBLIC

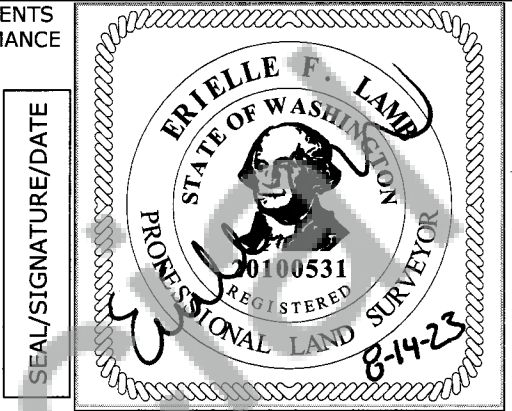

INDEXING INFORMATION: 1/4 \_\_\_\_\_ 1/4 \_\_\_\_\_ SEC: 34,35,3,2 TWP: 3-4N RGE: 9E

CORNER CODE, SEE DIAGRAM BELOW: Z-17

ADDITIONAL IDENTIFIER: (PLSS CORNER NAME) Section Cor. to S34, S35, S3, S2

WPCS: N: \_\_\_\_\_ E: \_\_\_\_\_

ZONE: \_\_\_\_\_ DATE OF OBSERVATION: 3/29/2023

BLM GCDB POINT IDENTIFIER (OPTIONAL): 500100

PROVIDE THE FOLLOWING INFORMATION ON ATTACHMENTS, AS REQUIRED BY RCW 58.09.060(2)

(a) AN ACCURATE DESCRIPTION AND LOCATION, IN REFERENCE TO THE CORNER POSITION, OF ALL MONUMENTS AND ACCESSORIES FOUND AT THE CORNER;

(b) AN ACCURATE DESCRIPTION AND LOCATION, IN REFERENCE TO THE CORNER POSITION, OF ALL MONUMENTS AND ACCESSORIES PLACED OR REPLACED AT THE CORNER;

(c) BASIS OF BEARINGS USED TO DESCRIBE OR LOCATE SUCH MONUMENTS OR ACCESSORIES;

(d) COROLLARY INFORMATION THAT MAY BE HELPFUL TO RELOCATE OR IDENTIFY THE CORNER POSITION.

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C		6				5				4				3				2						1	
D																									
E																									
F																									
G		7				8				9				10				11					12		
H																									
J																									
K																									
L		18				17				16				15				14					13		
M																									
N																									
O																									
P		19				20				21				22				23					24		
Q																									
R																									
S																									
T		30				29				28				27				26					25		
U																									
V																									
W																									
X		31				32				33				34				35					36		
Y																									
Z																									
	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25

# LAND CORNER RECORD ATTACHMENT

**CORNER INFORMATION:** DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

History:

(1879) The U.S. General Land Office Contracted with Edwin Richardson Deputy Surveyor on December 4th, 1878 under contract No. 247 and commenced fieldwork from June 26th to July 1st 1879. For the corner to sections 2, 3, 34, and 35 of T 3-4N R9E. Set a fir post 4' long and 1' deep from which the following bearing trees were taken:

- A 15" Cedar, Bears N 30° W, 5 links distance.
- A 4" Fir, Bears S 25° W, 12 links distance.
- A 4" Fir, Bears S 40° E, 10 links distance.
- A 5" Cedar, Bears N 50° E, 13 links distance.

(1892) The U.S. General Land Office Contracted with Jacob Richardson Deputy Surveyor on September 20th, 1892 under contract No. 383 and commenced fieldwork from October through November 1892. A portion of the South boundary of the township was resurveyed which included revisiting the section corner to 34, 33, 3, and 2 of T3-4N R9E of the Willamette Meridian that Edwin Richardson had previously set 13 years earlier. For the location of the corner, he noted that a post was set 4" square, and 24" above the ground marked "T4NS35" on the Northeast face, "R9ES2" on the Southeast face, "T3NS3" on the Southwest face, and "S34" on Northwest face with 2 notches on East and 4 on West edges. The following bearing trees were recorded:

- A 5" Yew, Bears N 53°30' E, 14 links distance, marked "T4NR9ES35BT"
- A 3" Fir, Bears S 45° E, 11 links distance, marked "T3NR9ES2BT"
- A 3" Cedar, Bears S 22° W, 11.5 links distance, marked "T3NR9ES3BT"
- A 18" Fir, Bears, N 51° W, 6 links distance, marked "T4NR9ES34BT"

(1970)- Field work performed June 29th 1970 by C.E. Whitten and Merl Lucas of the DNR. Found an iron pipe set by Karl Karlson on unspecified date and set a standard DNR monument recorded in an affidavit filed at the Skamania County Courthouse in book 61 page 921. The location for the Northwest bearing tree was covered by a large down snag. At the location for the Northeast bearing tree, found a dead yew tree lying on the ground, with a definite face, but no scribing. Set four tag references:

- A 8" Fir, Bears N 85° E, 12.54' distance.
- A 16" Fir, Bears S 3° E, 18.16' distance.
- A 10" Fir, Bears S 52° W, 12.84' distance.
- A 12" Fir, Bears N 12° E, 10.21' distance.

Notes: Distances were measured to aluminum spikes in base of trees.

(1973)- Visited by Jim Massey of the U.S. Forest Service in July 1973. Describes a 6" square DNR concrete post, 6" above the ground at the monument for S34, S35, S3, and S2. Notes that the monument is in good quality. Photo ID #773-188, Line 27.

(1982)- Corner was visited in December 1982 by Roy Gaylord (WA PLS#18731) of Terra Surveying. Recorded with the Skamania County Auditor on January 19th 1983 in Book 4 of 9 of monuments at pg 44. An LCR was also filed under Skamania County Auditor #95304. He recorded the following references:

- A 17" Douglas Fir, Bears N 12° E, 10.20' distance.
- A 13" Douglas Fir, Bears N 85° E, 12.52' distance.
- A 25" Douglas Fir, Bears S 3° E, 18.16' distance.
- A 14" Douglas Fir, Bears S 52° W, 12.84' distance.

Work Completed: Painted, blazed, and tagged existing bearing trees.

Evidence:

(2023)- R. Ellis of USDA Forest Service, Columbia Lands Zone on 3/29/2023 recovered the section corner monument to S34, S35, S3, and S2 as set in June 1970 by C.E. Whitten of the DNR. Found a 3 1/4" 1970 DNR brass cap on 4" by 3.5" concrete pedestal, 4" above the ground. The N 85° E bearing tree is now a snag. 6" red bands were painted on all new and old bearing trees. The following bearing trees were recovered:

- A 20" Douglas Fir, Bears N 12° E, 10.21' distance from record with healed blaze. The 10.21 feet distance was confirmed, but the tree bearing from the corner was recorded as N 4° E by our field crew in 2023 with a compass declination of 16° Northeast.
- A 24" Douglas Fir, Bears S 3° E, 18.16' distance, with healed blaze.
- A 17" Douglas Fir, Bears S 54° W, 12.84' distance, with healed blaze.
- A 13" Douglas Fir Snag, Bears N 85° E, 12.54' distance, with healed blaze.

A Small Yew sapling lies near the call for a N 53°30' E, 14 link distance bearing tree recorded by the 1892 Richardson GLO Survey and later described by C.E. Whitten as a down yew in his 1970 record for setting the current DNR monument.

Perpetuation:

New 25" Douglas Fir, Bears N 72° W, 56.95' distance, scribed "T4NR9ES34BT" with attached 54-9 LSM and 54-3 BT tag, 2.5" PK Nail with 2" diameter brass washer marked WA PLS#20100531 set right side center from monument 4" above ground.

# LAND CORNER RECORD ATTACHMENT

**CORNER INFORMATION:** DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

