


RETURN TO:
Erielle Lamb
987 McClellan Road
Vancouver, WA 98661

LAND CORNER RECORD

THIS FORM IS FOR RECORDING A PLSS CORNER MONUMENT AND ACCESSORY INFORMATION WHEN A RECORD OF SURVEY IS NOT REQUIRED, PER RCW 58.09.040(2). (UPDATED 8/01/2019. DO NOT REVISE THIS FORM)

CERTIFICATE: THIS LAND CORNER RECORD CORRECTLY REPRESENTS WORK PERFORMED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE SURVEY RECORDING ACT.


GRANTOR: Erielle Lamb
NAME:

SIGNATURE: 

CERTIFICATE NO.: 20100531

ADDRESS: 987 McClellan Road
Vancouver, WA 98661

GRANTEE: PUBLIC

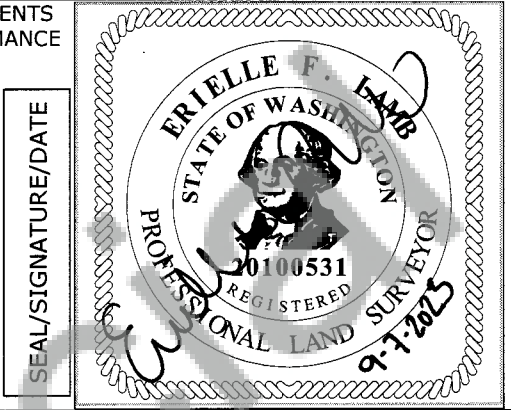

INDEXING INFORMATION: 1/4 1/4 SEC: 35 TWP: 5N RGE: 9E

CORNER CODE, SEE DIAGRAM BELOW:

ADDITIONAL IDENTIFIER: (PLSS CORNER NAME) Corner 3 of HES 234

WPCS: N: E:

ZONE: DATE OF OBSERVATION: 5/25/2023

BLM GCDB POINT IDENTIFIER (OPTIONAL):

PROVIDE THE FOLLOWING INFORMATION ON ATTACHMENTS, AS REQUIRED BY RCW 58.09.060(2)

- (a) AN ACCURATE DESCRIPTION AND LOCATION, IN REFERENCE TO THE CORNER POSITION, OF ALL MONUMENTS AND ACCESSORIES FOUND AT THE CORNER;
- (b) AN ACCURATE DESCRIPTION AND LOCATION, IN REFERENCE TO THE CORNER POSITION, OF ALL MONUMENTS AND ACCESSORIES PLACED OR REPLACED AT THE CORNER;
- (c) BASIS OF BEARINGS USED TO DESCRIBE OR LOCATE SUCH MONUMENTS OR ACCESSORIES;
- (d) COROLLARY INFORMATION THAT MAY BE HELPFUL TO RELOCATE OR IDENTIFY THE CORNER POSITION.

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	
A																										A
B																										B
C			6				5					4				3				2				1		C
D																										D
E																										E
F																										F
G																										G
H																										H
J																										J
K																										K
L																										L
M																										M
N																										N
O																										O
P																										P
Q																										Q
R																										R
S																										S
T																										T
U																										U
V																										V
W																										W
X																										X
Y																										Y
Z																										Z
	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	

LAND CORNER RECORD ATTACHMENT

CORNER INFORMATION: DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

History:

(1916)- Frederick W. Rase of the U.S. Forest Service conducted the survey for HES 234 from May 15th through May 17th 1916. HES 234 was for a Joseph C. Ries of Willard Washington in unsurveyed section 35 of T5N R9E of the Willamette Meridian. The size of the parcel surveyed was 16.03 acres.

Set a granite stone 25"x8"x7" 15" in the ground, over a stone marked with a cross for corner #3, marked "3HES234" on side facing the claim from which:

A 24" Fir, bears S 79° E, 24 links distance, marked "3HES234BT".

A 30" Fir, bears S 2°55' E, 40 links distance, marked "3HES234BT".

Raised a mound of earth, 4' base, 2' high, 3-1/2' distance within the claim.

(1985)- Visited by Larry Bishop (WA PLS#16337) of Bishop Surveying in June 1985. Recorded in Skamania Land Corner record #99586.

Evidence:

Found a 13x8x5 stone on top and "3HES234" on Southwest side.

Found 1-1/2" capped galvanized iron pipe alongside stone.

Found Original 24" now sawed 30" Douglas Fir stump, bears S 79° E, 15.8' distance, with healed blaze.

Found Original 30" now 36" uprooted Douglas Fir stump stood, bears S 2°53' E 26.4' distance.

Perpetuation:

Set 2-1/2"x30" Aluminum Pipe with 2-1/2" Aluminum Cap in a mound of stone. Buried Original Stone and pipe in hole next to monument set. The following references were recorded:

20" White Fir, bears S 25° W, 32.1' distance, scribed "3HES234BT", with 3/4" brass disk stamped PLS 16337.

8" Alder, bears S 31° E, 44.4' distance, bark scribed "3HES234BT", with 3/4" brass disk stamped PLS 16337.

Nailed 54-4 and BT signs to BT's and painted band and blazes red. Set guard posts East and S 30° E with decals 54-2 and survey marker.

Evidence:

(2023)- R. Ellis of USDA Forest Service, Columbia Lands Zone on 5/25/2023 recovered Corner 3 of HES 234 as set in 1985 by Larry Bishop of Bishop Surveying. 6" red bands were painted on all new and old bearing trees.

Found 2-1/2" Aluminum Cap on 2-1/2" Aluminum Pipe, 1-1/2" above the ground. The following bearing objects were recovered:

A 17" Alder, Bears S 31° E, 44.4' distance with bark scribing visible.

A 30" Stump, Bears S 79° E, 15.8' distance with bearing tree tag facing corner.

Perpetuation:

New 17" Grand Fir, Bears S 56° W, 11.29' distance, scribed "3HES234BT" with 2" diameter WA PLS#20100531 brass washer and nailed with a 2" long mag nail set left side center 1/2" above ground.

Set guard posts 5' East and along West line of HES 234 (S 30° E).

LAND CORNER RECORD ATTACHMENT

CORNER INFORMATION: DISCUSS THE HISTORY, EVIDENCE FOUND, AND PERPETUATION OF THE CORNER. SHOW THE REFERENCES; PROVIDE THE DATE OF THE FIELD WORK; IF APPLICABLE, MAKE REFERENCE TO A MAP OF RECORD AND/OR THE FIELD BOOK/PAGE NO. USE ADDITIONAL SHEETS AS NEEDED.

