


RECORD OF SURVEY

LOCATED IN THE GIFFORD PINCHOT NATIONAL FOREST WITHIN THE SE1/4SE1/4 SECTION 31, SW1/4SW1/4, SE1/4SW1/4, SW1/4SE1/4 & SE1/4SE1/4 SECTION 32, SW1/4SW1/4, SE1/4SW1/4, SW1/4SE1/4 & SE1/4SE1/4 SECTION 33, T.4 N., R.9 E., W.M. SKAMANIA COUNTY, STATE OF WASHINGTON **AUGUST 2023**

> UNITED STATES OF AMERICA 04090000150000, 04090000160000,

GIFFORD PINCHOT NATIONAL FOREST 04090000170000, 04090000130000

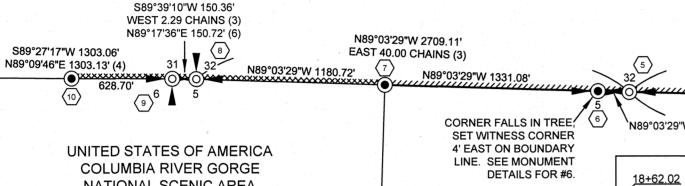

N86°45'13"W 186.56' WEST 2.74 CHAINS (3) WEST 40.00 CHAINS (2) N89°33'02"W 2464 64 **EAST 40.00 CHAINS (3)** TIMBER TRESPASS N89°03'29"W 197.28' AREA, SEE DETAIL "B" 3+92.44 R93.88

EDGE OF TIMBER CUT


DETAIL "B"


NOT TO SCALE

TIMBER TRESPASS- 1.5 ACRES

BLAZE AND 2 AXE HACKS ON LINE.

BROUGHTON LUMBER COMPANY 03090000010000 0+00

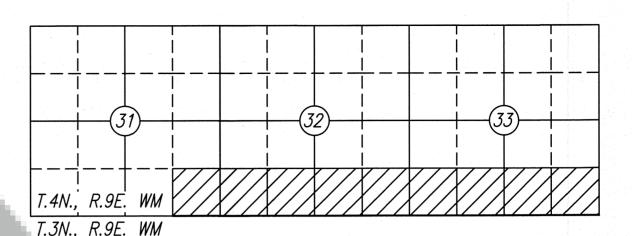

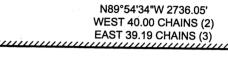

CREEK CALL-SEE DETAIL "A"

EAST 38.61 CHAINS (3) NOT TO SCALE CREEK CALL WEST 1 CHAIN (2) EAST 0.76 CHAIN (3)

S87°33'46"W 2698.47'

PURPOSE

THE PURPOSE OF THIS SURVEY IS TO POST AND MONUMENT A PORTION OF NATIONAL FOREST SYSTEM LANDS IN THE GIFFORD PINCHOT NATIONAL FOREST AND COLUMBIA RIVER GORGE NATIONAL SCENIC AREA. THE LANDS SURVEYED ARE PORTIONS OF SECTIONS 31, 32 & 33, T. 4 N., R. 9 E. AND PORTIONS OF SECTIONS 4, 5 & 6, T. 3 N., R. 9 E., W. M.

BASIS OF BEARING

BEARINGS SHOWN HEREON ARE BASED ON GEODETIC NORTH AT CONTROL POINT 1 USING A CONVERGENCE ANGLE OF -0°52'34".

DISTANCES SHOWN HEREON ARE GROUND DISTANCES, US SURVEY FEET USING A COMBINED FACTOR OF 0.99989493.

SURVEYOR'S REPORT

BOUNDARY RESOLUTION:

THIS SURVEY UPHELD MONUMENTS SET BY THE 1880, 1892 & 1901 GLO SURVEYS, REMONUMENTED BY THE DEPARTMENT OF NATURAL RESOURCES AND LARRY BISHOP.

LOCAL MONUMENTS IN SECTION 33 WERE ACCEPTED.

NATIONAL SCENIC AREA

03090000010200. 03090000019000

THE AXLE MARKING THE SOUTH QUARTER CORNER OF SECTION 33 WAS CORROBORATED BY THE GLO CREEK CALL. THE 1901 GLO CALL WAS 0.76 CHAINS (50.16') WEST AND THIS SURVEY FOUND THE CREEK TO BE 47' WEST OF THE AXLE. THE CREEK SEEMS TO BE IN THE SAME LOCATION.

THE IRON PIPE MARKING THE SECTION CORNER TO SECTIONS 32 & 33 IS CORROBORATED BY THE 1901 GLO CALL OF 2.74 CHAINS (180.84'). THE PIPE WAS FOUND BENT SEVERELY TO THE WEST BY A LARGE ROOT. I CHOPPED OUT THE ROOT AND SET A STANDARD FOREST SERVICE MONUMENT AT THE BASE OF THE PIPE AND RESET THE PIPE NORTH OF THE MONUMENT.

TWO BROUGHTON LUMBER COMPANY TAGS AND BLAZES WERE RECOVERED ON TWO TREES APPROXIMATELY 1000' & 1500' WEST OF THE SOUTHEAST CORNER OF SECTION 33. THESE TAGS ARE WITHIN 3' OF THE 2023 POSTED BOUNDARY LINE.

THE NORTH QUARTER CORNER OF SECTION 5 ONLY AND THE WEST 1/16 OF SECTION 5 ONLY WERE SET ACCORDING TO THE "2009 MANUAL OF SURVEYING INSTRUCTIONS" CHAPTERS 3-21, 3-26 & 7-23. SINCE THE 1901 GLO SURVEY SET THE CORNERS OF T. 3 & 4 N., R. 9 E. SIMULTANEOUSLY, I UPHELD THE INTENT TO SET MONUMENTS ON THE SAME RHUMB LINE BETWEEN THE SOUTH QUARTER CORNER OF SECTION 32 & THE SECTION CORNER COMMON TO SECTIONS 31 & 32 AND PROPORTIONED BETWEEN THE NORTHEAST AND NORTHWEST CORNERS OF SECTION 5.

A TRESPASS IN THE SOUTHEAST QUARTER OF SECTION 32 WAS DISCOVERED DURING THIS SURVEY. NO SURVEY OF RECORD WAS RECOVERED FOR THE TIMBER HARVEST ON BROUGHTON TIMBER LANDS AND NO SURVEY MARKERS WERE FOUND ALONG THE TIMBER HARVEST LINE. ONE OLD, CORRODED "NATIONAL FOREST BOUNDARY" SIGN WAS FOUND THAT FIT WITHIN A FEW FEET OF THE POSTED BOUNDARY LINE BUT NO OTHER SIGNS WERE RECOVERED. TREE RINGS OF THE NEW PLANTED TREES INDICATE THAT THEY ARE APPROXIMATELY 8 YEARS OLD.

METHOD AND PROCEDURE

CONTROL FOR THIS PROJECT WAS SET IN JUNE 2023 BY R. DIECKMANN, PLS AND ASSISTED BY D. LONDEN, R. ELLIS, S. DESHONG AND C. CLARK. PRIMARY CONTROL WAS SET USING STATIC SESSIONS AT POINTS 1, 2 & 5 AND POST-PROCESSED THROUGH THE ONLINE POSITIONING USER SERVICE (OPUS) AND TRIMBLE BUSINESS CENTER. ALL GPS WORK WAS PERFORMED WITH TRIMBLE R12 & R10 BASES (3MM+0.5PPM RMS). SECONDARY CONTROL WAS COLLECTED BY A CLOSED-LOOP TRAVERSE USING A 3-SECOND TRIMBLE S7 TOTAL STATION WITH EDM (1MM+2PPM). THE TRAVERSE WAS ADJUSTED BY LEAST SQUARES NETWORK ADJUSTMENT IN TRIMBLE BUSINESS CENTER. ALL WORK MET OR EXCEEDED THE MINIMUM STANDARDS SET FORTH IN WAC 332-130-085.

COORDINATES SHOWN ARE WASHINGTON STATE PLANE SOUTH NAD83(2011) (EPOCH 2010.0000). DISTANCES SHOWN HEREON ARE GROUND DISTANCES IN US SURVEY FEET, BEARINGS SHOWN HEREON ARE MEAN GEODETIC BEARINGS. COMBINED SCALE FACTOR IS 0.99989493 AND THE CONVERGENCE ANGLE AT POINT 1 IS -0°52'34". DATA OBTAINED FROM NGS OPUS DERIVED SOLUTIONS UTILIZING THE FOLLOWING CORS STATIONS:

DG8349 PACKWOODF WA2004 MSH_SESLPEWA2004 DH4131 KELSO_AIR_WA2007 DK4153

BEARINGS AND DISTANCES TO BEARING TREES WERE TAKEN WITH A HAND COMPASS (MAGNETIC DECLINATION 16°E) AND MEASURED TO A MAG NAIL AND WASHER SIDE-CENTER. MONUMENTS SET IN THIS SURVEY CONSIST OF A 3-1/4" ALUMINUM CAP ON A 2-1/2" (OUTSIDE DIAMETER) x 28" LONG ALUMINUM PIPE WITH A MAGNET INSIDE. ALL NEW BEARING TREES ARE MEASURED TO A 2" BRASS WASHER AND MAG NAILED SIDE-CENTER INSCRIBED "OR PLS 89906" "WA PLS 20100531". STANDARD 54-3 BEARING TREE SIGNS WERE ATTACHED TO THE FRONT AND 54-9 LAND SURVEY MONUMENT SIGNS ATTACHED TO THE BACK OF ALL BEARING TREES. STANDARD 54-2 PROPERTY BOUNDARY AND 54-9 LAND SURVEY MONUMENT SIGNS WERE PLACED ON ALUMINUM POSTS WITHIN 5' OF THE PROPERTY BOUNDARY LINE MONUMENTS. BOUNDARY POSTS ARE SET AT APPROXIMATE 150' INTERVALS ALONG THE INDICATED LINE AND TREES WITHIN 2' EACH SIDE OF THE BOUNDARY WERE BLAZED. TREES ON THE GOVERNMENT SIDE ARE BLAZED WITH 2 QUARTER BLAZES, TREES ON PRIVATE SIDE ARE BLAZED WITH 1 QUARTER BLAZE. TREES THAT ARE ON THE BOUNDARY LINE HAVE 1 QUARTER

CONTROL POINTS			
PT #	NORTHING	EASTING	DESCRIPTION
1	165697.917	1332738.145	SET 5/8" REBAR AND CAP "USFS CONTROL"
			WITH TACK OFF-CENTER
2	167594.064	1349347.049	SET 5/8" REBAR AND CAP "USFS CONTROL"
5	160420.207	1329541.694	SET 5/8" REBAR AND CAP "USFS CONTROL"

LEGEND

- SET 3-1/4" ALUMINUM CAP ON 2-1/2"x28" LONG ALUMINUM PIPE, SET AUGUST 2023
- FOUND MONUMENT AS NOTED (JUNE-JULY 2023)
- PROPERTY BOUNDARY MARKED WITH 6' **ALUMINUM POSTS AND 54-2 PROPERTY BOUNDARY SIGN, APPROX. 150'** INTERVALS

ADMINISTRATIVE BOUNDARY BETWEEN GIFFORD PINCHOT NATIONAL FOREST AND **SXXXXXX** COLUMBIA RIVER GORGE NATIONAL SCENIC AREA MARKED WITH 6' ALUMINUM POSTS, APPROX. 150' INTERVALS

- MONUMENT NUMBER, SEE "MONUMENT **DETAILS**"
- AFN AUDITOR'S FILE NUMBER
- (#) SURVEY REFERENCE NUMBER, SEE SHEET 3

SHEET INDEX

- PURPOSE, BASIS OF BEARING, SURVEYOR'S REPORT, METHOD AND PROCEDURE, CONTROL COORDINATES, LEGEND, FOREST SERVICE APPROVAL, INDEX
- CORNER HISTORY AND MONUMENTATION (#6-11), HISTORY OF SURVEYS, SURVEY REFERENCES

REVIEWED BY

I CERTIFY THAT THIS SURVEY WAS PERFORMED AT THE REQUEST OF THE GIFFORD PINCHOT NATIONAL FOREST SUPERVISOR

SIGNATURE



UNITED STATES DEPARTMENT OF AGRICULTURE FOREST SERVICE- REGION 6

COLUMBIA LANDS ZONE 987 McCLELLAN ROAD VANCOUVER, WA 98661

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE GIFFORD PINCHOT NATIONAL FOREST IN NOVEMBER 2022.

whe famb ERIELLE F. LAMB, PLS #20100531 12/12/2023



AUDITOR'S CERTIFICATE

CORNER HISTORY AND MONUMENTATION (#1-5)

FILED FOR RECORD THIS MAY OF DECEMBER. 2023 AT 3:18 M. IN BOOK ___ OF ___ AT PAGE ___, AT THE REQUEST OF ERIELLE F. LAMB, PLS. Moha Dichlans AFN: 2023-001875

COUNTY AUDITOR 2023-00/875 AUDITOR'S FILE NUMBER

CALC BY: EFL CHECK BY: RJD

DRAWN BY: EFL


SHEET 1 OF 3



RECORD OF SURVEY

LOCATED IN THE GIFFORD PINCHOT NATIONAL FOREST WITHIN THE SE1/4SE1/4 SECTION 31, SW1/4SW1/4, SE1/4SW1/4, SW1/4SE1/4 & SE1/4SE1/4 SECTION 32. SW1/4SW1/4. SE1/4SW1/4. SW1/4SE1/4 & SE1/4SE1/4 SECTION 33, T.4 N., R.9 E., W.M. SKAMANIA COUNTY, STATE OF WASHINGTON **AUGUST 2023**

MONUMENT DETAILS

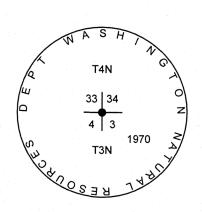

1. SECTION CORNER COMMON TO SECTIONS 3 & 4, T. 3 N., R. 9 E., AND SECTIONS 33 & 34, T. 4 N., R. 9 E. 1880- SHELTON SET A POST, 4" SQUARE, 24" ABOVE GROUND MARKED "T4NS34" ON NORTHEAST, "R9ES3" ON SOUTHEAST, "T3NS4" ON SOUTHWEST AND "S33" ON NORTHWEST FACES WITH 3 NOTCHES ON THE EAST AND WEST EDGES.

18" FIR BEARS N52°30'E 25 LINKS MARKED "T4NR9ES34BT"

24" FIR BEARS S56°E 70 LINKS MARKED "T3NR9ES3BT"

4" WILLOW BEARS S76°W 16 LINKS MARKED "T3NR9ES4BT" 15" FIR BEARS N45°W 25 LINKS MARKED "T4NR9ES33BT"

1895- RICHARDSON FOUND A POST, 4" SQUARE, 24" ABOVE GROUND MARKED "T4NS34" ON NORTHEAST.

"R9ES3" ON SOUTHEAST, "T3NS4" ON SOUTHWEST AND "S33" ON NORTHWEST FACES WITH 3 NOTCHES ON THE EAST AND WEST EDGES.

18" FIR BEARS N52°30'E 25 LINKS MARKED "T4NR9ES34BT"

24" FIR BEARS S56°E 70 LINKS MARKED "T3NR9ES3BT"

4" WILLOW BEARS S76°W 16 LINKS MARKED "T3NR9ES4BT"

15" FIR BEARS N45°W 25 LINKS MARKED "T4NR9ES33BT"

1901- GESNER & GESNER FOUND A 3" SQUARE FIR POST 3' ABOVE GROUND MARKED "T4NS34" ON

NORTHEAST, "T3NS3" ON THE SOUTHEAST, "R9ES4" ON SOUTHWEST AND "S33" ON NORTHWEST FACES WITH 3 NOTCHES ON THE EAST AND WEST EDGES

20" RED FIR BEARS N52°30'E 25 LINKS MARKED "T4NR9ES34BT"

30" RED FIR BEARS S56°E 70 LINKS MARKED "T3NR9ES3BT"

6" WILLOW BEARS S76°W 16 LINKS MARKED "T3NR9ES4BT" 18" RED FIR BEARS N45°W 25 LINKS MARKED "T4NR9ES33BT"

1970- C. WHITTEN (DEPARTMENT OF NATURAL RESOURCES) FOUND 2 BEARING TREES WITH SCRIBING AND

AN IRON PIPE. SET A STANDARD DNR MONUMENT AT POSITION OF IRON PIPE.

36" FIR BEARS N60°E 15.41'

12" HEMLOCK BEARS S46°E 27.19'

6" FIR BEARS S62°W 21.26'

1988- TRANTOW (AFN 105269) FOUND A DNR STANDARD CONCRETE MONUMENT WITH BRASS CAP, ONE BEARING TREE AND TWO WITNESS TREES

36" DOUG FIR STUMP WITH 18"X18" FACE BEARS N62°E 17.05' TO CENTER OF STUMP WITH USFS WITNESS

6" WESTERN HEMLOCK BEARS N18°E 14.50' TO NAIL AT CENTER OF TREE, NOT SCRIBED

3" WESTERN HEMLOCK BEARS S40°W 28.32' TO NAIL AT CENTER OF TREE, NOT SCRIBED

2023- FOUND 3" DNR BRASS CAP ON 3.5"X4" CONCRETE POST, 9.5" HIGH

FOUND BEARING TREES

38" DOUG FIR BEARS N52°E 17' WITH HEALED BLAZE

6" DOWN FIR SNAG BEARS S62°W 21.26'

16" HEMLOCK BEARS S34°E 23.4"

21" HEMLOCK BEARS S71°W 23.8'

NEW BEARING TREE

14" DOUG FIR BEARS N12°W 47.1' SCRIBED "BTT4NR9ES33" WITH MAG & WASHER 4" HIGH

SET GUARD POST ON PROPERTY BOUNDARY LINE WEST OF MONUMENT

2. QUARTER CORNER FOR SECTION 33 ONLY

1892- RICHARDSON SET A 4' LONG POST, 3" SQUARE, 24" IN THE GROUND MARKED "1/4S" ON THE NORTH FACE

4" HEMLOCK BEARS SOUTH 8 LINKS MARKED "1/4SBT" 4" HEMLOCK BEARS N40°E 8 LINKS MARKED "1/4SBT"

1901- GESNER & GESNER FOUND A 3" SQUARE HEMLOCK POST 2-1/2' ABOVE GROUND MARKED "1/4S" ON THE


2023- FOUND 1-1/4" AXLE, 1' ABOVE GROUND. AXLE LOCATION FIT 1901 GLO CREEK CALL SO ACCEPTED POSITION AND REMONUMONTED WITH 3-1/4" ALUMINUM CAP ON 2-1/2"x28" ALUMINUM PIPE, 5" ABOVE

17" DOUG FIR BEARS N30°E 7.18' WITH HEALED QUARTER BLAZE 1.5' ABOVE GROUND. DISTANCE IS TO SET

30" CEDAR BEARS S69°E 3.5' WITH AX HACK 4' ABOVE GROUND. FOUND UNREADABLE DNR LOCATION

22" DOUG FIR BEARS N15°W 28.0' SCRIBED "T4NR9ES33BT" WITH MAG & WASHER RIGHT SIDE-CENTER

SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND WEST OF MONUMENT

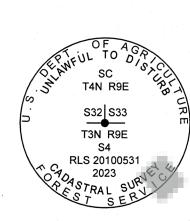

T4N

CC

S5 S4

LS 16337

S32

LS 16337

—**●**—R9E

R9E

MONUMENT DETAILS CONTINUED

3. SECTION CORNER COMMON TO SECTIONS 32 & 33 ONLY

1892- RICHARDSON SET A 4' LONG POST, 4" SQUARE, 24" IN THE GROUND FOR SECTION CORNER COMMON TO SECTIONS 4, 5, 32 & 33 MARKED "T4NS33" ON NORTHEAST, "R9ES4" ON SOUTHEAST, "T3NS5" ON SOUTHWEST AND "S32" ON NORTHWEST WITH 4 NOTCHES ON EAST AND 2 ON WEST EDGES.

15" HEMLOCK BEARS N8°E 53 LINKS MARKED "T4NR9ES33BT"

5" HEMLOCK BEARS S35°E 41 LINKS MARKED"T3NR9ES4BT"

8" HEMLOCK BEARS S3°30'W 19 LINKS MARKED "T3NR9ES5BT"

8" HEMLOCK BEARS N58°W 20 LINKS MARKED "T4NR9ES32BT"

1901- GESNER & GESNER FOUND A 3" SQUARE POST, 3' ABOVE GROUND MARKED "T4NS33" ON THE

NORTHEAST, "R9ES32" ON THE NORTHWEST, "T3NS5" ON THE SOUTHWEST AND "S4" ON THE SOUTHEAST FACES WITH 4 NOTCHES ON THE EAST AND 2 NOTCHES ON THE WEST SIDE.

15" HEMLOCK BEARS N80°E 53 LINKS MARKED "T4NR9ES33BT"

3" HEMLOCK BEARS \$45°E 41 LINKS MARKED "T3NR9ES4BT" (DESTROYED FOR CLOSING CORNER)

8" HEMLOCK BEARS \$3°30'W 19 LINKS MARKED "T3NR9ES5BT" (DESTROYED FOR CLOSING CORNER)

8" HEMLOCK BEARS N58°W 20 LINKS MARKED T4NR9ES32BT" 2023- FOUND 1-1/2" IRON PIPE, BENT SEVERELY WEST. HELD FOR CORNER LOCATION. SET 3-1/4" ALUMINUM

CAP ON 2-1/2" ALUMINUM PIPE AT PIPE LOCATION. SET IRON PIPE 10" NORTHWEST OF MONUMENT. **NEW BEARING TREES:**

30" DOUG FIR BEARS N45°W 18.05' WITH MAG & WASHER LEFT SIDE-CENTER MARKED "T4NR9ES32BT" WITH **HEALED AX HACK 5' HIGH**

26" DOUG FIR BEARS N25°E 27.05' TO MAG & WASHER LEFT SIDE-CENTER MARKED "T4NR9ES33BT" SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND WEST OF MONUMENT

SECTION CORNER FOR SECTIONS 4 & 5 ONLY

901- GESNER & GESNER SET AN 18"X12"X5" BASALT STONE, 10" IN GROUND MARKED "CC" ON THE SOUTH SIDE WITH 4 NOTCHES ON THE EAST AND 2 NOTCHES ON THE WEST SIDE

24" HEMLOCK BEARS S20°E 61 LINKS MARKED "CCT3NR9ES4BT"

42" RED FIR BEARS S52°W 27 LINKS MARKED "CCT3NR9ES5BT"

1978- BISHOP (AFN 87117) SET A 3" BRASS CAP ON A 2"X30" IRON PIPE FROM A FOUND GLO BEARING TREE (44" DOUG FIR STUMP WITH BLAZE AND SCRIBING S52°E 17.8'). THE STONE WAS UNABLE TO BE FOUND. A PIPE SET BY BROUGHTON LUMBER COMPANY ENGINEER WAS RECOVERED BUT NO MENTION OF ITS RELATION TO THE CORNER.

20" DOUG FIR BEARS S16°E 6.4' WITH GROWN OVER BLAZE

14" DOUG FIR BEARS SOUTH 1.2' WITH GROWN OVER OPEN BLAZE FACING EAST

18" DOUG FIR BEARS S35°30'W 26.9' SCRIBED "T3NR9ES5BT"

2023- FOUND 3" BRASS CAP ON 3" IRON PIPE, 1/2" ABOVE GROUND.

FOUND BEARING TREES

26" FIR SNAG BEARS S34°W 26.1' WITH OLD HEALED BLAZE

28" DOUG FIR SNAG BEARS S22°E 6.15' WITH OLD HEALED BLAZE

21" FIR STUMP BEARS \$11°E 2' WITH OLD HEALED BLAZE FACING OLD CORNER LOCATION (EASTERLY) NEW BEARING TREES

19" HEMLOCK BEARS S40°W 37.15' BLAZED "T3NR9ES5CCBT" WITH MAG & WASHER RIGHT SIDE-CENTER 1' HIGH

5" HEMLOCK BEARS S68°W 38.8' BLAZED "XBT" WITH MAG & WASHER RIGHT SIDE-CENTER 2' HIGH 34" DOUG FIR BEARS S52°E 41.17' BLAZED "T3NR9ES4CCBT" WITH MAG & WASHER LEFT SIDE-CENTER 1' HIGH

26" DOUG FIR BEARS S50°E 59.90' BLAZED "XBT" WITH MAG & WASHER LEFT SIDE-CENTER 1' HIGH SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND WEST OF MONUMENT

SOUTH QUARTER CORNER TO SECTION 32 ONLY

1901- GESNER & GESNER SET A 4-1/2' LONG CEDAR POST, 4" SQUARE, 24" IN GROUND MARKED "1/4S32" ON THE

12" HEMLOCK BEARS N73°E 4 LINKS MARKED "1/4S32BT"

8" RED FIR BEARS S58°W 24 LINKS MARKED "1/4SBT"

1978- BISHOP (AFN 87127) FOUND A 2" PIPE FILLED WITH CONCRETE SET BY AN UNKNOWN PARTY AND A 10" FELLED DOUG FIR SNAG WITH VISIBLE SCRIBING S58°W 15.85'. HE SET A 3" BRASS CAP ON A 2"X30" GALVANIZED IRON PIPE.

14" DOUG FIR BEARS N29°W 18.4' SCRIBED "1/4S32BT"

7" DOUG FIR BEARS S26°W 4.5' SCRIBED "1/4SBT"

2023- FOUND 3" BRASS CAP ON 3" GALVANIZED IRON POST 3" ABOVE DUFFY GROUND.

FOUND BEARING TREES:

7" ROTTED, DOWN FIR BEARS S26°W 4.5'

20" DOUG FIR BEARS N29°W 18.9' WITH HEALED BLAZE

12" DOUG FIR BEARS S74°E 7.21' WITH OLD 1963 BROUGHTON TAG AND HEALED BLAZE

NEW BEARING TREES: 11" HEMLOCK BEARS N72°W 27.68' SCRIBED "1/4S32BT" WITH MAG & WASHER SET RIGHT SIDE-CENTER 15" HIGH


6" CEDAR BEARS N42°E 8.33' SCRIBED "XBT" WITH MAG & WASHER RIGHT SIDE-CENTER 6" HIGH SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND WEST OF MONUMENT



DRAWN BY: EFL CALC BY: EFL CHECK BY: RJD

SHEET 2 OF 3

T4N R9E 1/4 S33 T3N R9E RLS 20100531 CADASTRAL.

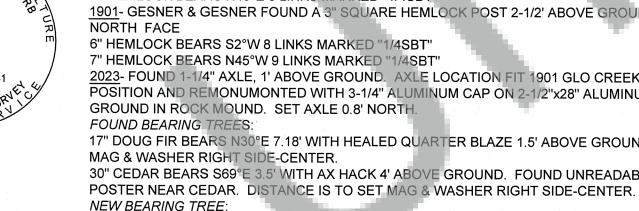



UNITED STATES DEPARTMENT OF AGRICULTURE FOREST SERVICE- REGION 6

> COLUMBIA LANDS ZONE 987 McCLELLAN ROAD

VANCOUVER, WA 98661

RECORD OF SURVEY

LOCATED IN THE GIFFORD PINCHOT NATIONAL FOREST WITHIN THE SE1/4SE1/4 SECTION 31, SW1/4SW1/4, SE1/4SW1/4, SW1/4SE1/4 & SE1/4SE1/4 SECTION 32, SW1/4SW1/4, SE1/4SW1/4, SW1/4SE1/4 & SE1/4SE1/4 SECTION 33, T.4 N., R.9 E., W.M. SKAMANIA COUNTY, STATE OF WASHINGTON AUGUST 2023


MONUMENT DETAILS CONTINUED

T4N R9E T4N R9E T4N R9E T3N R9E RLS 20100531 2023 RUE CALLER COLUMN THE CALLER COLUMN THE CALLER COLUMN THE CALLER CALLER

6. NORTH QUARTER CORNER OF SECTION 5 ONLY

NOT PREVIOUSLY SET 2023- SET 3-1/4" ALUMINUM CAP ON 2-1/2"x28" ALUMINUM PIPE, 6" ABOVE GROUND. NEW BEARING TREES:

9" HEMLOCK BEARS S69°E 21.48' SCRIBED "1/4S5BT" WITH MAG & WASHER LEFT SIDE-CENTER 6" HIGH 23" DOUG FIR BEARS S49°W 23.3' SCRIBED "1/4S5BT" WITH MAG & WASHER LEFT SIDE-CENTER 16" HIGH SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND WEST OF MONUMENT

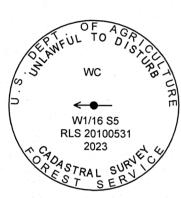

7. WEST 1/16 OF SECTION 5 ONLY

NOT PREVIOUSLY SET

2023- 13" DOUG FIR IS AT TRUE CORNER LOCATION, SET WITNESS CORNER 4' EAST ON PROPERTY BOUNDARY LINE. SET 3-1/4" ALUMINUM CAP ON 2-1/2"x28" ALUMINUM PIPE AS WITNESS CORNER, 6" ABOVE GROUND. NEW BEARING TREES:

17" DOUG FIR BEARS S16°W 10.30' SCRIBED "X" "BT" WITH MAG & WASHER RIGHT SIDE-CENTER 2" HIGH 20" CEDAR BEARS S35°E 13.05' SCRIBED "X" "BT" WITH MAG & WASHER RIGHT SIDE-CENTER 9" HIGH BOTH "X"S WERE BARK SCRIBED AT BREAST HEIGHT

SET GUARD POSTS ON PROPERTY BOUNDARY LINE EAST AND ADMINISTRATIVE BOUNDARY WEST OF MONUMENT



8. SECTION CORNER COMMON TO SECTIONS 31 & 32 ONLY

1901- GESNER & GESNER SET A 5' LONG HEMLOCK POST, 4" SQUARE, 24" IN THE GROUND MARKED "T4NS32" ON THE NORTHEAST AND "R9ES31" ON THE NORTHWEST WITH 5 NOTCHES ON THE EAST AND 1 NOTCH ON THE WEST EDGES.

10" RED FIR BEARS N76°E 29 LINKS MARKED "T4NR9ES32BT"

24" RED FIR BEARS N50°W 31 LINKS MARKED "T4NR9ES31BT"

1978- BISHOP (AFN 87125) FOUND THE N50°W FIR SNAG AND A FIR STUMP HOLE. HE SET A 3" BRASS CAP ON A 2"X30" IRON PIPE.

19" HEMLOCK BEARS N86°W 31.6' SCRIBED "T4NR9ES31BT"

28" DOUG FIR BEARS N16°E 49.8' BARK SCRIBED "T4NR9ES32BT"

2023- FOUND 3" BRASS CAP ON 2-1/2" IRON PIPE, 5" ABOVE GROUND. DID NOT RECOVER ANY PREVIOUS BEARING TREES

NEW BEARING TREES:

13" DOUG FIR BEARS N32°E 21.1' SCRIBED "BT4N9ES32" WITH MAG & WASHER RIGHT SIDE-CENTER 6" HIGH 11" DOUG FIR BEARS N26°W 12.97' SCRIBED "T4NR9ES31BT" WITH MAG & WASHER RIGHT SIDE-CENTER 6" HIGH 11" HEMLOCK BEARS N70°W 36.69' SCRIBED "T4NR9ES31BT" WITH MAG & WASHER LEFT SIDE-CENTER 10" HIGH 12" HEMLOCK BEARS N60°E 37.15' SCRIBED "T4NR9ES32BT" WITH MAG & WASHER RIGHT SIDE-CENTER 6" HIGH

SET GUARD POSTS ON ADMINISTRATIVE BOUNDARY LINE EAST AND WEST OF MONUMENT

HISTORY OF SURVEYS

JUNE 1880- LEWIS D. W. SHELTON SURVEYED SUBDIVISIONS OF TOWNSHIP 3 NORTH, RANGE 9 EAST. IN THIS SURVEY, HE SET THE SECTION CORNER COMMON TO SECTIONS 33, 34, 3 & 4. JUNE 1892- JACOB RICHARDSON, UNDER CONTRACT 383, SURVEYED THE SOUTH BOUNDARY OF TOWNSHIP 4 NORTH, RANGE 9 EAST. IN THIS SURVEY, HE SURVEYED THE SOUTH LINE OF SECTION 33.

NOVEMBER 1901- ALONZO AND FRANK X. GESNER, UNDER CONTRACT 571, RETRACED THE SOUTH BOUNDARY OF SECTION 33 AND SURVEYED THE REST OF THE SOUTH BOUNDARY OF TOWNSHIP 4 NORTH, RANGE 9 EAST. THE SURVEY COMMENCED AT THE CORNER COMMON TO SECTIONS 32, 33, 4 & 5 AND CLOSED AT THE TOWNSHIP CORNER AT 162.08 CHAINS.

1970- CHUCK WHITTEN OF THE DEPARTMENT OF NATURAL RESOURCES PERFORMED REMONUMENTATION OF THE SECTION CORNER COMMON TO SECTIONS 33, 34, 3 & 4.

1978- LARRY BISHOP PERFORMED REMONUMENTATION OF CORNERS IN SECTION 31, 32, 4 & 5 ALONG THE TOWNSHIP LINE.

2023- US FOREST SERVICE PERFORMED A SURVEY ALONG THE TOWNSHIP LINE TO SUPPORT LAND MANAGEMENT ACTIVITIES IN NATIONAL FOREST SYSTEM LANDS.



UNITED STATES DEPARTMENT OF AGRICULTURE FOREST SERVICE- REGION 6

COLUMBIA LANDS ZONE

987 McCLELLAN ROAD VANCOUVER, WA 98661



MONUMENT DETAILS CONTINUED

9. SECTION CORNER FOR SECTIONS 5 & 6 ONLY

1901- GESNER & GESNER SET A 4-1/2' LONG HEMLOCK POST, 4.5" SQUARE, 24" IN THE GROUND MARKED "CC" ON THE SOUTH, "T3NS5" ON THE EAST AND "R9ES6" ON THE WEST WITH 5 GROOVES ON THE EAST AND 1 GROOVE ON THE WEST SIDE

26" RED FIR BEARS S59°E 16 LINKS MARKED "CCT3NR9ES5BT"

10" HEMLOCK BEARS S58°30'W 33 LINKS MARKED "CCT3NR9ES6BT"

1978- BISHOP (AFN 87121) FOUND A 32" DOUG FIR S59°E 10.5' WITH OPEN FACE AND VISIBLE SCRIBING AND A 10" HEMLOCK S59°W 21.8' WITH VISIBLE SCRIBING. HE SET A 3" BRASS CAP ON A 2"X30" IRON PIPE FROM BOTH GLO BEARING TREES. NO NEW BEARING TREES WERE MARKED.

2023- FOUND 3" BRASS CAP ON 2-1/2" IRON PIPE, SLOPING NORTHEASTERLY.

FOUND BEARING TREES
ROTTED DOUG FIR STUMP, UPROOTED AND SLOPING NORTHEASTERLY WITH SCRIBING IN FACE OF ROOT BASE

SOUTHWEST HEMLOCK (\$59°E) IS GONE/DISINTEGRATED NEW BEARING TREES

12" HEMLOCK BEARS S50°W 11.49' SCRIBED "T3NR9ES6CCBT" WITH MAG & WASHER LEFT SIDE-CENTER 1' HIGH 7" HEMLOCK BEARS S66°W 20.17' SCRIBED "XBT" WITH MAG & WASHER LEFT SIDE-CENTER 7" HIGH

11" HEMLOCK BEARS S44°E 26.15' SCRIBED "XBT" WITH MAG & WASHER EEFT SIDE-CENTER 7" HIGH

13" DOUG FIR BEARS S74°E 50.22' SCRIBED "T3NR9ES5CCBT" WITH MAG & WASHER LEFT SIDE-CENTER 11" HIGH

SET GUARD POSTS ON ADMINISTRATIVE BOUNDARY EAST AND WEST OF MONUMENT

1978

T4N

E1/16 ----- R9E

T3N

LS16337

R9E

CC

S6 S5

T3N

1978

LS 16337

T4N

10. ANGLE POINT 107, COLUMBIA RIVER GORGE NATIONAL SCENIC AREA BOUNDARY

NOT PREVIOUSLY SET

2023- SET 3-1/4" ALUMINUM CAP ON 2-1/2"x28" ALUMINUM PIPE 6" ABOVE GROUND IN COLLAR OF STONES AT CALL "INTERSECTION WITH NORTH LINE OF SEC 06, T. 03 N., R. 09 E." AND "CREST OF RIDGE LINE"

NEW BEARING TREES:

10" DOUG FIR BEARS N76°W 6.35" SCRIBED "AP107BT" WITH MAG & WASHER RIGHT SIDE-CENTER 1" HIGH 12" HEMLOCK BEARS S33°W 21.75" SCRIBED "AP107BT" WITH MAG & WASHER RIGHT SIDE-CENTER 4" HIGH

SET GUARD POST ON ADMINISTRATIVE BOUNDARY NORTHWEST AND EAST OF MONUMENT

11. EAST 1/16 CORNER OF SECTION 6 ONLY

1978- BISHOP (AFN 87124) SET A 3" BRASS CAP ON A 2"X30" IRON PIPE.

20" DOUG FIR BEARS N67°E 9.5' SCRIBED "1/16BT"

26" DOUG FIR BEARS S23°E 17.2' SCRIBED "E1/16S6BT" 2023- FOUND 3" BRASS CAP ON 2" GALVANIZED IRON PIPE, LAYING SIDEWAYS ON THE GROUND. STRAIGHTENED

AND RE-MOUNDED CORNER WITH COLLAR OF ROCKS.

FOUND BEARING TREE:

27" DOUG FIR BEARS N67°E 9.5 WITH HEALED BLAZE NEW BEARING TREE:

29" DOUG FIR BEARS \$53°W 39.9' WITH OLD HEALED BLAZE, DID NOT PLACE NEW WASHER.

SURVEY REFERENCES

1. 1880 GLO SURVEY BY LEWIS D.W. SHELTON

2. 1892 GLO SURVEY BY JACOB RICHARDSON, UNDER CONTRACT 383

3. 1901 GLO SURVEY BY ALONZO AND FRANK X. GESNER, UNDER CONTRACT 571

 1978 LARRY BISHOP SURVEY, BOOK 1 OF SURVEYS AT PAGE 164, SKAMANIA COUNTY AUDITOR RECORDS (AFN 87112)

5. 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 3/9 OF MONUMENTS AT PAGE 5, SKAMANIA COUNTY AUDITOR RECORDS (AFN 87117)

 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 3/9 OF MONUMENTS AT PAGE 9, SKAMANIA COUNTY AUDITOR RECORDS (AFN 87121)
 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 3/9 OF MONUMENTS AT PAGE 12.

SKAMANIA COUNTY AUDITOR RECORDS (AFN 87124)

8. 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 4/9 OF MONUMENTS AT PAGE 11,

SKAMANIA COUNTY AUDITOR RECORDS (AFN 87125)

9. 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 3/9 OF MONUMENTS AT PAGE 12,

SKAMANIA COUNTY AUDITOR RECORDS (AFN 87126)

10. 1978 LARRY BISHOP LAND CORNER RECORD, BOOK 4/9 OF MONUMENTS AT PAGE 13, SKAMANIA COUNTY AUDITOR RECORDS (AFN 87127)

11. 1988 TRANTOW SURVEYING LAND CORNER RECORD, BOOK 3/9 OF MONUMENTS AT PAGE 37, SKAMANIA COUNTY AUDITOR RECORDS (AFN 105269)

DRAWN BY: EFL CALC BY: EFL CHECK BY: RJD

SHEET 3 OF 3